



## POSITIP 8000

Operating Instructions  
Turning

Digital Readout

## Contents

<b>1</b>	<b>Fundamentals.....</b>	<b>17</b>
<b>2</b>	<b>Safety.....</b>	<b>27</b>
<b>3</b>	<b>Transport and storage.....</b>	<b>33</b>
<b>4</b>	<b>Mounting.....</b>	<b>39</b>
<b>5</b>	<b>Installation.....</b>	<b>45</b>
<b>6</b>	<b>Basic operation.....</b>	<b>57</b>
<b>7</b>	<b>Commissioning.....</b>	<b>91</b>
<b>8</b>	<b>Setup.....</b>	<b>135</b>
<b>9</b>	<b>Quick Start.....</b>	<b>153</b>
<b>10</b>	<b>Manual operation.....</b>	<b>171</b>
<b>11</b>	<b>MDI mode.....</b>	<b>179</b>
<b>12</b>	<b>Program run.....</b>	<b>191</b>
<b>13</b>	<b>Programming.....</b>	<b>201</b>
<b>14</b>	<b>File management.....</b>	<b>213</b>
<b>15</b>	<b>Settings.....</b>	<b>221</b>
<b>16</b>	<b>Servicing and maintenance.....</b>	<b>281</b>
<b>17</b>	<b>What to do if .....</b>	<b>295</b>
<b>18</b>	<b>Removal and disposal.....</b>	<b>301</b>
<b>19</b>	<b>Specifications.....</b>	<b>303</b>
<b>20</b>	<b>Index.....</b>	<b>310</b>
<b>21</b>	<b>List of figures.....</b>	<b>313</b>

<b>1</b>	<b>Fundamentals.....</b>	<b>17</b>
1.1	Overview.....	18
1.2	Information on the product.....	18
1.3	Overview of new and modified functions.....	18
1.4	Demo software for the product.....	18
1.5	Documentation on the product.....	19
1.5.1	Validity of the documentation.....	19
1.5.2	Notes on reading the documentation.....	20
1.5.3	Storage and distribution of the documentation.....	21
1.6	About these instructions.....	21
1.6.1	Document category.....	21
1.6.2	Target groups for the instructions.....	21
1.6.3	Target groups according to user types.....	22
1.6.4	Contents of the chapters.....	22
1.6.5	Notes in this documentation.....	24
1.6.6	Symbols and fonts used for marking text.....	25
<b>2</b>	<b>Safety.....</b>	<b>27</b>
2.1	Overview.....	28
2.2	General safety precautions.....	28
2.3	Intended use.....	28
2.4	Improper use.....	28
2.5	Personnel qualification.....	29
2.6	Obligations of the operating company.....	29
2.7	General safety precautions.....	30
2.7.1	Symbols on the product.....	30
2.7.2	Electrical safety precautions.....	31

<b>3</b>	<b>Transport and storage.....</b>	<b>33</b>
3.1	Overview.....	34
3.2	Unpacking.....	34
3.3	Items supplied and accessories.....	34
3.3.1	Items supplied.....	34
3.3.2	Accessories.....	35
3.4	In case of damage in transit.....	36
3.5	Repackaging and storage.....	36
3.5.1	Repackaging the product.....	37
3.5.2	Storage of the product.....	37
<b>4</b>	<b>Mounting.....</b>	<b>39</b>
4.1	Overview.....	40
4.2	Assembly of the product.....	40
4.2.1	Mounting on Single-Pos stand.....	41
4.2.2	Mounting on Duo-Pos stand.....	42
4.2.3	Mounting on Multi-Pos stand.....	43
4.2.4	Mounting on Multi-Pos holder.....	44
<b>5</b>	<b>Installation.....</b>	<b>45</b>
5.1	Overview.....	46
5.2	General information.....	46
5.3	Device overview.....	47
5.4	Connecting encoders.....	50
5.5	Wiring switching inputs and outputs.....	51
5.6	Connecting input devices.....	54
5.7	Connecting a network peripheral.....	54
5.8	Connecting the line voltage.....	55

<b>6</b>	<b>Basic operation.....</b>	<b>57</b>
<b>6.1</b>	<b>Overview.....</b>	<b>58</b>
<b>6.2</b>	<b>Using the touchscreen and input devices.....</b>	<b>58</b>
6.2.1	Touchscreen and input devices.....	58
6.2.2	Gestures and mouse actions.....	58
<b>6.3</b>	<b>General operating elements and functions.....</b>	<b>60</b>
<b>6.4</b>	<b>POSITIP 8000 – switch-on and switch-off.....</b>	<b>62</b>
6.4.1	Switching on the POSITIP 8000.....	62
6.4.2	Activating and deactivating the energy saving mode.....	62
6.4.3	Switching off the POSITIP 8000.....	63
<b>6.5</b>	<b>User login and logout.....</b>	<b>63</b>
6.5.1	User login.....	64
6.5.2	User logout.....	64
<b>6.6</b>	<b>Setting the language.....</b>	<b>65</b>
<b>6.7</b>	<b>Performing the reference mark search after startup.....</b>	<b>65</b>
<b>6.8</b>	<b>User interface.....</b>	<b>65</b>
6.8.1	User interface after switch-on.....	66
6.8.2	Main menu of the user interface.....	67
6.8.3	Manual operation menu.....	69
6.8.4	MDI menu.....	70
6.8.5	Program run menu.....	72
6.8.6	Programming menu.....	73
6.8.7	File management menu.....	75
6.8.8	User login menu.....	76
6.8.9	Settings menu.....	77
6.8.10	Switch-off menu.....	78
<b>6.9</b>	<b>Position display.....</b>	<b>78</b>
6.9.1	Operating elements of the position display.....	78
6.9.2	Position display functions.....	80
<b>6.10</b>	<b>Status bar.....</b>	<b>82</b>
6.10.1	Operating elements of the status bar.....	82
6.10.2	Adjusting settings in the quick access menu.....	84
6.10.3	Stopwatch.....	85
6.10.4	Calculator.....	85

6.10.5 Setting the feed-rate value..... 86  
 6.10.6 Additional functions in Manual operation mode..... 86

**6.11 OEM bar..... 87**

6.11.1 Operating elements of the OEM bar..... 87  
 6.11.2 Calling functions of the OEM bar.....87

**6.12 Messages and audio feedback.....88**

6.12.1 Messages.....88  
 6.12.2 Wizard..... 89  
 6.12.3 Audio feedback.....90

<b>7</b>	<b>Commissioning</b>	<b>91</b>
<b>7.1</b>	<b>Overview</b>	<b>92</b>
<b>7.2</b>	<b>Logging in for commissioning</b>	<b>92</b>
7.2.1	User login	92
7.2.2	Performing the reference mark search after startup	93
7.2.3	Setting the language	93
7.2.4	Changing the password	94
<b>7.3</b>	<b>Steps for commissioning</b>	<b>94</b>
<b>7.4</b>	<b>Selecting the Application</b>	<b>96</b>
<b>7.5</b>	<b>Basic settings</b>	<b>96</b>
7.5.1	Activating the Software options	96
7.5.2	Setting the date and time	99
7.5.3	Setting the units of measure	99
<b>7.6</b>	<b>Configuring the axes</b>	<b>100</b>
7.6.1	Overview of typical encoders	101
7.6.2	Configuring axes for encoders with EnDat interface	102
7.6.3	Configuring the axes for encoders with a 1 V <sub>PP</sub> or 11 μA <sub>PP</sub> interface	104
7.6.4	Performing error compensation	107
7.6.5	Configuring the spindle axis	110
7.6.6	Configuring Axis+ NC	112
7.6.7	Configuring an Electronic handwheel	114
7.6.8	Coupling axes	115
7.6.9	Activating the reference mark search	116
<b>7.7</b>	<b>Configuring thread cutting (NC software option)</b>	<b>117</b>
<b>7.8</b>	<b>Configuring M functions</b>	<b>117</b>
7.8.1	Standard M functions	118
7.8.2	Manufacturer-specific M functions	118
<b>7.9</b>	<b>OEM area</b>	<b>118</b>
7.9.1	Adding documentation	119
7.9.2	Adding a startup screen	119
7.9.3	Configuring the OEM bar	120
7.9.4	Adjusting the display	126
7.9.5	Defining error messages	126
7.9.6	Backing up and restoring OEM settings	130
7.9.7	Configuring the unit for screenshots	131
<b>7.10</b>	<b>Backing up data</b>	<b>132</b>
7.10.1	Back up settings	132
7.10.2	Back up user files	133

<b>8</b>	<b>Setup.....</b>	<b>135</b>
8.1	Overview.....	136
8.2	Logging in for setup.....	136
8.2.1	User login.....	136
8.2.2	Performing the reference mark search after startup.....	137
8.2.3	Setting the language.....	137
8.2.4	Changing the password.....	138
8.3	Single steps for setup.....	139
8.3.1	Basic settings.....	139
8.3.2	Preparing machining processes.....	147
8.4	Back up settings.....	151
8.5	Back up user files.....	152
<b>9</b>	<b>Quick Start.....</b>	<b>153</b>
9.1	Overview.....	154
9.2	Logging in for Quick Start.....	155
9.3	Requirements.....	155
9.4	Setting up the lathe.....	158
9.4.1	Measuring the reference tool.....	159
9.4.2	Tool measurement.....	160
9.4.3	Finding the preset.....	161
9.5	Roughing the outside contour.....	161
9.6	Turning the recess.....	164
9.7	Turning the chamfer.....	165
9.8	Finishing the outside contour.....	165
9.9	Machining threads.....	168
9.9.1	Defining threads.....	169
9.9.2	Thread cutting.....	170



<b>10 Manual operation.....</b>	<b>171</b>
10.1 Overview.....	172
10.2 Defining the upper limit for the spindle speed.....	173
10.3 Conducting the reference mark search.....	174
10.4 Defining presets.....	175
10.4.1 Touching off presets.....	175
10.4.2 Setting a position as a preset.....	176
10.5 Creating a tool.....	177
10.6 Calibrating tools.....	178
10.7 Selecting a tool.....	178
<b>11 MDI mode.....</b>	<b>179</b>
11.1 Overview.....	180
11.2 Defining the upper limit for the spindle speed.....	182
11.3 Block types.....	183
11.3.1 Positioning.....	183
11.3.2 Machining cycle.....	183
11.4 Executing blocks.....	186
11.5 Using the simulation window.....	187
11.5.1 Depiction as contour view.....	188
11.6 Working with the positioning aid.....	189
11.7 Applying the Scaling factor.....	189

<b>12 Program run.....</b>	<b>191</b>
<b>12.1 Overview.....</b>	<b>192</b>
<b>12.2 Using the program.....</b>	<b>193</b>
12.2.1 Running the program.....	195
12.2.2 Proceeding to a specific program block.....	196
12.2.3 Aborting program run.....	196
12.2.4 Using the simulation window.....	196
12.2.5 Applying the Scaling factor.....	198
12.2.6 Setting the spindle speed.....	199
<b>12.3 Managing programs.....</b>	<b>199</b>
12.3.1 Opening a program.....	199
12.3.2 Closing a program.....	199
<b>13 Programming.....</b>	<b>201</b>
<b>13.1 Overview.....</b>	<b>202</b>
<b>13.2 Block types.....</b>	<b>203</b>
13.2.1 Positioning.....	203
13.2.2 Coordinate systems.....	203
13.2.3 Machine functions.....	204
13.2.4 Machining cycle.....	204
<b>13.3 Creating a program.....</b>	<b>207</b>
13.3.1 Programming support.....	207
13.3.2 Creating a program header.....	208
13.3.3 Adding blocks.....	208
13.3.4 Deleting blocks.....	208
13.3.5 Saving a program.....	208
<b>13.4 Using the simulation window.....</b>	<b>209</b>
13.4.1 Depiction as contour view.....	210
13.4.2 Activating the simulation window.....	210
13.4.3 Checking a program in the simulation window.....	211
<b>13.5 Managing programs.....</b>	<b>211</b>
13.5.1 Opening a program.....	211
13.5.2 Closing a program.....	211
13.5.3 Saving a program.....	211
13.5.4 Saving a program under a new name.....	212
13.5.5 Saving a program automatically.....	212
13.5.6 Deleting a program.....	212
<b>13.6 Editing program blocks.....</b>	<b>212</b>

<b>14 File management.....</b>	<b>213</b>
14.1 Overview.....	214
14.2 File types.....	215
14.3 Managing folders and files.....	215
14.4 Viewing files.....	218
14.5 Exporting files.....	218
14.6 Importing files.....	219

<b>15 Settings.....</b>	<b>221</b>
<b>15.1 Overview.....</b>	<b>222</b>
<b>15.2 General.....</b>	<b>223</b>
15.2.1 Device information.....	223
15.2.2 Screen.....	223
15.2.3 Display.....	224
15.2.4 Simulation window.....	225
15.2.5 Input devices.....	226
15.2.6 Sounds.....	227
15.2.7 Printers.....	227
15.2.8 Date and time.....	227
15.2.9 Units.....	228
15.2.10 Copyrights.....	229
15.2.11 Service info.....	229
15.2.12 Documentation.....	229
<b>15.3 Interfaces.....</b>	<b>230</b>
15.3.1 Network.....	230
15.3.2 Network drive.....	231
15.3.3 USB.....	232
15.3.4 Axes (switching functions).....	232
15.3.5 Position-dependent switching functions.....	232
<b>15.4 User.....</b>	<b>234</b>
15.4.1 OEM.....	234
15.4.2 Setup.....	234
15.4.3 Operator.....	235
15.4.4 Adding User.....	235
<b>15.5 Axes.....</b>	<b>236</b>
15.5.1 Fundamentals of axis configuration.....	236
15.5.2 Reference marks.....	237
15.5.3 Information.....	238
15.5.4 Switching functions.....	238
15.5.5 Inputs (Switching functions).....	238
15.5.6 Outputs (Switching functions).....	240
15.5.7 Overrides.....	241
15.5.8 Adding M functions.....	241
15.5.9 Configuring M functions.....	241
15.5.10 Diameter axis.....	242
15.5.11 Special settings.....	243
15.5.12 Thread cutting.....	244
15.5.13 <Axis name> (settings of the axis).....	244
15.5.14 Encoder.....	247
15.5.15 Reference marks (Encoder).....	250

15.5.16	Reference point displacement.....	251
15.5.17	Diagnostics for encoders with EnDat interface.....	251
15.5.18	Diagnostics for encoders with 1 V <sub>PP</sub> /11 μA <sub>PP</sub> .....	253
15.5.19	Linear error compensation (LEC).....	254
15.5.20	Segmented linear error compensation (SLEC).....	254
15.5.21	Create table of supporting points.....	255
15.5.22	Outputs.....	255
15.5.23	Inputs.....	257
15.5.24	Movement commands from digital input.....	257
15.5.25	Movement commands from analog input.....	258
15.5.26	Movement commands from electronic handwheel.....	259
15.5.27	Digital enable inputs.....	260
15.5.28	Software limit switches.....	260
15.5.29	Spindle axis S.....	261
15.5.30	Outputs (S).....	263
15.5.31	Inputs (S).....	264
15.5.32	Movement commands from digital input (S).....	265
15.5.33	Digital enable inputs (S).....	265
15.5.34	Spindle speed display via analog input (S).....	266
15.5.35	Adding Gear stages.....	266
15.5.36	Gear stages.....	267
<b>15.6</b>	<b>Service.....</b>	<b>268</b>
15.6.1	Firmware information.....	268
15.6.2	Back up and restore.....	269
15.6.3	Firmware update.....	270
15.6.4	Reset.....	270
15.6.5	OEM area.....	271
15.6.6	Startup screen.....	271
15.6.7	OEM bar.....	272
15.6.8	Adding OEM-Bar items.....	272
15.6.9	OEM bar item: Logo.....	273
15.6.10	Spindle speed OEM bar item.....	273
15.6.11	M function OEM bar item.....	274
15.6.12	Special functions OEM bar item.....	275
15.6.13	Document OEM bar item.....	275
15.6.14	Settings (OEM area).....	276
15.6.15	Program execution.....	276
15.6.16	Configuring M functions.....	277
15.6.17	Text database.....	277
15.6.18	Messages.....	278
15.6.19	Back up and restore (OEM area).....	278
15.6.20	Documentation.....	279
15.6.21	Software options.....	279

<b>16 Servicing and maintenance.....</b>	<b>281</b>
16.1 Overview.....	282
16.2 Cleaning.....	282
16.3 Maintenance plan.....	283
16.4 Resuming operation.....	283
16.5 Updating the firmware.....	284
16.6 Encoder diagnostics.....	286
16.6.1 Diagnostics for encoders with 1 V <sub>PP</sub> /11 μA <sub>PP</sub> interface.....	286
16.6.2 Diagnostics for encoders with EnDat interface.....	288
16.7 Restoring files and settings.....	290
16.7.1 Restore OEM-specific folders and files.....	290
16.7.2 Restore user files.....	291
16.7.3 Restore settings.....	292
16.8 Reset all settings.....	293
16.9 Reset to shipping conditions.....	293
<b>17 What to do if .....</b>	<b>295</b>
17.1 Overview.....	296
17.2 System or power failure.....	296
17.2.1 Restoring the firmware.....	296
17.2.2 Restore settings.....	297
17.3 Malfunctions.....	297
17.3.1 Troubleshooting.....	297
<b>18 Removal and disposal.....</b>	<b>301</b>
18.1 Overview.....	302
18.2 Removal.....	302
18.3 Disposal.....	302

<b>19 Specifications.....</b>	<b>303</b>
19.1 Overview.....	304
19.2 Product data.....	304
19.3 Product dimensions and mating dimensions.....	306
19.3.1 Product dimensions with Single-Pos stand.....	308
19.3.2 Product dimensions with Duo-Pos stand.....	308
19.3.3 Product dimensions with Multi-Pos stand.....	309
19.3.4 Product dimensions with Multi-Pos holder.....	309
<b>20 Index.....</b>	<b>310</b>
<b>21 List of figures.....</b>	<b>313</b>





# 1

## Fundamentals

## 1.1 Overview

This chapter contains information about the product and this manual.

## 1.2 Information on the product

Product designation	ID	Firmware version	Index
POSITIP 8000	1089176-xx, 1089177-xx	1252216.1.2.x	--

The ID label is provided on the rear panel of the product.

Example:



- 1 Product designation
- 2 Index
- 3 ID number

## 1.3 Overview of new and modified functions

This document provides a short overview of new and modified functions or settings becoming available with version 1252216.1.2.x.

## 1.4 Demo software for the product

POSITIP 8000 Demo is software you can install on a computer regardless of the device. POSITIP 8000 Demo helps you to become familiar with, try out or present the functions of the device.

You can download the current version of the software here: [www.heidenhain.de](http://www.heidenhain.de)



To download the installation file from the HEIDENHAIN Portal, you need access rights to the **Software** portal folder in the directory of the appropriate product.

If you do not have access rights to the Portal's **Software** folder, you can request the access rights from your HEIDENHAIN contact person.

## 1.5 Documentation on the product

### 1.5.1 Validity of the documentation

Before using the documentation and the product, you need to verify that the documentation matches the product.

- ▶ Compare the ID number and the index indicated in the documentation with the corresponding data given on the ID label of the product
- ▶ Compare the firmware version given in the documentation with the firmware version of the product

**Further information:** "Device information", Page 223

- > If the ID numbers and indexes as well as the firmware versions match, the documentation is valid



If the ID numbers and indexes do not match so that the documentation is not valid, you will find the current documentation at [www.heidenhain.com](http://www.heidenhain.com).

## 1.5.2 Notes on reading the documentation

### **WARNING**

#### **Fatal accidents, personal injury or property damage caused by non-compliance with the documentation!**

Failure to comply with the documentation may result in fatal accidents, personal injury or property damage.

- ▶ Read the documentation carefully from beginning to end
- ▶ Keep the documentation for future reference

The table below lists the components of the documentation in the order of priority for reading.

<b>Documentation</b>	<b>Description</b>
Addendum	An addendum supplements or supersedes the corresponding contents of the Operating Instructions and, if applicable, of the Installation Instructions. If an addendum is included in the shipment, it has the highest priority for reading. All other contents of the documentation retain their validity.
Installation Instructions	The Installation Instructions contain all of the information and safety precautions needed for the proper mounting and installation of the product. The Installation Instructions are contained as an excerpt from the Operating Instructions in every delivery. The Installation Instructions have the second highest level of priority for reading.
Operating Instructions	The Operating Instructions contain all the information and safety precautions needed for the proper operation of the product according to its intended use. The Operating Instructions are included on the supplied storage medium and can also be downloaded in the download area from <b>www.heidenhain.com</b> . The Operating Instructions must be read before the unit is put into service. The Operating Instructions have the third highest level of priority for reading.
User's Manual	The User's Manual provides all information required for installing the demo software on a computer and for using it as intended. The User's Manual is located in the installation folder of the demo software and can be downloaded from the download area at <b>www.heidenhain.com</b> .

#### **Have you found any errors or would you like to suggest changes?**

We continuously strive to improve our documentation for you. Please help us by sending your suggestions to the following e-mail address:

**userdoc@heidenhain.de**

### 1.5.3 Storage and distribution of the documentation

The instructions must be kept in the immediate vicinity of the workplace and must be available to all personnel at all times. The operating company must inform the personnel where these instructions are kept. If the instructions have become illegible, the operating company must obtain a new copy from the manufacturer.

If the product is given or resold to any other party, the following documents must be passed on to the new owner:

- Addendum (if supplied)
- Installation Instructions
- Operating Instructions

## 1.6 About these instructions

These instructions provide all the information and safety precautions needed for the safe operation of the device.

### 1.6.1 Document category

#### **Operating Instructions**

These instructions are the **Operating Instructions** for the product.

The Operating Instructions

- Is oriented to the product life cycle
- Contains all information and safety precautions needed for the proper operation of the product according to its intended use

### 1.6.2 Target groups for the instructions

These instructions must be read and observed by every person who performs any of the following tasks:

- Mounting
- Installation
- Commissioning and configuration
- Operation
- Programming
- Service, cleaning and maintenance
- Troubleshooting
- Removal and disposal

### 1.6.3 Target groups according to user types

The target groups of these instructions refer to the various user types of the product and their authorizations.

The product features the following user types:

#### OEM user

The **OEM** (Original Equipment Manufacturer) user has the highest level of permissions. This user is allowed to configure the product's hardware (e.g. connection of encoders and sensors). He can create **Setup** and **Operator**-type users, and configure the **Setup** and **Operator** users. The **OEM** user cannot be duplicated or deleted. This user cannot be logged in automatically.

#### Setup user

The **Setup** user configures the product for use at the place of operation. This user can create **Operator**-type users. The **Setup** user cannot be duplicated or deleted. This user cannot be logged in automatically.

#### Operator user

The **Operator** user is permitted to use the basic functions of the product. An **Operator**-type user cannot create additional users, but is allowed to edit various operator-specific settings, such as his name or the language. A user of the **Operator** group can be logged in automatically as soon as the product is switched on.

### 1.6.4 Contents of the chapters

The table below shows:

- from which chapters these instructions are derived from
- which information the chapters of the instructions contain
- to which target groups the chapters of the instructions mainly apply

Section	Contents	Target group		
		OEM	Setup	Operator
	<b>This chapter contains information about...</b>			
<b>1 "Fundamentals"</b>	... this product ... these instructions	✓	✓	✓
<b>2 "Safety"</b>	... Safety regulations and safety measures <ul style="list-style-type: none"> <li>■ for mounting the product</li> <li>■ for installing the product</li> <li>■ for operating the product</li> </ul>	✓	✓	✓
<b>3 "Transport and storage"</b>	... transporting the product ... storing the product ... items supplied with the product ... accessories for the product	✓	✓	
<b>4 "Mounting"</b>	... correct mounting of the product	✓	✓	
<b>5 "Installation"</b>	... correct installation of the product	✓	✓	

Section	Contents	Target group		
		OEM	Setup	Operator
	<b>This chapter contains information about...</b>			
<b>6 "Basic operation"</b>	... the operating elements of the product user interface ... the user interface of the product ... basic functions of the product	✓	✓	✓
<b>7 "Commissioning"</b>	... commissioning the product	✓		
<b>8 "Setup"</b>	... correct setup of the product		✓	
<b>9 "Quick Start"</b>	... a typical manufacturing process based on a sample workpiece			✓
<b>10 "Manual operation"</b>	... the "Manual" mode of operation ... using the "Manual" mode of operation		✓	✓
<b>11 "MDI mode"</b>	... the "MDI" mode of operation ... using the "MDI" mode of operation ... executing single blocks		✓	✓
<b>12 "Program run"</b>	... the "Program Run" mode of operation ... using the "Program Run" mode of operation ... executing previously created programs		✓	✓
<b>13 "Programming"</b>	... the "Program Run" mode of operation ... using the "Program Run" mode of operation ... executing previously created programs		✓	✓
<b>14 "File management"</b>	... the functions of the "File management" menu	✓	✓	✓
<b>15 "Settings"</b>	... setting options and associated setting parameters for the product	✓	✓	✓
<b>16 "Servicing and maintenance"</b>	... general maintenance work on the product	✓	✓	✓
<b>17 "What to do if ..."</b>	... causes of faults or malfunctions of the product ... corrective actions for faults or malfunctions of the product	✓	✓	✓
<b>18 "Removal and disposal"</b>	... disassembly and disposal of the product ... environment protection specifications	✓	✓	✓
<b>19 "Specifications"</b>	... the technical data of the product ... product dimensions and mating dimensions (drawings)	✓	✓	✓
<b>20 "Index"</b>	This chapter enables accessing the content of these instructions according to specific topics.	✓	✓	✓

## 1.6.5 Notes in this documentation




### Safety precautions

Precautionary statements warn of hazards in handling the product and provide information on their prevention. Precautionary statements are classified by hazard severity and divided into the following groups:

<b>⚠ DANGER</b>
<b>Danger</b> indicates hazards for persons. If you do not follow the avoidance instructions, the hazard <b>will result in death or severe injury</b> .
<b>⚠ WARNING</b>
<b>Warning</b> indicates hazards for persons. If you do not follow the avoidance instructions, the hazard <b>could result in death or serious injury</b> .
<b>⚠ CAUTION</b>
<b>Caution</b> indicates hazards for persons. If you do not follow the avoidance instructions, the hazard <b>could result in minor or moderate injury</b> .
<b>NOTICE</b>
<b>Notice</b> indicates danger to material or data. If you do not follow the avoidance instructions, the hazard <b>could result in property damage</b> .

### Informational notes

Informational notes ensure reliable and efficient operation of the product. Informational notes are divided into the following groups:

	The information symbol indicates a <b>tip</b> . A tip provides additional or supplementary information.
	The gear symbol indicates that the function described <b>depends on the machine</b> , e.g. <ul style="list-style-type: none"> <li>■ Your machine must feature a certain software or hardware option</li> <li>■ The behavior of the functions depends on the configurable machine settings</li> </ul>
	The book symbol represents a <b>cross reference</b> to external documentation, e.g. the documentation of your machine tool builder or other supplier.



### 1.6.6 Symbols and fonts used for marking text

In these instructions the following symbols and fonts are used for marking text:

Depiction	Meaning
▶ ...	Identifies an action and the result of this action
> ...	Example: ▶ Tap <b>OK</b> > The message is closed
■ ...	Identifies an item of a list
■ ...	Example: ■ TTL interface ■ EnDat interface ■ ...
<b>Bold</b>	Identifies menus, displays and buttons Example: ▶ Tap <b>Shut down</b> > The operating system shuts down ▶ Turn the power switch off



# 2

**Safety**

## 2.1 Overview

This chapter provides important safety information needed for the proper operation of the unit.

## 2.2 General safety precautions

General accepted safety precautions, in particular the applicable precautions relating to the handling of live electrical equipment, must be followed when operating the system. Failure to observe these safety precautions may result in personal injury or damage to the product.

It is understood that safety rules within individual companies vary. If a conflict exists between the material contained in these instructions and the rules of a company using this system, the more stringent rules take precedence.

## 2.3 Intended use

The products of the POSITIP 8000 series are advanced digital readouts for use on manually operated machine tools. In combination with linear and angle encoders, digital readouts of the POSITIP 8000 series return the position of the tool in more than one axis and provide further functions for operating the machine tool.

The POSITIP 8000 NC1 software option can automate the production of a workpiece.

The products of this series

- must only be used in commercial applications and in an industrial environment
- must be mounted on a suitable stand or holder to ensure the correct and intended operation of the product
- are intended for indoor use in an environment in which the contamination caused by humidity, dirt, oil and lubricants complies with the requirements of the specifications



The products support the use of peripheral devices from different manufacturers. HEIDENHAIN cannot make any statements on the intended use of these devices. The information on their intended use, which is provided in the respective documentation, must be observed.

## 2.4 Improper use

In particular, the products of the POSITIP 8000 series must not be used in the following applications:

- Use and storage outside the operating conditions specified in "Specifications"
- Outdoor use
- Use in potentially explosive atmospheres
- Use of the products of the POSITIP 8000 series as part of a safety function

## 2.5 Personnel qualification

The personnel for mounting, installation, operation, service, maintenance and removal must be appropriately qualified for this work and must have obtained sufficient information from the documentation supplied with the product and with the connected peripherals.

The personnel required for the individual activities to be performed on the product are indicated in the respective sections of these instructions.

The personnel groups are specified in detail as follows with regard to their qualifications and tasks.

### Operator

The operator uses and operates the product within the framework specified for the intended use. He is informed by the operating company about the special tasks and the potential hazards resulting from incorrect behavior.

### Qualified personnel

The qualified personnel are trained by the operating company to perform advanced operation and parameterization. The qualified personnel have the required technical training, knowledge and experience and know the applicable regulations, and are thus capable of performing the assigned work regarding the application concerned and of proactively identifying and avoiding potential risks.

### Electrical specialist

The electrical specialist has the required technical training, knowledge and experience and knows the applicable standards and regulations, and is thus capable of performing work on electrical systems and of proactively identifying and avoiding potential risks. Electrical specialists have been specially trained for the environment they work in.

Electrical specialists must comply with the provisions of the applicable legal regulations on accident prevention.

## 2.6 Obligations of the operating company

The operating company owns or leases the device and the peripherals. At all times, the operating company is responsible for ensuring that the intended use is complied with.

The operating company must:

- Assign the different tasks to be performed on the device to suitable, qualified and authorized personnel
- Verifiably train the personnel in the authorizations and tasks
- Provide all materials and means necessary in order for the personnel to complete the assigned tasks
- Ensure that the device is operated only when in perfect technical condition
- Ensure that the device is protected from unauthorized use

## 2.7 General safety precautions



The safety of any system incorporating the use of this product is the responsibility of the assembler or installer of the system.






The product supports the use of a wide variety of peripheral devices from different manufacturers. HEIDENHAIN cannot make any statements on the specific safety precautions to be taken for these devices. The safety precautions provided in the respective documentation must be observed. If there is no documentation at hand, it must be obtained from the manufacturers concerned.

The specific safety precautions required for the individual activities to be performed on the product are indicated in the respective sections of these instructions.

### 2.7.1 Symbols on the product

The following symbols are used to identify the product:

Symbol	Meaning
	Observe the safety precautions regarding electricity and the power connection before you connect the product.
	Functional ground connection as per IEC/EN 60204-1. Observe the information on installation.
	Product seal. Breaking or removing the product seal will result in forfeiture of warranty and guarantee.

## 2.7.2 Electrical safety precautions

### **WARNING**

#### **Hazard of contact with live parts when opening the product.**

This may result in electric shock, burns or death.

- ▶ Never open the housing
- ▶ Only the manufacturer is permitted to access the inside of the product

### **WARNING**

#### **Hazard of dangerous amount of electricity passing through the human body upon direct or indirect contact with live electrical parts.**

This may result in electric shock, burns or death.

- ▶ Work on the electrical system and live electrical components is to be performed only by trained specialists
- ▶ For power connection and all interface connections, use only cables and connectors that comply with applicable standards
- ▶ Have the manufacturer exchange defective electrical components immediately
- ▶ Regularly inspect all connected cables and all connections on the product. Defects, such as loose connections or scorched cables, must be removed immediately

### **NOTICE**

#### **Damage to internal parts of the product!**

If you open the product, the warranty and the guarantee will become void.

- ▶ Never open the housing
- ▶ Only the product manufacturer is permitted to access the inside of the product





# 3

**Transport and  
storage**

## 3.1 Overview

This chapter contains information on the transportation and storage of the product and provides an overview of the items supplied and the available accessories for the product.



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

## 3.2 Unpacking

- ▶ Open the top lid of the box
- ▶ Remove the packaging materials
- ▶ Unpack the contents
- ▶ Check the delivery for completeness
- ▶ Check the delivery for damage

## 3.3 Items supplied and accessories

### 3.3.1 Items supplied

The following items are included in delivery:

Name	Description
Addendum (optional)	Supplements or supersedes the contents of the Operating Instructions and, if applicable, of the Installation Instructions.
Operating Instructions	PDF issue of the Operating Instructions on a memory medium in the currently available languages
Product	Digital Readout POSITIP 8000
Installation Instructions	Printed issue of the Installation Instructions in the currently available languages
Single-Pos stand	Stand for rigid mounting, inclination angle 20°, fixing hole pattern 100 mm x 100 mm

### 3.3.2 Accessories



Software options need to be enabled on the product via a license key. Before you can use the associated hardware components, you need to enable the respective software option.

**Further information:** "Activating the Software options", Page 96

The following accessories are optionally available and can be ordered from HEIDENHAIN:

Accessories	Name	Description	ID
For operation			
	POSITIP 8000 AEI1 software option	Enabling of an additional encoder input	1089228-02
	POSITIP 8000 AEI1 Trial software option	Enabling of an additional encoder input; trial version for a limited time (60 days)	1089228-52
	POSITIP 8000 NC1 software option	Feedback control of one axis (servo motor or stepper motor) of the machine tool	1089228-03
	POSITIP 8000 NC1 Trial software option	Feedback control of one axis (servo motor or stepper motor) of the machine tool; trial version for a limited time (60 days)	1089228-53
For installation			
	Adapter connector for 1 V <sub>pp</sub>	Conversion of the 1 V <sub>pp</sub> interface from installation in D-sub connector, 2-row, male, 15-pin to D-sub connector, 2-row, with locking screws, male, 15-pin	1089214-01
	Cables	For information on connecting cables, see "Cables and Connectors for HEIDENHAIN Products" brochure.	---
	Power cable	Power cable with European plug (type F), length: 3 m	223775-01
	TS 248 touch probe	Touch probe for probing a workpiece (for setting presets), axial cable outlet	683110-xx
	TS 248 touch probe	Touch probe for probing a workpiece (for setting presets), radial cable outlet	683112-xx
	USB connecting cable	USB connecting cable for connector type A to type B	354770-xx
For mounting			

Accessories	Name	Description	ID
	Duo-Pos stand	Stand for rigid mounting, inclination angle 20° or 45°, fixing hole pattern 100 mm x 100 mm	1089230-02
	Mounting frame	Mounting frame for mounting of the QUADRA-CHEK 3000 and POSITIP 8000 subsequent electronics in a panel	1089208-02
	Multi-Pos holder	Holder for fastening the device on an arm, continuously tiltable within an angle of 90°, fixing hole pattern 100 mm x 100 mm	1089230-04
	Multi-Pos stand	Stand for continuously variable tilting within an angle of 90°, fixing hole pattern 100 mm x 100 mm	1089230-03
	Single-Pos stand	Stand for rigid mounting, inclination angle 20°, fixing hole pattern 100 mm x 100 mm	1089230-01

### 3.4 In case of damage in transit

- ▶ Have the shipping agent confirm the damage
- ▶ Keep the packaging materials for inspection
- ▶ Notify the sender of the damage
- ▶ Contact the distributor or machine manufacturer for replacement parts



If damage occurred during transit:

- ▶ Keep the packaging materials for inspection
- ▶ Contact HEIDENHAIN or the machine manufacturer

This applies also if damage occurred to requested replacement parts during transit.

### 3.5 Repackaging and storage

Repackage and store the product carefully in accordance with the conditions stated below.

### 3.5.1 Repackaging the product

Repackaging should correspond to the original packaging as closely as possible.

- ▶ Re-attach all mounting parts and dust protection caps to the product as received from the factory, or repackage them in the original packaging as received from the factory
- ▶ Repackage the product in such a way that
  - it is protected from impact and vibration during transit
  - it is protected from the ingress of dust or humidity
- ▶ Place all accessories that were included in the shipment in the original packaging  
**Further information:** "Items supplied and accessories", Page 34
- ▶ Enclose all the documentation that was included in the original packaging  
**Further information:** "Storage and distribution of the documentation", Page 21



If the product is returned for repair to the Service department:

- ▶ Ship the product without accessories, without encoders and without peripherals

### 3.5.2 Storage of the product

- ▶ Package the product as described above
- ▶ Observe the specified ambient conditions  
**Further information:** "Specifications", Page 303
- ▶ Inspect the product for damage after any transport or longer storage times



# 4

## Mounting

## 4.1 Overview

This chapter describes the mounting of the product. It contains instructions about how to correctly mount the product on stands or holders.



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

## 4.2 Assembly of the product

### General mounting information

The mount for the mounting variants is provided on the rear panel. The connection is compatible with the VESA standard 100 mm x 100 mm.

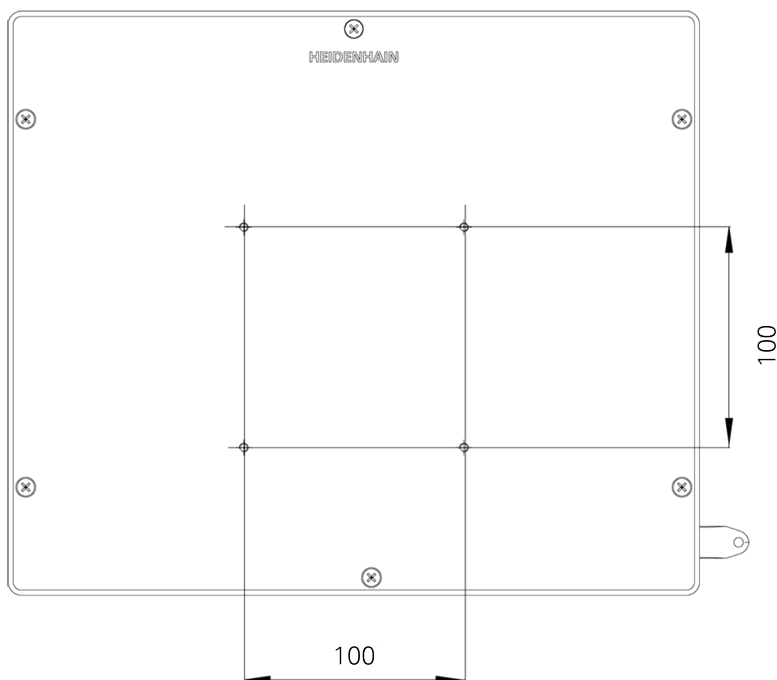


Figure 1: Dimensions of the rear panel

The materials for attachment of the mounting variants on the device are included in delivery.

You will also need the following:

- Torx T20 screwdriver
- Torx T25 screwdriver
- Allen key, size 2.5 (Duo-Pos stand)
- Materials for mounting on a supporting surface



The unit must be mounted to a stand or a holder to ensure the correct and intended use of the product.



### 4.2.1 Mounting on Single-Pos stand

You can fasten the Single-Pos stand to the product at a 20° angle.

- ▶ Use the provided M4 x 8 ISO 14581 countersunk head screws to fasten the stand to the upper VESA 100 threaded holes on the rear panel



Comply with the permissible tightening torque of 2.6 Nm

- ▶ Fasten the stand with two suitable screws from above to a supporting surface or
- ▶ Attach self-adhesive rubber pads to the underside of the stand
- ▶ Route the cables from behind through the opening in the stand and then to the connections

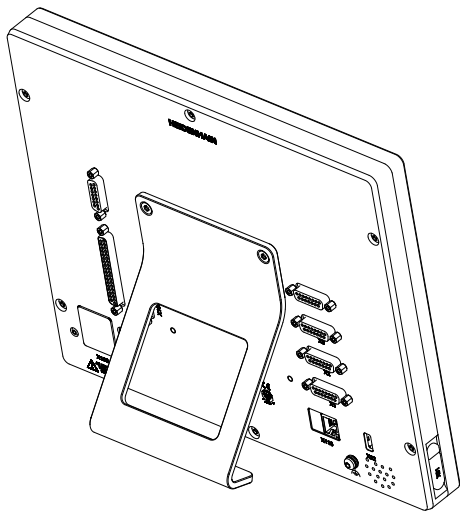


Figure 2: Product mounted on Single-Pos stand

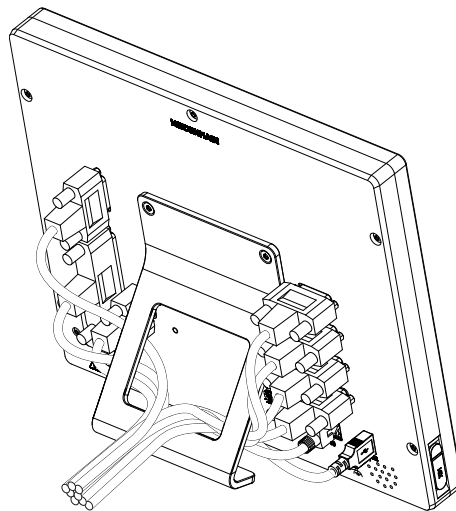


Figure 3: Cable routing on Single-Pos stand

**Further information:** "Product dimensions with Single-Pos stand", Page 308

### 4.2.2 Mounting on Duo-Pos stand

You can fasten the Duo-Pos stand to the product at a 20° or 45° angle.

- ▶ Use the provided M4 x 8 ISO 7380 hexagon socket screws to fasten the stand to the lower VESA 100 threaded holes on the rear panel



Comply with the permissible tightening torque of 2.6 Nm

- ▶ Using the mounting slots (width = 4.5 mm), screw the stand to a supporting surface

or

- ▶ Set up the device freely at the desired location
- ▶ Route the cable from behind through the two supports of the stand and then through the lateral openings to the connections

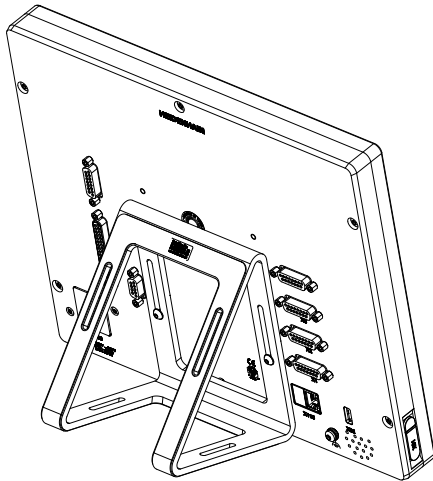


Figure 4: Product mounted on Duo-Pos stand

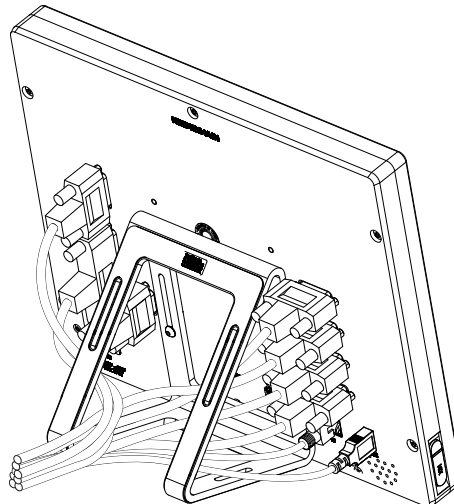


Figure 5: Cable routing on Duo-Pos stand

**Further information:** "Product dimensions with Duo-Pos stand", Page 308

### 4.2.3 Mounting on Multi-Pos stand

- ▶ Use the provided M4 x 8 ISO 14581 countersunk head screws (black) to fasten the stand to the VESA 100 threaded holes on the rear panel

**i** Comply with the permissible tightening torque of 2.6 Nm

- ▶ Using two M5 screws, you can also optionally screw the stand to a supporting surface from the bottom
- ▶ Adjust the desired angle of inclination within the tilting range of 90°
- ▶ To fix the stand: Tighten the T25 screw

**i** Comply with the tightening torque for screw T25

- Recommended tightening torque: 5.0 Nm
- Maximum permissible tightening torque: 15.0 Nm

- ▶ Route the cable from behind through the two supports of the stand and then through the lateral openings to the connections

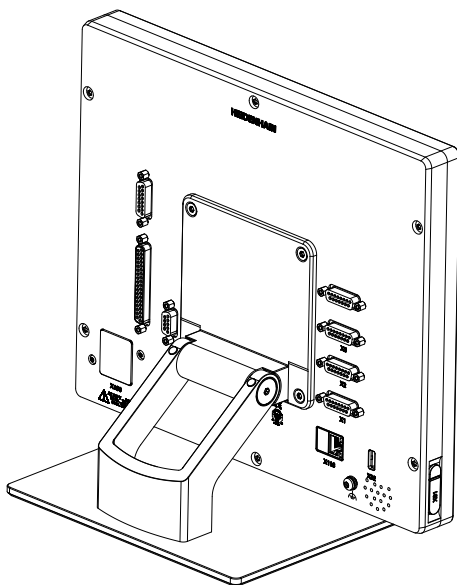


Figure 6: Product mounted on Multi-Pos stand

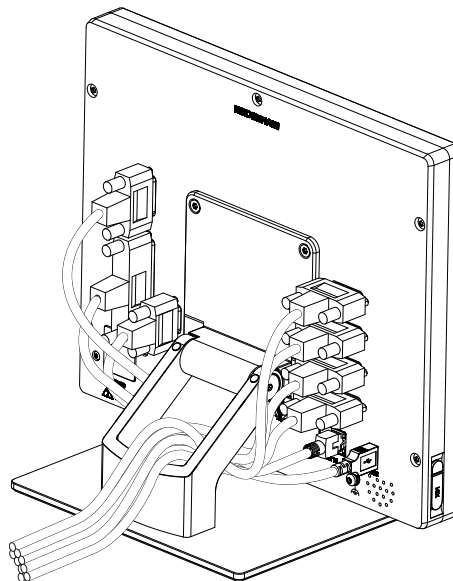


Figure 7: Cable routing on Multi-Pos stand

**Further information:** "Product dimensions with Multi-Pos stand", Page 309

#### 4.2.4 Mounting on Multi-Pos holder

- ▶ Use the provided M4 x 8 ISO 14581 countersunk head screws (black) to fasten the holder to the VESA 100 threaded holes on the rear panel

**i** Comply with the permissible tightening torque of 2.6 Nm

- ▶ Mount the holder with the supplied M8 screw, the washers, the handle and the M8 hexagon nut to an arm

or

- ▶ Mount the holder with two screws <7 mm through the two holes to the intended surface
- ▶ Adjust the desired angle of inclination within the tilting range of 90°
- ▶ To fix the holder in place: tighten the T25 screw

**i** Comply with the tightening torque for screw T25

- Recommended tightening torque: 5.0 Nm
- Maximum permissible tightening torque: 15.0 Nm

- ▶ Route the cable from behind through the two supports of the holder and then through the lateral openings to the connections

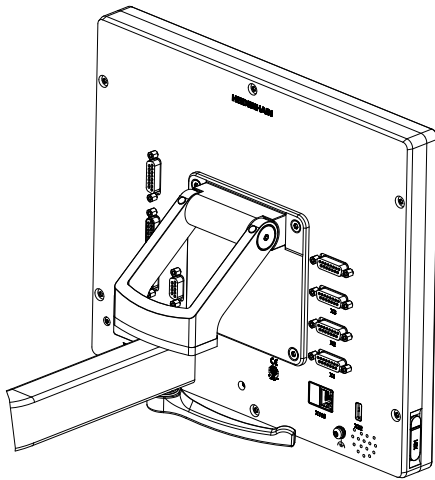


Figure 8: Product mounted on Multi-Pos holder

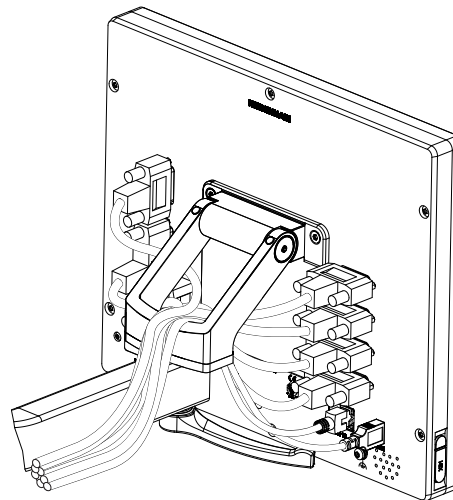


Figure 9: Cable routing on Multi-Pos holder

**Further information:** "Product dimensions with Multi-Pos holder", Page 309

# 5

**Installation**

## 5.1 Overview

This chapter describes the Installation of the product. It contains information about the product's connections and instructions about how to correctly connect the peripheral devices.



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

## 5.2 General information

### NOTICE

#### **Interference from sources of high electromagnetic emission!**

Peripheral devices, such as frequency inverters or servo drives, may cause interference.

To increase the noise immunity to electromagnetic influences:

- ▶ Use the optional functional ground connection as per IEC/EN 60204-1
- ▶ Use only USB peripherals with continuous shielding, e.g. by metalized film and metal braiding or a metal housing. The degree of coverage provided by the braiding must be 85 % or higher. The shield must be connected around the entire circumference of the connectors (360° connection).

### NOTICE

#### **Damage to the device from the engaging and disengaging of connecting elements during operation!**

Damage to internal components may result.

- ▶ Do not engage or disengage any connecting elements while the unit is under power

### NOTICE

#### **Electrostatic discharge (ESD)!**

This device contains electrostatic sensitive components that can be destroyed by electrostatic discharge (ESD).

- ▶ It is essential to observe the safety precautions for handling ESD-sensitive components
- ▶ Never touch connector pins without ensuring proper grounding
- ▶ Wear a grounded ESD wristband when handling device connections

**NOTICE****Damage to the product due to incorrect wiring!**

The incorrect wiring of inputs or outputs can cause damage to the product or to peripheral devices.

- ▶ Comply with the pin layouts and specifications of the product
- ▶ Assign only pins or wires that will be used

**Further information:** "Specifications", Page 303

### 5.3 Device overview

The connections on the rear panel of the device are protected by dust protection caps from contamination and damage.

**NOTICE****Contamination or damage may result if the dust protection caps are missing!**

If no dust protection caps are fitted to unused connections, this may impair the proper functioning of the contacts or destroy them.

- ▶ Remove dust protection caps only when connecting measuring devices or peripherals
- ▶ If you remove a measuring device or peripheral, re-attach the dust protection cap to the connection



The type of connections for encoders may vary depending on the product version.

Rear panel without dust protection caps

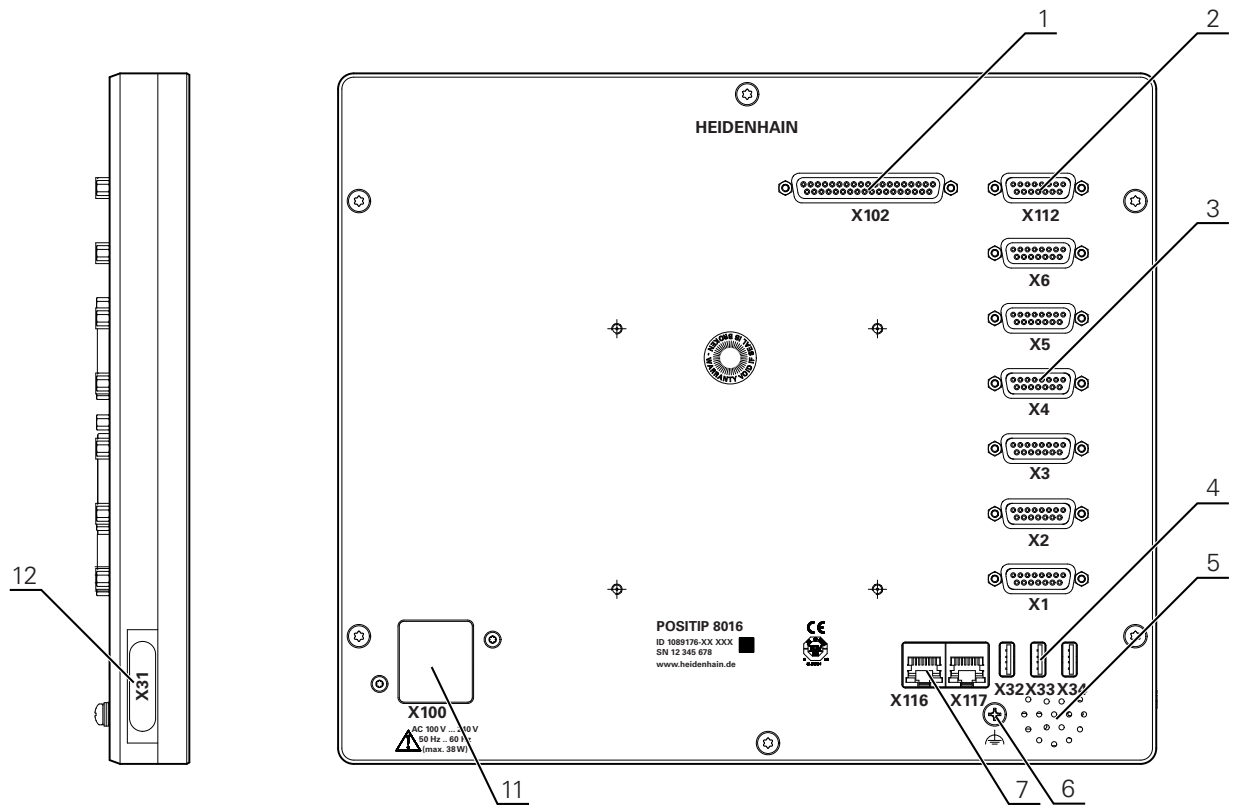


Figure 10: Rear panel of devices with ID 1089176-xx



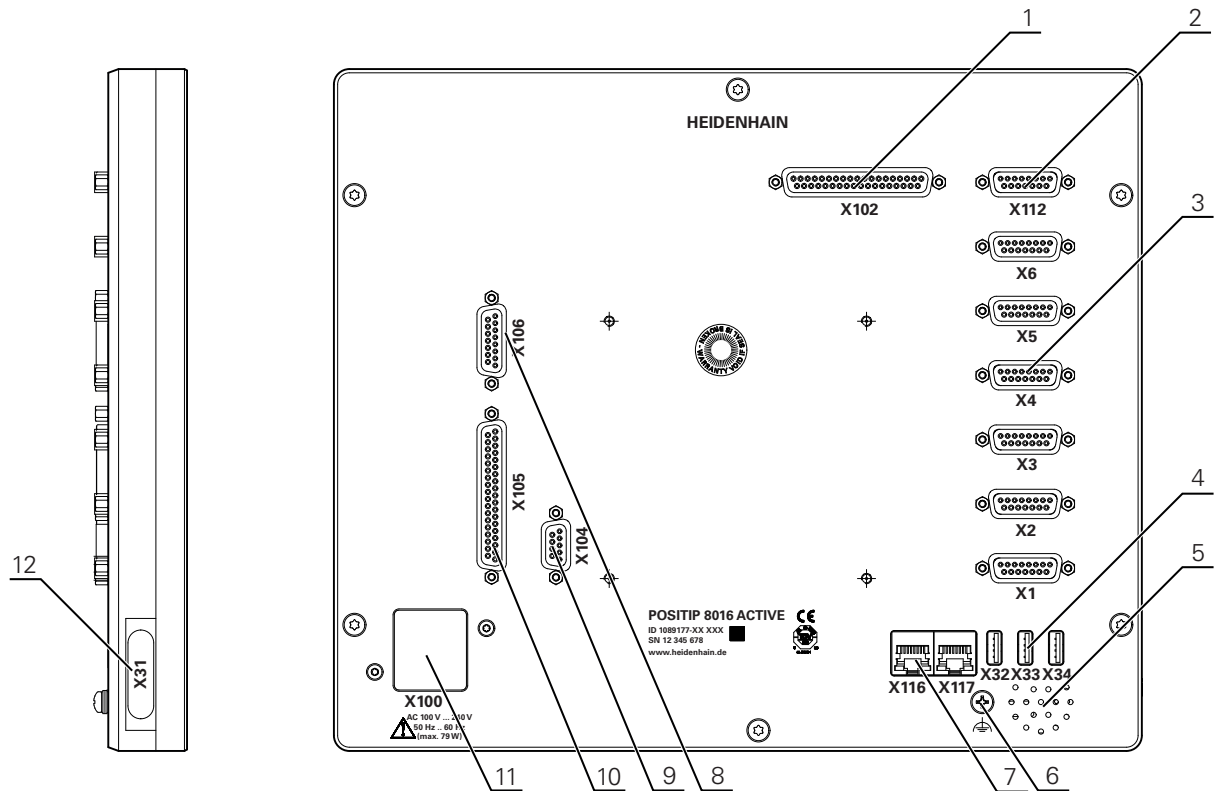


Figure 11: Rear panel of devices with ID 1089177-xx

Connections:

- 1 X102:** 37-pin D-sub connection for digital TTL interface (8 inputs, 16 outputs)
- 2 X112:** 15-pin D-sub connection for touch probes (e.g. HEIDENHAIN touch probe)
- 3 X1-X6:** 15-pin D-sub connections for encoder with interfaces of the type 1  $V_{PP}$ ,  $11\mu A_{PP}$  or EnDat 2.2  
Four inputs enabled by default, with option of enabling another two inputs
- 4 X32-X34:** USB 2.0 Hi-Speed connection (Type-A) for USB mass storage device
- 5** Speaker
- 6** Functional ground connection as per IEC/EN 60204-1
- 7 X116:** RJ45 Ethernet connection for communication and data exchange with downstream systems or PC  
**X117:** Not currently supported
- 11 X100:** Power switch and power connection

Additional connections on devices with ID 1089177-xx:

- 8 X106:** 15-pin D-sub connection for analog interface (4 inputs, 4 outputs)
- 9 X104:** 9-pin D-sub connection for universal relay interface (2x relay changeover contacts)
- 10 X105:** 37-pin D-sub connection for digital interface (DC 24 V; 24 switching inputs, 8 switching outputs)

**Left side panel**

- 12 X31** (under protective cover): USB 2.0 Hi-Speed connection (Type-A) for USB mass storage device

## 5.4 Connecting encoders



For encoders with an EnDat 2.2 interface: If the corresponding encoder input has already been assigned to an axis in the device settings, then the encoder is automatically detected upon restart, and the settings are adapted. Alternatively, you can assign the encoder input after you have connected the encoder.

- ▶ Comply with the pin layout
- ▶ Remove and save the dust protection cap
- ▶ Route the cables depending on the mounting variant

**Further information:** "Assembly of the product", Page 40

- ▶ Connect the encoder cables tightly to the respective connections

**Further information:** "Device overview", Page 47

- ▶ If the cable connectors include mounting screws, do not overtighten them

### Pin layout of X1, X2, X3, X4, X5, X6

1 V <sub>PP</sub> , 11 μA <sub>PP</sub> , EnDat 2.2								
	1	2	3	4	5	6	7	8
1 V <sub>PP</sub>	A+	0 V	B+	U <sub>P</sub>	/	/	R-	/
11 μA <sub>PP</sub>	I <sub>1+</sub>		I <sub>2+</sub>		/	Internal shield	I <sub>0+</sub>	/
EnDat	/		/		DATA		/	CLOCK
	9	10	11	12	13	14	15	
1 V <sub>PP</sub>	A-	Sense 0 V	B-	Sense U <sub>P</sub>	/	R+	/	
11 μA <sub>PP</sub>	I <sub>1-</sub>		I <sub>2-</sub>		/	I <sub>0+</sub>	/	
EnDat	/		/		DATA	/	CLOCK	


## 5.5 Wiring switching inputs and outputs

### WARNING

#### Hazard when using switching inputs for safety functions!


If switching inputs for mechanical limit switches are used for safety functions, severe injury or death can result.

- ▶ Do not use the switching inputs for mechanical limit switches for safety functions

 Depending on the peripherals to be connected, the connection work may need to be carried out by an electrical specialist.

Example: Safety Extra Low Voltage (SELV) exceeded

**Further information:** "Personnel qualification", Page 29

 The product fulfills the requirements of standard IEC 61010-1 only if the power to the peripheral devices is supplied from a secondary circuit with current limitation as per IEC 61010-1<sup>3rd Ed.</sup>, Section 9.4 or with power limitation as per IEC 60950-1<sup>2nd Ed.</sup>, Section 2.5 or from a Class 2 secondary circuit as specified in UL1310.

In place of IEC 61010-1<sup>3rd Ed.</sup>, Section 9.4, the corresponding sections of standards DIN EN 61010-1, EN 61010-1, UL 61010-1 and CAN/CSA-C22.2 No. 61010-1 can be used, and, in place of IEC 60950-1<sup>2nd Ed.</sup>, Section 2.5, the corresponding sections of standards DIN EN 60950-1, EN 60950-1, UL 60950-1, CAN/CSA-C22.2 No. 60950-1 can be applied.


- ▶ Wire switching inputs and outputs in accordance with the following pin layout
- ▶ Remove and save the dust protection cap
- ▶ Route the cables depending on the mounting variant

**Further information:** "Assembly of the product", Page 40

- ▶ Connect the connecting cables of the peripherals tightly to their connectors

**Further information:** "Device overview", Page 47

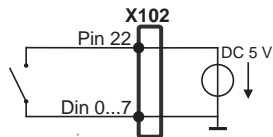
- ▶ If the cable connectors include mounting screws, do not overtighten them

 The digital or analog inputs and outputs must be assigned in the device settings of the respective switching function.


**Pin layout of X102**

1	2	3	4	5	6	7	8
GND	Din 1	Din 3	Din 4	Din 6	GND	Dout 0	Dout 2
9	10	11	12	13	14	15	16
Dout 4	GND	Dout 6	Dout 8	Dout 10	GND	Dout 12	Dout 14
17	18	19	20	21	22	23	24
/	/	GND	Din 0	Din 2	DC 5 V	Din 5	Din 7
25	26	27	28	29	30	31	32
GND	Dout 1	Dout 3	Dout 5	GND	Dout 7	Dout 9	Dout 11
33	34	35	36	37			
GND	Dout 13	Dout 15	/	/			

**Digital inputs:**



**Digital outputs:**

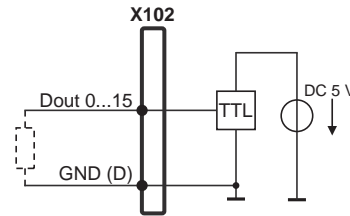


**Pin layout of X104**

1	2	3	4	5	6	7	8	9
R-0 NO	R-0 NC	/	R-1 NO	R-1 NC	R-0 CO	/	/	R-1 CO

CO – Change Over  
 NO – Normally Open  
 NC – Normally Closed

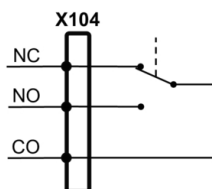
**Relay outputs:**




**Pin layout of X105**

<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>	<b>6</b>	<b>7</b>	<b>8</b>
Din 0	Din 2	Din 4	Din 6	Din 8	Din 10	Din 12	Din 14
<b>9</b>	<b>10</b>	<b>11</b>	<b>12</b>	<b>13</b>	<b>14</b>	<b>15</b>	<b>16</b>
Din 16	Din 18	Din 20	Din 22	Dout 0	Dout 2	Dout 4	Dout 6
<b>17</b>	<b>18</b>	<b>19</b>	<b>20</b>	<b>21</b>	<b>22</b>	<b>23</b>	<b>24</b>
DC 24 V	DC 24 V	GND	Din 1	Din 3	Din 5	Din 7	Din 9
<b>25</b>	<b>26</b>	<b>27</b>	<b>28</b>	<b>29</b>	<b>30</b>	<b>31</b>	<b>32</b>
Din 11	Din 13	Din 15	Din 17	Din 19	Din 21	Din 23	Dout 1
<b>33</b>	<b>34</b>	<b>35</b>	<b>36</b>	<b>37</b>			
Dout 3	Dout 5	Dout 7	DC 24 V	GND			

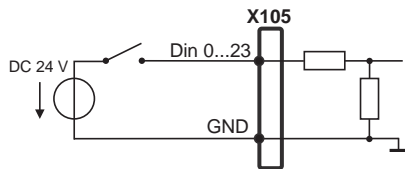**Digital inputs:**





**Digital outputs:**

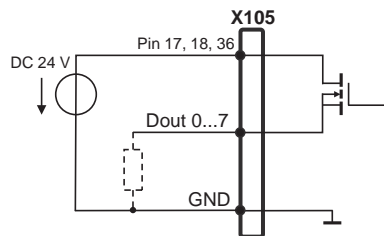

**Pin layout of X106**

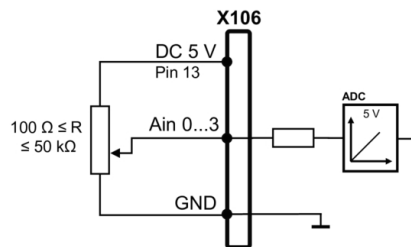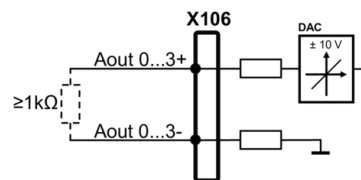1	2	3	4	5	6	7	8
Aout 0+	Aout 1+	Aout 2+	Aout 3+	GND	GND	Ain 1	Ain 3
9	10	11	12	13	14	15	
Aout 0-	Aout 1-	Aout 2-	Aout 3-	DC 5 V	Ain 0	Ain 2	

**Analog inputs:****Analog outputs:****5.6 Connecting input devices**

- ▶ Comply with the pin layout
- ▶ Remove and save the dust protection cap
- ▶ Route the cables based on the mounting variant

**Further information:** "Assembly of the product", Page 40

- ▶ Connect USB mouse or USB keyboard to USB Type-A port (X31, X32, X33, X34). Make sure the USB cable connector is fully inserted

**Further information:** "Device overview", Page 47

**Pin layout of X31, X32, X33, X34**

1	2	3	4
DC 5 V	Data (-)	Data (+)	GND

**5.7 Connecting a network peripheral**

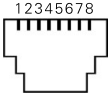
- ▶ Comply with the pin layout
- ▶ Remove and save the dust protection cap
- ▶ Route the cables depending on the mounting variant

**Further information:** "Assembly of the product", Page 40

- ▶ Connect the network peripheral to Ethernet port X116 using a standard CAT.5 cable. The cable connector must firmly engage in the port

**Further information:** "Device overview", Page 47

**Pin layout of X116**

							
1	2	3	4	5	6	7	8
D1+ (TX+)	D1- (TX-)	D2+ (RX+)	D3+	D3-	D2- (RX-)	D4+	D4-

## 5.8 Connecting the line voltage

**⚠ WARNING**

**Risk of electric shock!**

Improper grounding of electrical devices may result in serious personal injury or death by electric shock.

- ▶ Always use 3-wire power cables
- ▶ Make sure the ground wire is correctly connected to the ground of the building's electrical installations

**⚠ WARNING**

**Fire hazard due to wrong power cable!**

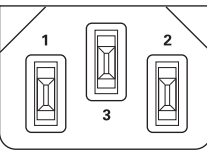
Use of a power cable that does not meet the requirements of the mounting location may cause a fire hazard.

- ▶ Use only a power cable that meets at least the national requirements of the respective country in which the product is mounted

- ▶ Comply with the pin layout
- ▶ Connect the power connection to a 3-wire grounded power outlet using a power cable that meets requirements

**Further information:** "Device overview", Page 47

**Pin layout X100**

		
1	2	3
L/N	N/L	⊕





# 6

**Basic operation**

## 6.1 Overview

This chapter describes the user interface, operating elements, and basic functions of the product.

## 6.2 Using the touchscreen and input devices

### 6.2.1 Touchscreen and input devices

The operating elements on the user interface of the unit are operated via a touchscreen or a connected USB mouse.

To enter data, you can use the screen keyboard of the touchscreen or a connected USB keyboard.

#### NOTICE

##### **Malfunctions of the touchscreen caused by humidity or contact with water!**

Humidity or water can impair the proper functioning of the touchscreen.

- ▶ Protect the touchscreen from humidity or contact with water

**Further information:** "Product data", Page 304

### 6.2.2 Gestures and mouse actions

To activate, switch or move the operating elements of the user interface, you can use the unit's touchscreen or a mouse. Gestures are used to operate the touchscreen and the mouse.

**i** The gestures for operating the touchscreen may differ from the gestures for operating the mouse.  
If the gestures for operating the touchscreen differ from those for operating the mouse, then these instructions describe both operating options as alternative actions.  
The alternative actions for operating the touchscreen or the mouse are identified by the following symbols:



Operation using the touchscreen



Operation using the mouse

The following overview describes the different gestures for operating the touchscreen or the mouse:

#### Tapping



Means touching the screen briefly with your fingertip



Means pressing the left mouse button once

**The actions initiated by tapping include**

- Selection of menus, features, or parameters
- Entering characters with the screen keyboard
- Closing dialogs

---

**Holding (long press)**

---



Means touching the screen and holding your finger(s) on it for a few seconds



Means pressing the left mouse button once and holding it down

**The actions initiated by holding are**

- Quickly changing the values in input fields with plus and minus buttons

---

**Dragging**

---



Is a combination of long press and then swipe, moving a finger over the touchscreen when at least the starting point of motion is defined



Means pressing the left mouse button once and holding it down while moving the mouse; at least the starting point of the motion is defined

**The actions initiated by dragging include**

- Scrolling through lists and texts

## 6.3 General operating elements and functions

The operating elements described below are available for configuration and operating the product via the touchscreen or input devices.

### Screen keyboard

With the screen keyboard, you can enter text into the input fields of the user interface. Depending on the input field, a numeric or alphanumeric screen keyboard is shown.

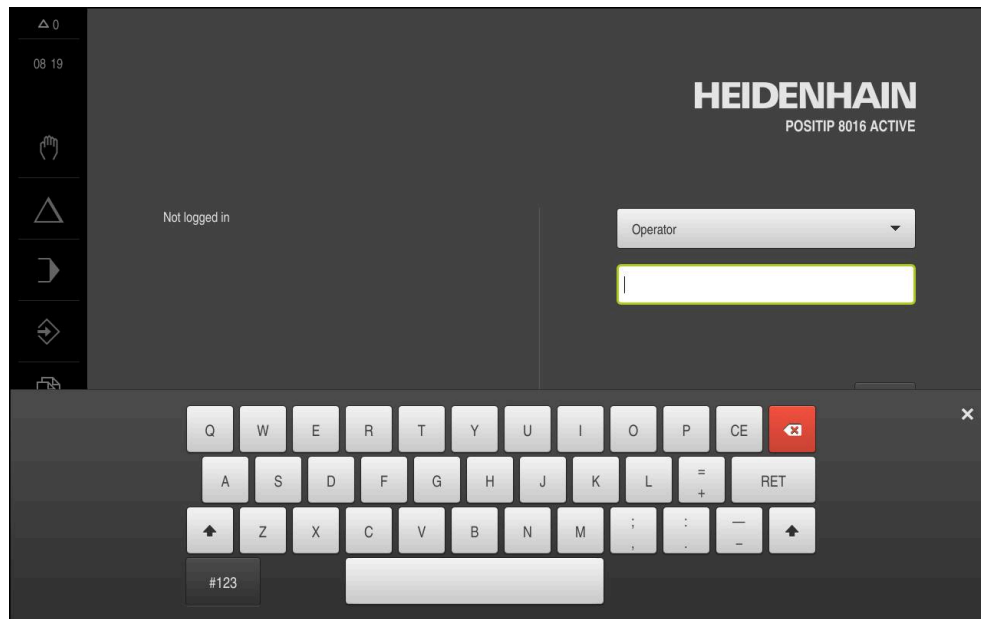


Figure 12: Screen keyboard

- ▶ To enter values, tap an input field
- > The input field is highlighted
- > The screen keyboard is displayed
- ▶ Enter text or numbers
- > The correctness of the entry in the input field is shown with a green check mark, if applicable
- > If the entry is incomplete or incorrect, a red exclamation mark is displayed. In this case, the entry cannot be completed
- ▶ To apply the values, confirm the entry with **RET**
- > The values are displayed
- > The screen keyboard disappears

### Input fields with plus and minus buttons

To adjust a numerical value, use the + (plus) and - (minus) buttons to the left and right of the numerical value.



- ▶ Tap + or - until the desired value is displayed
- ▶ Long-press + or - to scroll through the values more quickly
- > The selected value is displayed

### Toggle switch

Use the toggle switch to switch between functions.



- ▶ Tap the desired function
- > The active function is shown in green
- > The inactive function is shown in light gray

### Slide switch

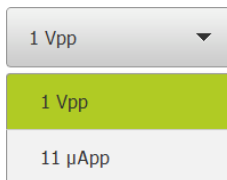
With the slide switch, you can activate or deactivate a function.



- ▶ Drag the slide switch to the desired position
- or
- ▶ Tap the slide switch
- > The function is activated or deactivated

### Drop-down list

Buttons that open drop-down lists are indicated by a triangle pointing down.



- ▶ Tap the button
- > The drop-down list opens
- > The active entry is highlighted in green
- ▶ Tap the desired entry
- > The selected entry is applied

### Undo

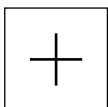
With this button, you can undo the last action.

Processes that have already been concluded cannot be undone.




- ▶ Tap **Undo**
- > The last action is undone

### Add




- ▶ To add a feature, tap **Add**
- > The new feature is added

### Close

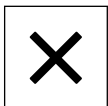


- ▶ Tap **Close** to close a dialog

### Confirm

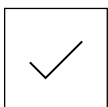

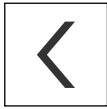- ▶ Tap **Confirm** to conclude an activity

**Back**

- ▶ Tap **Back** to return to the higher level in the menu structure

## 6.4 POSITIP 8000 – switch-on and switch-off

### 6.4.1 Switching on the POSITIP 8000



Before using the product, you need to perform the commissioning and setup steps. Depending on the purpose of use, you may have to configure additional setup parameters.

**Further information:** "Commissioning", Page 91

- ▶ Turn the power switch on  
The power switch is located on the rear side of the product
- > The unit powers up. This can take a moment
- > If automatic user login is active and the last user who logged in was of the **Operator** type, the user interface opens with the **Manual operation** menu
- > If automatic user login is not active, the **User login** menu is displayed  
**Further information:** "User login and logout", Page 63

### 6.4.2 Activating and deactivating the energy saving mode

If you will not be using the unit for a while, you should activate the energy-saving mode. This switches the unit to an inactive state without interrupting the power supply. The screen is switched off in this state.

#### Activating energy-saving mode



- ▶ Tap **Switch off** in the main menu



- ▶ Tap **Energy-saving mode**
- > The screen switches off

#### Deactivating energy-saving mode



- ▶ Tap anywhere on the touchscreen
- > An arrow appears at the bottom of the screen
- ▶ Drag the arrow up
- > The screen is switched on and shows the user interface last displayed

### 6.4.3 Switching off the POSITIP 8000

#### NOTICE

##### Damage to the operating system!

Disconnecting the power source while the product is on can damage the operating system of the product.

- ▶ Use the **Switch-off** menu to shut down the product
- ▶ Do not disconnect the power source while the product is on
- ▶ Do not turn the power switch off until the product has shut down



- ▶ Tap **Switch off** in the main menu



- ▶ Tap **Shut down**
- > The operating system shuts down
- ▶ Wait until the following message appears on the screen:  
**You can switch off the device now.**
- ▶ Turn the power switch off

## 6.5 User login and logout

In the **User login** menu, you can log in and out of the product as a user.

Only one user can be logged in to the product at a time. The logged-in user is displayed. Before a new user can log in, the logged-in user has to log out.



The product provides various authorization levels that grant the user full or restricted access to management and operation functionality.

## 6.5.1 User login



- ▶ Tap **User login** in the main menu
- ▶ Select the user in the drop-down list
- ▶ Tap the **Password** input field
- ▶ Enter the user's password

User	Default password	Target group
<b>OEM</b>	oem	Commissioner, machine tool builder
<b>Setup</b>	setup	Setup engineer, system configurer
<b>Operator</b>	operator	Operator

**Further information:** "Logging in for Quick Start", Page 155

**i** If the password does not match the default password, ask a **Setup** user or **OEM** user for the assigned password.  
If the password is no longer known, contact a HEIDENHAIN service agency.

- ▶ Confirm entry with **RET**
- ▶ Tap **Log in**
- > The user is logged in and the is displayed



**Further information:** "Target groups according to user types", Page 22

## 6.5.2 User logout



- ▶ Tap **User login** in the main menu



- ▶ Tap **Log out**
- > The user is logged out
- > All functions of the main menu are inactive, except for **Switch off**
- > The product can only be used again after a user has logged in



## 6.6 Setting the language

The user interface language is English. You can change to another language, if desired.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
  - > The logged-in user is indicated by a check mark
  - ▶ Select the logged-in user
  - > The language selected for the user is indicated by a national flag in the **Language** drop-down list
  - ▶ Select the flag for the desired language from the **Language** drop-down list
  - > The user interface is displayed in the selected language

## 6.7 Performing the reference mark search after startup



If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining operation.

**Further information:** "Defining the upper limit for the spindle speed", Page 173



If the reference mark search after unit start is active, then all of the unit's functions will be disabled until the reference mark search has been successfully completed.

**Further information:** "Reference marks (Encoder)", Page 250



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

If the reference mark search is active on the unit, then a wizard will ask you to traverse the reference marks of the axes.

- ▶ After logging in, follow the instructions of the wizard
- > The Reference symbol stops blinking upon successful completion of the reference mark search

**Further information:** "Operating elements of the position display", Page 78

**Further information:** "Activating the reference mark search", Page 116

## 6.8 User interface



The unit is available in different versions, which are variously equipped. The user interface and available functions may vary depending on the version.

## 6.8.1 User interface after switch-on

### Factory default user interface

The figure shows the user interface in the product's factory default setting. This user interface will also be displayed after the product has been reset to its factory default setting.

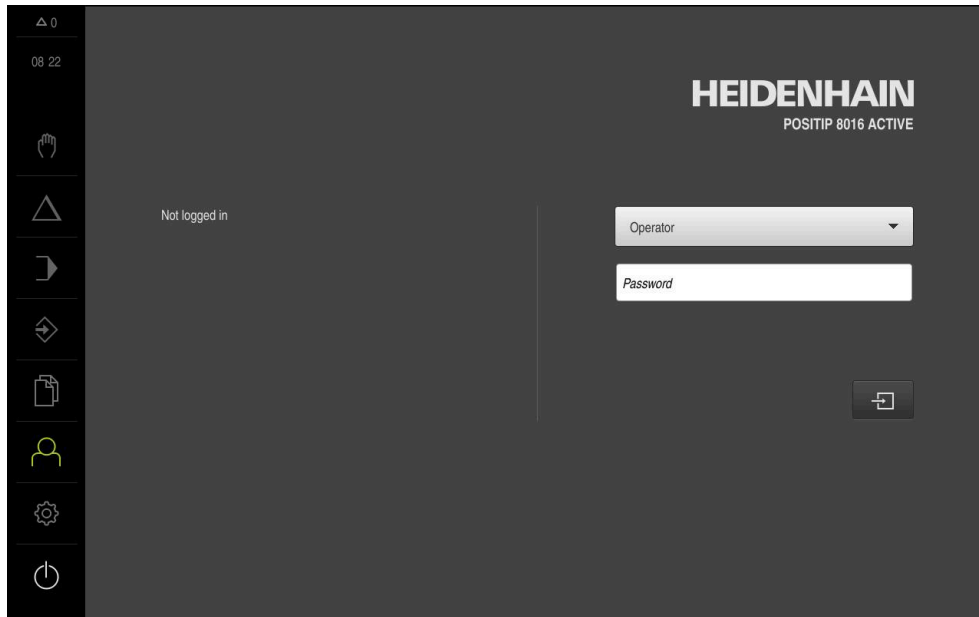


Figure 13: The user interface in the product's factory default setting

### User interface after start-up

If automatic user login is activated, and the last user who logged in was of the **Operator** type, then the product displays the **Manual operation** menu after starting up.

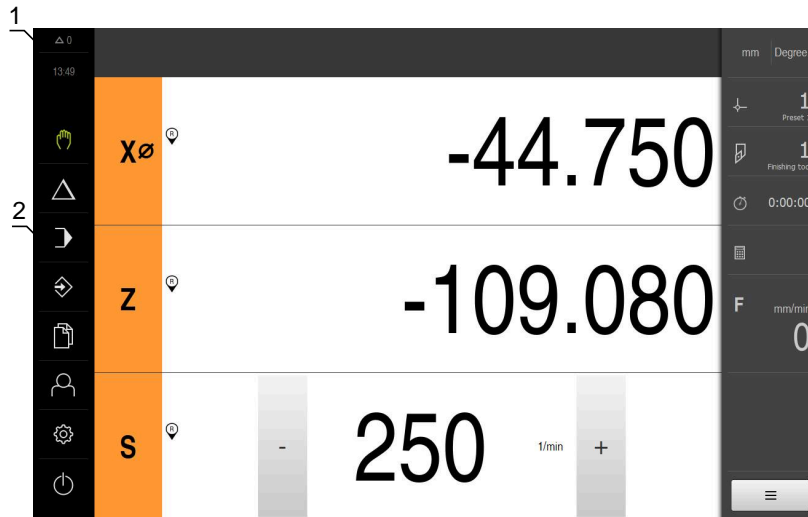
**Further information:** "Manual operation menu", Page 69

If automatic user login is not activated, then the product opens the **User login** menu.

**Further information:** "User login menu", Page 76







## 6.8.2 Main menu of the user interface



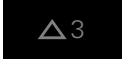


User interface (in Manual operation mode)



- 1 Message display area, displays the time and the number of unclosed messages
- 2 Main menu with operating elements

### Main menu operating elements

Operating element	Function
	<p><b>Message</b></p> <p>Display of an overview of all messages as well as the number of messages that have not been closed</p> <p><b>Further information:</b> "Messages", Page 88</p>
	<p><b>Manual operation</b></p> <p>Manual positioning of machine axes</p> <p><b>Further information:</b> "Manual operation menu", Page 69</p>
	<p><b>MDI mode</b></p> <p>Direct input of the desired axis movements (Manual Data Input); the distance to go is calculated and displayed</p> <p><b>Further information:</b> "MDI menu", Page 70</p>
	<p><b>Program run</b></p> <p>Execution of a previously created program with user interface</p> <p><b>Further information:</b> "Program run menu ", Page 72</p>
	<p><b>Programming</b></p> <p>Creation and management of individual programs</p> <p><b>Further information:</b> "Programming menu ", Page 73</p>
	<p><b>File management</b></p> <p>Management of the files that are available on the product</p> <p><b>Further information:</b> "File management menu", Page 75</p>

Operating element	Function
	<p><b>User login</b> Login and logout of the user <b>Further information:</b> "User login menu", Page 76</p>
	<div style="border: 1px solid black; padding: 5px;"> <p> If a user with additional permissions (Setup or OEM user type) is logged in, then the gear symbols appears.</p> </div>
	<p><b>Settings</b> Settings of the product, such as setting up users, configuring sensors, or updating the firmware <b>Further information:</b> "Settings menu ", Page 77</p>
	<p><b>Switch-off</b> Shutdown of the operating system or activation of power-saving mode <b>Further information:</b> "Switch-off menu", Page 78</p>

### 6.8.3 Manual operation menu

#### Activation



- ▶ Tap **Manual operation** in the main menu
- > The user interface for manual operation is displayed

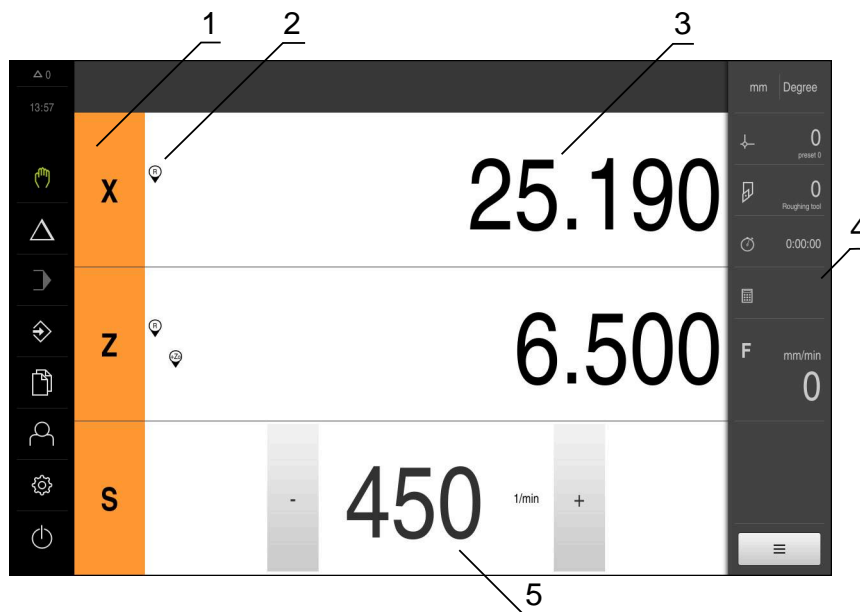


Figure 14: **Manual operation** menu

- 1 Axis key
- 2 Reference
- 3 Position display
- 4 Status bar
- 5 Spindle speed (machine tool)

In the **Manual operation** menu, the workspace shows the position values measured at the machine axes.

The status bar provides auxiliary functions.

**Further information:** "Manual operation", Page 171

## 6.8.4 MDI menu

### Activation



- ▶ Tap **MDI** in the main menu
- > The user interface for MDI mode is displayed

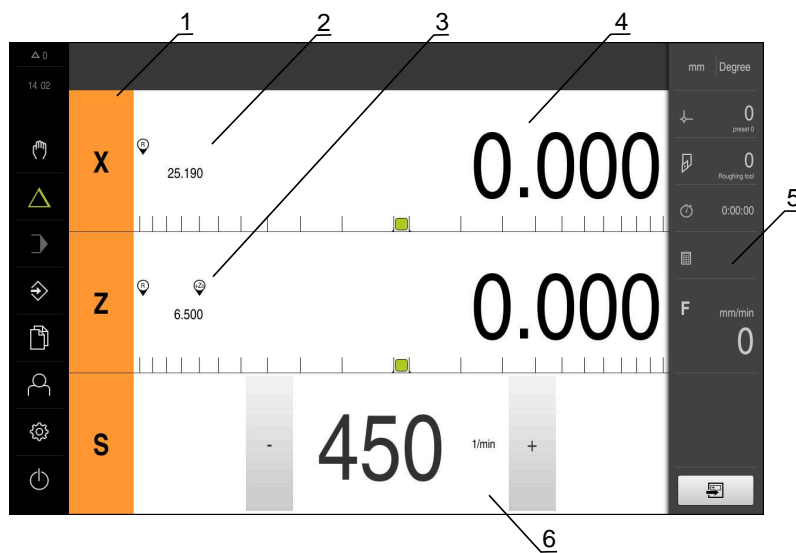


Figure 15: **MDI** menu

- 1 Axis key
- 2 Actual position
- 3 Coupled axes
- 4 Distance-to-go
- 5 Status bar
- 6 Spindle speed (machine tool)


## MDI block dialog box



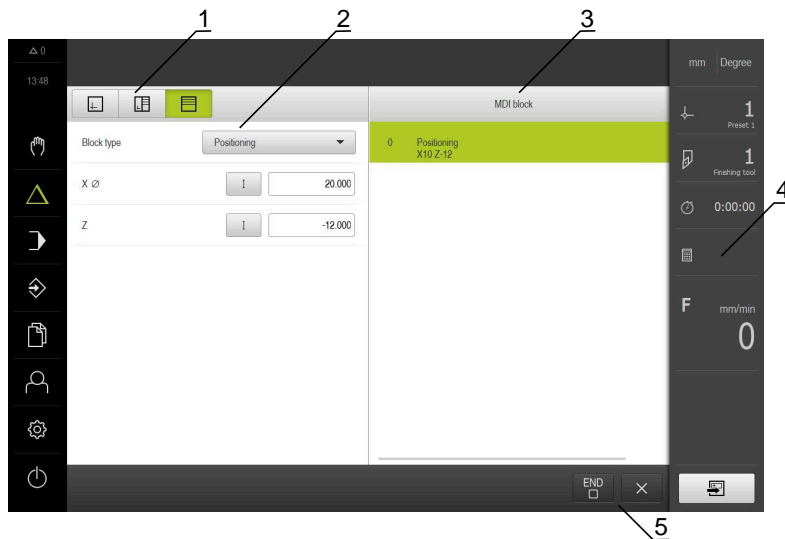- ▶ Tap **MDI** in the main menu



- ▶ Tap **Create** on the status bar
- The user interface for MDI mode is displayed



- 1 View bar
- 2 Block parameters
- 3 MDI block
- 4 Status bar
- 5 Block tools

The **MDI** (Manual Data Input) menu enables you to enter the desired axis movements directly. You specify the distance to the target point, and the distance to go is then calculated and displayed.

The status bar provides additional measured values and functions.

**Further information:** "MDI mode", Page 179

## 6.8.5 Program run menu

### Calling up



- ▶ Tap **Program run** in the main menu
- The user interface for Program Run is displayed

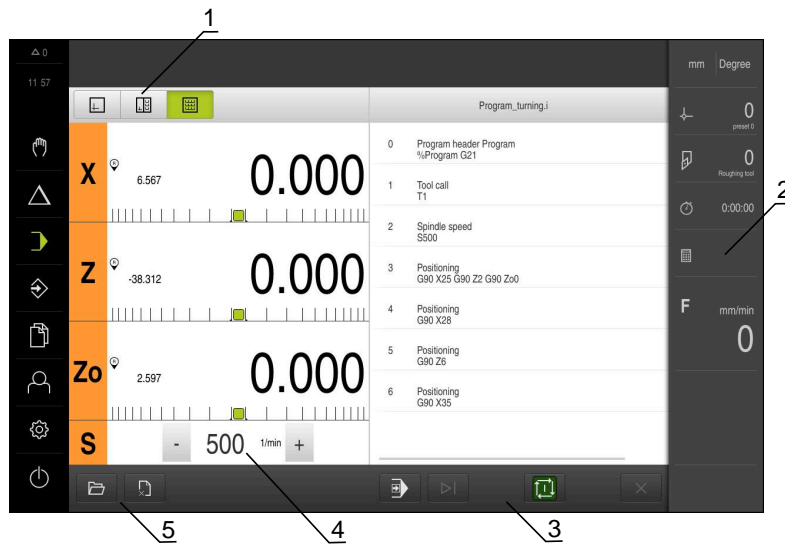


Figure 16: **Program run** menu

- 1 View bar
- 2 Status bar
- 3 Program control
- 4 Spindle speed (machine tool)
- 5 Program management

The **Program run** menu makes it possible to execute a program that has previously been created in the Programming operating mode. During execution, a wizard will guide you through the individual program steps.

In the **Program run** menu, you can display a simulation window that visualizes the selected block.

The status bar provides additional measured values and functions.

**Further information:** "Program run", Page 191



## 6.8.6 Programming menu

### Calling up



- ▶ Tap **Programming** in the main menu
- > The user interface for programming is displayed

**i** The status bar and the optional OEM bar are not available in the **Programming** menu.

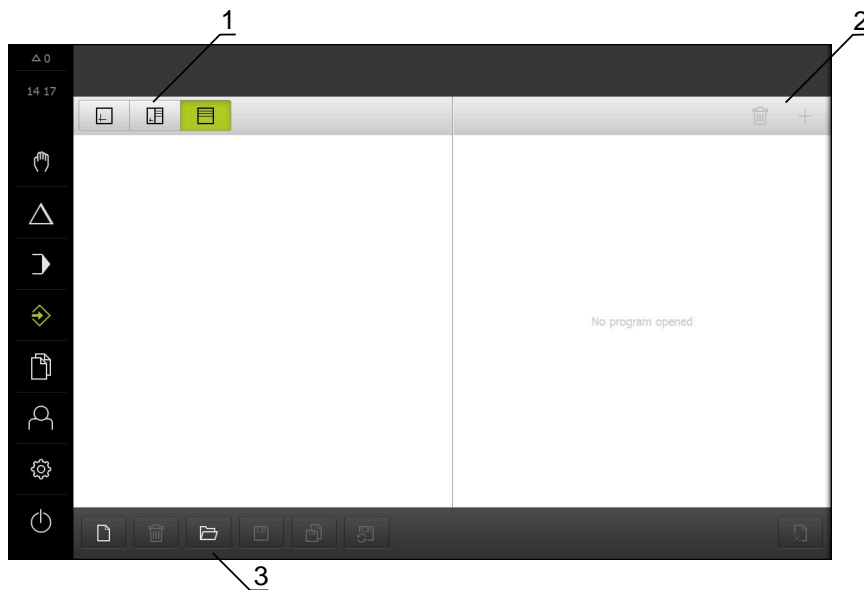


Figure 17: **Programming** menu

- 1 View bar
- 2 Toolbar
- 3 Program management

You can see a visualization of the selected block in the optional simulation window.

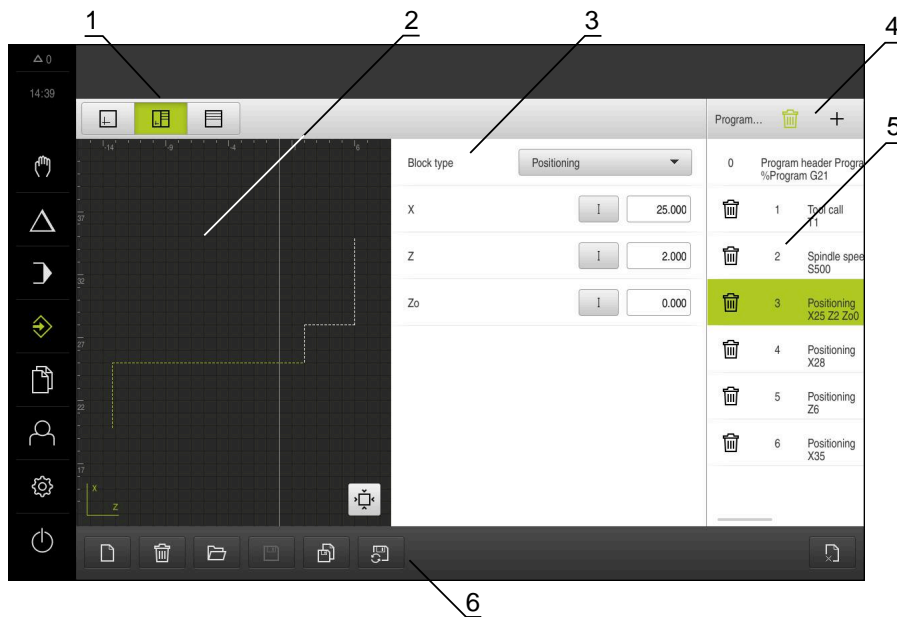


Figure 18: **Programming** menu with opened simulation window

- 1 View bar
- 2 Simulation window (optional)
- 3 Block parameters
- 4 Toolbar
- 5 Program blocks
- 6 Program management

In the **Programming** menu, you can create and manage programs. You define individual machining steps or machining patterns as blocks. A sequence of blocks then forms a program.

**Further information:** "Programming", Page 201

## 6.8.7 File management menu

### Calling up



- ▶ Tap **File management** in the main menu
- > The file management user interface is displayed

### Short description

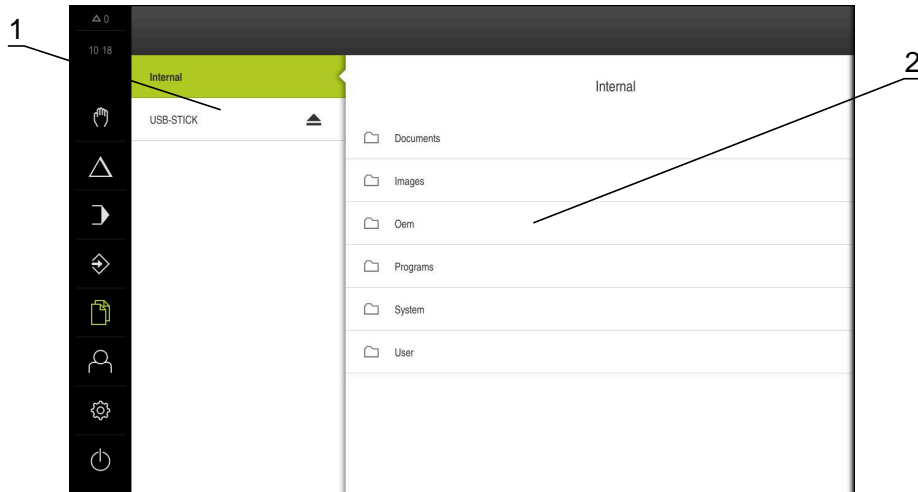


Figure 19: **File management** menu

- 1 List of available storage locations
- 2 List of folders in the selected storage location

The **File management** menu shows an overview of the files stored in the product's memory.

Any connected USB mass storage devices (FAT32 format) or available network drives are shown in the list of storage locations. The USB mass storage devices and the network drives are displayed with their name or drive designation.

**Further information:** "File management", Page 213

## 6.8.8 User login menu

### Calling up



- ▶ Tap **User login** in the main menu
- > The user interface for user login and logout is displayed

### Short description

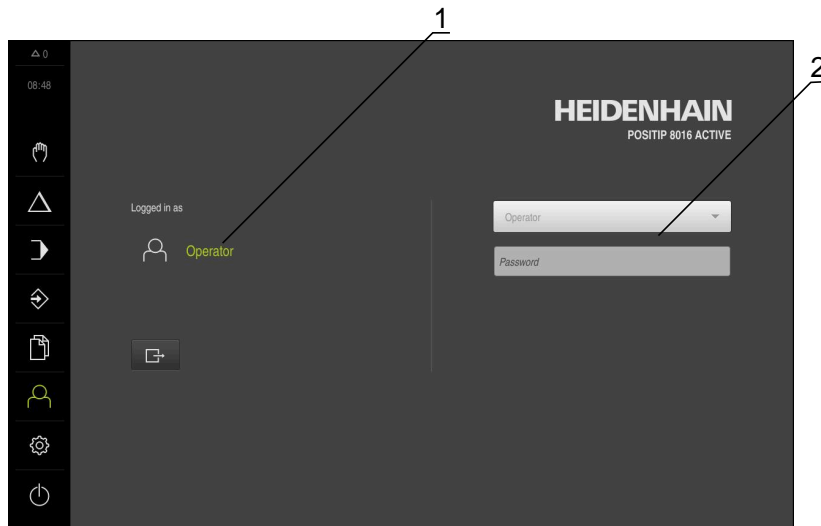


Figure 20: **User login** menu

- 1 Display of the logged-in user
- 2 User login

The **User login** menu shows the logged-in user in the column on the left. The login of a new user is displayed in the right-hand column.

To log in another user, the logged-in user must first log out.

**Further information:** "User login and logout", Page 63

## 6.8.9 Settings menu

### Calling up



- ▶ Tap **Settings** in the main menu
- > The user interface for the product settings is displayed

### Short description

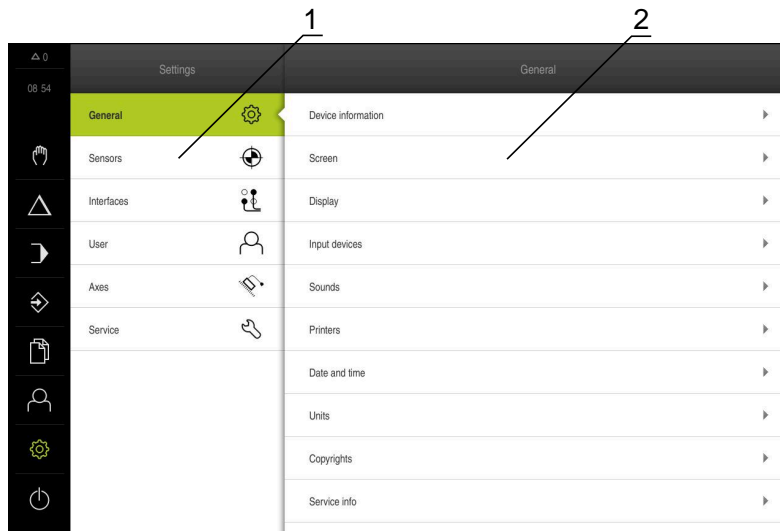


Figure 21: **Settings** menu

- 1 List of setting options
- 2 List of setting parameters

The **Settings** menu shows all of the options for configuring the product. With the setting parameters, you can adapt the product to on-site requirements.

**Further information:** "Settings", Page 221



The product provides various authorization levels that grant the user full or restricted access to management and operation functionality.

## 6.8.10 Switch-off menu




### Calling up



- ▶ Tap **Switch off** in the main menu
- The operating elements for shutting down the operating system, for activating the energy-saving mode and for activating the cleaning mode are displayed

### Short description

The **Switch off** menu provides the following options:

Operating element	Function
	<b>Shut down</b> Shuts down the operating system
	<b>Energy saving mode</b> Switches the screen off and puts the operating system into energy-saving mode
	<b>Cleaning mode</b> Switches the screen off; the operating system continues unchanged

**Further information:** "POSITIP 8000 – switch-on and switch-off", Page 62




**Further information:** "Cleaning the screen", Page 282











## 6.9 Position display

The unit's position display shows the axis positions and additional information about the configured axes (if applicable).

You can also couple the display of axes and have access to the spindle functions.

### 6.9.1 Operating elements of the position display

Symbol	Meaning
	Axis key <b>Axis key functions:</b> <ul style="list-style-type: none"> <li>■ Tapping the axis key: opens the input field for position value (Manual operation) or dialog box <b>MDI block</b> (MDI mode)</li> <li>■ Holding down the axis key: sets the current position as zero point</li> <li>■ Dragging the axis key to the right: opens menu if functions are available for the axis</li> </ul>
	Position display shows the diameter of the radial machining axis <b>X</b> <b>Further information:</b> "Display", Page 224
	Reference mark search performed successfully

Symbol	Meaning
	Reference mark search not performed or no reference mark detected
	Zo axis is coupled with the Z axis. Position display shows the sum of both position values <b>Further information:</b> "Coupling axes", Page 80
	Z axis is coupled with the Zo axis. Position display shows the sum of both position values
	Selected gear stage of the gear spindle <b>Further information:</b> "Setting the gear stage for gear spindles", Page 81
	Spindle speed cannot be achieved with selected gear stage ▶ Select a higher gear stage
	Spindle speed cannot be achieved with selected gear stage ▶ Select a lower gear stage
	The <b>CSS</b> (constant surface speed) spindle mode is activated <b>Further information:</b> "Setting the spindle mode", Page 82  If the icon is flashing, then the calculated spindle speed lies outside of the defined speed range. The desired surface speed cannot be attained. The spindle will continue to turn at the maximum or minimum speed
	In MDI mode and Program Run , a scaling factor is applied to the axis <b>Further information:</b> "Adjusting settings in the quick access menu", Page 84
	Axis is feedback-controlled
1250 <sup>1/min</sup>	Actual spindle speed
	Input field for controlling the spindle speed <b>Further information:</b> "Setting the spindle speed", Page 81

## 6.9.2 Position display functions

### Coupling axes

You can alternately couple the display of the axes **Z** and **Zo**. For coupled axes, the position display shows the sum of the position values of both axes.



If the **Z** axis and the **Zo** axis have been coupled, the Program run operating mode is disabled.



Coupling is identical for the **Z** axis and **Zo** axis. The following describes only the coupling of the **Z** axis.



All of the other axes can be coupled in the menu.

**Further information:** "Coupling axes", Page 115

### Coupling axes



- ▶ In the working space, drag the **Z axis key** to the right



- ▶ Tap **Couple**
- > The **Zo** axis is now coupled with the **Z** axis



- > The icon for the coupled axes is shown next to the **Z axis key**
- > The position value for the coupled axes is shown as a sum

### Decoupling axes



- ▶ In the working space, drag the **Z axis key** to the right

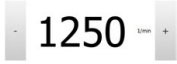


- ▶ Tap **Decouple**
- > The position value of both axes are shown independently of each other



## Setting the spindle speed

You can control the spindle speed depending on the configuration of the connected machine tool.

- 
- ▶ To switch from the display of the spindle speed to the input field (if required), drag the display to the right.
  - > The **Spindle speed** input field is displayed
  - ▶ Tap or long-press **+** or **-** to set the spindle speed to the desired value
- or
- ▶ Tap the **Spindle speed** input field
  - ▶ Enter the desired value
  - ▶ Confirm entry with **RET**
  - > The product applies the entered spindle speed as the nominal value and controls the spindle of the machine tool accordingly
  - ▶ To return to the display of the spindle speed, drag the input field to the left



If no entry is made in the **spindle speed** input field for three seconds, the device switches back to the display of the current spindle speed.

## Setting the gear stage for gear spindles

If your machine tool uses a gear spindle, then you can select the gear stage used.



The selection of the gear stages can also be controlled via an external signal.

**Further information:** "Spindle axis S", Page 261



- ▶ In the working space, drag the **S axis key** to the right



- ▶ Tap **Gear stage**
- > The **Set gear stage** dialog appears
- ▶ Tap the desired gear stage



- ▶ Tap **Confirm**
- > The selected gear stage is now adopted as the new value
- ▶ Drag the **S axis key** to the left



- > The icon for the selected gear stage appears next to the **S axis key**







If the desired spindle speed cannot be attained with the selected gear stage, then the gear stage icon will flash with an upward pointing arrow (higher gear stage) or with a downward pointing arrow (lower gear stage).

## Setting the spindle mode




For spindle mode, you can decide whether the product uses the standard speed mode or **CSS** (constant surface speed).

In the **CSS** spindle mode, the unit calculates the spindle speed such that the surface speed of the turning tool remains constant regardless of the workpiece geometry.


### Activating the CSS spindle mode

-  ▶ In the working space, drag the **S axis key** to the right
-  ▶ Tap **CSS mode**
  - The **Activate CSS** dialog box appears
  - Enter the value for **Maximum spindle speed**
-  ▶ Tap **Confirm**
  - The **CSS** spindle mode is activated
  - The spindle speed is shown in the unit of measure **m/min**
-  ▶ Drag the **S axis key** to the left
  - The icon for the **CSS** spindle mode appears next to the **S axis key**

### Activating the speed mode

-  ▶ In the working space, drag the **S axis key** to the right
-  ▶ Tap **Speed mode**
  - The **Activate speed mode** dialog box appears
  - Enter the value for **Maximum spindle speed**
-  ▶ Tap **Confirm**
  - The speed mode is activated
  - The spindle speed is shown in the unit of measure **rpm**
- ▶ Drag the **S axis key** to the left

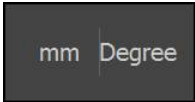








## 6.10 Status bar

 The status bar and the optional OEM bar are not available in the **Programming** menu.

In the status bar, the product shows the feed rate and traversing speed. The operating elements of the status bar also give you direct access to the preset table and tool table, as well as to the stopwatch and calculator features.

### 6.10.1 Operating elements of the status bar

The status bar provides the following operating elements:

Operating element	Function
	<p><b>Quick access menu</b></p> <p>Setting of the units for linear values and angular values, configuration of a scaling factor, configuration of the position display for radial machining axes; tapping opens the quick access menu</p> <p><b>Further information:</b> "Adjusting settings in the quick access menu", Page 84</p>
	<p><b>Preset table</b></p> <p>Display of the current preset; tapping opens the preset table</p> <p><b>Further information:</b> "Creating a preset table", Page 149</p>
	<p><b>Tool table</b></p> <p>Display of the current tool; tapping opens the tool table</p> <p><b>Further information:</b> "Creating a tool table", Page 147</p>
	<p><b>Stopwatch</b></p> <p>Time display with Start / Stop function in h:mm:ss format</p> <p><b>Further information:</b> "Stopwatch", Page 85</p>
	<p><b>Calculator</b></p> <p>Calculator with the most important mathematical functions, speed calculator and taper calculator</p> <p><b>Further information:</b> "Calculator", Page 85</p>
	<p><b>Feed rate</b></p> <p>Display of the current feed rate of the fastest linear axis</p> <p>If all linear axes are at a standstill, the feed rate of the fastest rotational axis is shown</p> <p>The feed-rate value can be set in the <b>Manual operation</b> and <b>MDI</b> operating modes; tapping it opens the feed-rate menu</p>
	<p><b>Override</b></p> <p>Display of the changed traversing speed of the fastest linear axis.</p> <p>If all linear axes are at a standstill, the changed traversing speed of the fastest rotational axis is displayed</p> <p>The change is made using an external controller on an NC-controlled machine tool</p>
	<p><b>Auxiliary functions</b></p> <p>Auxiliary functions in Manual operation mode</p> <p><b>Further information:</b> "Additional functions in Manual operation mode", Page 86</p>
	<p><b>MDI block</b></p> <p>For creating machining blocks in MDI mode</p>

## 6.10.2 Adjusting settings in the quick access menu

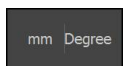
With the quick access menu, you can adjust the following settings:



The availability of settings in the quick access menu depends on the which user is logged in.

- Unit for linear values (**Millimeters** or **Inch**)
- Unit for angular values (**Radian**, **Decimal degrees** or **Deg-Min-Sec**)
- The display of **Radial machining axes** (**Radius** or **Diameter**)
- The **Scaling factor** by which the stored position is multiplied during execution of an **MDI block** or **program block**
- Feed-rate value for axes in the **Manual operation** and **MDI** operating modes

### Setting units




- ▶ Tap the **quick access menu** on the status bar
- ▶ Select the desired **Unit for linear values**
- ▶ Select the desired **Unit for angular values**



- ▶ Tap **Close** to close the quick access menu
- > The selected units are displayed in the **quick access menu**

### Activating the display of Radial machining axes

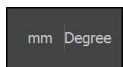


- ▶ Tap the **quick access menu** on the status bar
- ▶ Select the desired option
- ▶ Tap **Close** to close the quick access menu



- > If the **Diameter** option is selected, then the corresponding symbol appears in the position display

### Activating Scaling factor

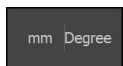While an **MDI block** or a **program block** is executing, the position stored in the block is multiplied by the **Scaling factor**. This allows you to mirror or scale an **MDI block** or **program block** on one or more axes, without changing the block.



- ▶ Tap the **quick access menu** on the status bar
- ▶ To navigate to the desired setting, drag the view to the left
- ▶ Activate **Scaling factor** with the **ON/OFF** slide switch
- ▶ Enter the desired **Scaling factor** for each axis
- ▶ Confirm each entry with **RET**






- ▶ To close the quick access menu, tap **Close**



- > For an active scaling factor  $\neq 1$ , the corresponding symbol appears in the position display

### 6.10.3 Stopwatch

The status bar provides a stopwatch for measuring the machining times, etc. The stopwatch uses the time display format h:mm:ss and operates on the same principle as a standard stopwatch, i.e. it measures elapsed time.

Operating element	Function
	<p><b>Start</b></p> <p>Starts time measurement or resumes time measurement after <b>Pause</b></p>
	<p><b>Pause</b></p> <p>Interrupts time measurement</p>
	<p><b>Stop</b></p> <p>Stops time measurement and resets it to 0:00:00</p>

### 6.10.4 Calculator

For calculations, the product provides various calculators in the status bar. To enter the numerical values, use the numeric keys as on a normal computer.

Calculator	Function
<b>Standard</b>	Contains the most important mathematical functions
<b>Speed calculator</b>	<ul style="list-style-type: none"> <li>▶ Enter the <b>Diameter</b> (mm) and <b>Cutting speed</b> (m/min) in the provided fields</li> <li>&gt; The speed is calculated automatically</li> </ul>
<b>Taper calculator</b>	<ul style="list-style-type: none"> <li>▶ Enter <b>D1</b>, <b>D2</b>, and <b>L</b> in the provided fields</li> <li>&gt; The angle is calculated automatically</li> <li>&gt; The taper is displayed graphically</li> </ul>

## 6.10.5 Setting the feed-rate value

### Setting the feed-rate value

For the **Manual mode** and **MDI mode**, you can set the feed-rate value in the **Feed rate** dialog



- ▶ Tap **Feed rate** on the status bar
- The **Feed rate** dialog box appears
- ▶ Enter the feed-rate value in the corresponding input field
  - For linear axes, use the input fields for **mm/rev** and **mm/min**
  - For rotational axes, use the **°/min** input field

**i** When the spindle is rotating, the linear axes are moved depending on the spindle speed. The device uses the value given in the **mm/rev** input field. If the spindle is at standstill, the device uses the value from the **mm/min** input field.



- ▶ Tap **Close** to close the dialog
- The axes are moved at the entered feed-rate value

## 6.10.6 Additional functions in Manual operation mode



- ▶ To call the additional functions, tap **Additional functions** in the status bar

The following operating elements are available:

Operating element	Function
	<p><b>Reference marks</b></p> <p>For starting the reference mark search</p> <p><b>Further information:</b> "Activating the reference mark search", Page 116</p>
	<p><b>Presets</b></p> <p>Setting presets</p> <p><b>Further information:</b> "Touching off presets", Page 150</p>
	<p><b>Tool data</b></p> <p>For tool setting (touch-off)</p> <p><b>Further information:</b> "Calibrating a tool", Page 148</p>

## 6.11 OEM bar



The status bar and the optional OEM bar are not available in the **Programming** menu.

The optional OEM bar allows you to control the configuration of the functions of the connected machine tool, independently of its configuration.



### 6.11.1 Operating elements of the OEM bar



The operating elements that are available on the OEM bar depend on the configuration of the device and of the connected machine tool.

**Further information:** "Configuring the OEM bar", Page 120

The following operating elements are typically available in the **OEM bar**:

Operating element	Function
	<p><b>Logo</b></p> <p>Displays the configured OEM logo</p>
	<p><b>Spindle speed</b></p> <p>Shows one or more default values for the spindle speed</p> <p><b>Further information:</b> "Configuring nominal values for the spindle speed", Page 122</p>

### 6.11.2 Calling functions of the OEM bar



The operating elements that are available on the OEM bar depend on the configuration of the device and of the connected machine tool.

**Further information:** "Configuring the OEM bar", Page 120

The operating elements in the OEM bar allow you to control special functions (e.g., spindle functions).

**Further information:** "Configuring special functions", Page 124

#### Setting spindle speed



- ▶ Tap the **Spindle speed** field on the OEM bar
- The product applies the predefined voltage value at which the spindle of the connected machine tool is brought to the selected rotational speed (with no load on the spindle)

### Programming spindle speed



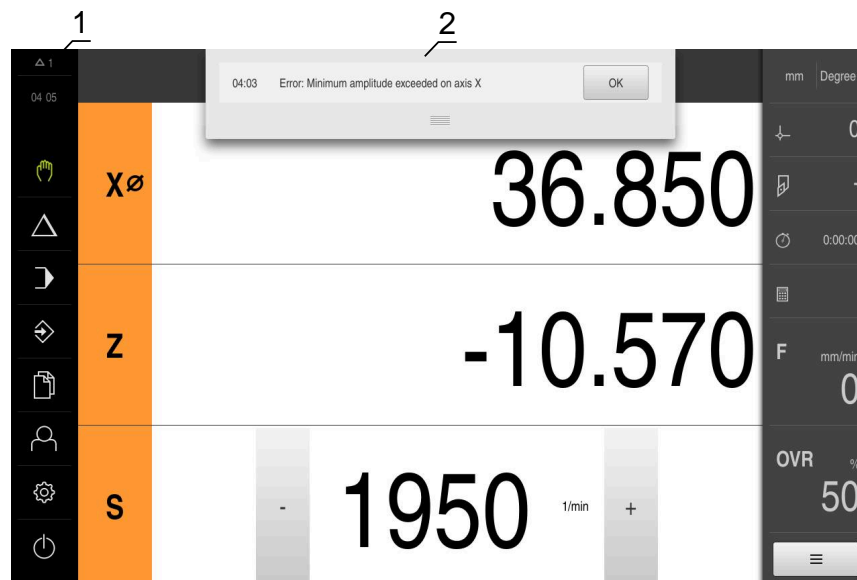
- ▶ Tap or long-press **+** or **-** to bring the spindle to the desired rotational speed



- ▶ Press and hold the desired **Spindle speed** field on the OEM bar
  - > The background color of the field is highlighted in green
  - > The product applies the current spindle speed as the nominal value and displays it in the **Spindle speed** field

## 6.12 Messages and audio feedback

### 6.12.1 Messages




- 1 Message display area
- 2 Message list

The messages that appear at the top of the workspace are triggered by, for example, operator errors or uncompleted processes.

The messages are displayed upon occurrence of the message cause or via tapping on the **Messages** display area at the top left of the screen.

#### Viewing messages

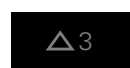

- ▶ Tap **Messages**
- > The message list opens

#### Resizing the display area



- ▶ To enlarge the message display area, drag the **handle** down
- ▶ To make the message display area smaller, drag the **handle** up
- ▶ To close the display area, drag the **handle** up out of the screen
- > The number of unclosed messages is indicated in **Messages**



### Closing messages

Depending on the content of the messages, you can close messages by means of the following operating elements:



- ▶ To close an informational message, tap **Close**
- > The message disappears

or

- ▶ To close a message that potentially has an effect on the application, tap **OK**
- > If applicable, the message will now be taken into account by the application
- > The message disappears

## 6.12.2 Wizard

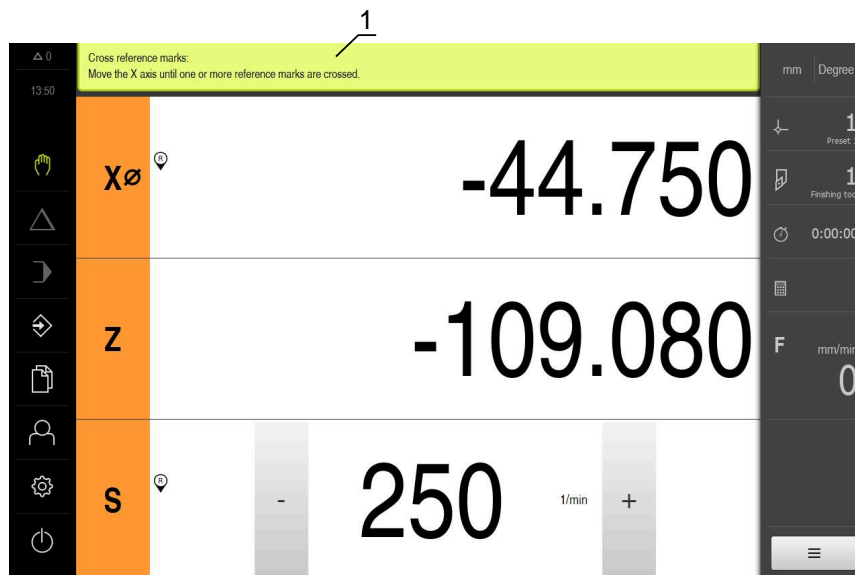


Figure 22: Support from the wizard for action steps

### 1 Wizard (example)

The wizard assists you in carrying out action steps, programs, or teach processes.

The following operating elements of the wizard are shown based on the action step or process.



- ▶ To return to the last action step or to repeat the process, tap **Undo**



- ▶ To confirm the displayed action step, tap **Confirm**
- > The wizard proceeds to the next step or completes the process



- ▶ Tap **Next** to proceed to the next step
- ▶ Tap **Back** to return to the previous step



- ▶ Tap **Close** to close the wizard

### 6.12.3 Audio feedback

The product can provide audio feedback to indicate user actions, completed processes or malfunctions.

The available sounds are grouped into categories. The sounds differ within a category.

You can define the audio feedback settings in the **Settings** menu.

**Further information:** "Sounds", Page 227

# 7

## Commissioning

## 7.1 Overview

This chapter contains all the information necessary for commissioning the product.

During commissioning, the machine manufacturer's commissioning engineer (**OEM**) configures the product for use on the specific machine tool.

The settings can be reset to the factory defaults.

**Further information:** "Reset", Page 270



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

## 7.2 Logging in for commissioning

### 7.2.1 User login

To commission the product, the **OEM** user must log in.



- ▶ Tap **User login** in the main menu
- ▶ If required, log out the user who is currently logged in
- ▶ Select the **OEM** user
- ▶ Tap the **Password** input field
- ▶ Enter the password "**oem**"



If the password does not match the default password, ask a **Setup** user or **OEM** user for the assigned password.

If the password is no longer known, contact a HEIDENHAIN service agency.



- ▶ Confirm the entry with **RET**
- ▶ Tap **Log in**
- > The user is logged in
- > The product opens the **Manual operation** mode

## 7.2.2 Performing the reference mark search after startup



If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining operation.

**Further information:** "Defining the upper limit for the spindle speed", Page 173



If the reference mark search after unit start is active, then all of the unit's functions will be disabled until the reference mark search has been successfully completed.

**Further information:** "Reference marks (Encoder)", Page 250



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

If the reference mark search is active on the unit, then a wizard will ask you to traverse the reference marks of the axes.

- ▶ After logging in, follow the instructions of the wizard
- > The Reference symbol stops blinking upon successful completion of the reference mark search

**Further information:** "Operating elements of the position display", Page 78

**Further information:** "Activating the reference mark search", Page 116

## 7.2.3 Setting the language

The user interface language is English. You can change to another language, if desired.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
  - > The logged-in user is indicated by a check mark
  - ▶ Select the logged-in user
  - > The language selected for the user is indicated by a national flag in the **Language** drop-down list
  - ▶ Select the flag for the desired language from the **Language** drop-down list
  - > The user interface is displayed in the selected language

## 7.2.4 Changing the password

You must change the password to prevent unauthorized configuration.

The password is confidential and must not be disclosed to any other person.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
- > The logged-in user is indicated by a check mark
- ▶ Select the logged-in user
- ▶ Tap **Password**
- ▶ Enter the current password
- ▶ Confirm entry with **RET**
- ▶ Enter the new password and repeat it
- ▶ Confirm entry with **RET**
- ▶ Tap **OK**
- ▶ Close the message with **OK**
- > The new password is available the next time the user logs in

## 7.3 Steps for commissioning



The following commissioning steps build on each other.

- ▶ To correctly commission the product, make sure to perform the steps in the order described here

**Prerequisite:** You are logged on as a user of the **OEM** type (see "Logging in for commissioning", Page 92).

---

### Select the application

---

- Selecting the Application

---

### Basic settings

---

- Activating the Software options
- Setting the date and time
- Setting the units of measure

---

### Configuring the axes

---

#### For EnDat interfaces:

- Configuring axes for encoders with EnDat interface
- Performing error compensation
- Ascertaining the line count per revolution

#### For 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interfaces:

- Activating the reference mark search
  - Configuring the axes for encoders with a 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface
  - Performing error compensation
  - Ascertaining the line count per revolution
- 

- Configuring the spindle axis
  - Configuring Axis+ NC
  - Coupling axes
- 

### Configuring thread cutting

---

- Configuring thread cutting (NC software option)
- 

### Configuring M functions

---

- Standard M functions
  - Manufacturer-specific M functions
- 

### OEM area

---

- Adding documentation
  - Adding a startup screen
  - Configuring the OEM bar
  - Adjusting the display
  - Defining error messages
  - Back-up OEM-specific folders and files
  - Configuring the unit for screenshots
- 

### Backing up data

---

- Back up settings
  - Back up user files
- 

## NOTICE

### Loss of or damage to configuration data!

If the product is disconnected from the power source while it is on, the configuration data can be lost or corrupted.

- ▶ Back up the configuration data and keep the backup for recovery purposes

## 7.4 Selecting the Application

When putting the product into service, you can choose between the standard application modes of **Milling** and **Turning**.

In its factory default setting, the product is already set to the **Milling** application mode.



When you change the unit's application mode, then all of the axis settings will be reset.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Settings**
- ▶ In the **Application** drop-down list, select the **Turning** application mode

## 7.5 Basic settings

### 7.5.1 Activating the Software options

Additional **Software options** can be enabled on the product via a **License key**.



You can view the enabled **Software options** on the overview page.  
**Further information:** "Checking the Software options", Page 98

### Requesting license key

You can request a license key by using the following procedure:

- Reading out device information for the license key request
- Creating a license key request

#### Reading out device information for the license key request



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Device information**
  - > An overview of the device information appears
  - > The product designation, ID number, serial number, and firmware version are displayed
- ▶ Contact a HEIDENHAIN service agency and submit the displayed device information in order to request a license key for the product
- > The license key and the license file are generated and sent by e-mail



### Creating a license key request



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Tap **Software options**
- ▶ To request a software option that is available for a fee, tap **Request options**
- ▶ To request a free trial option, tap **Request trial options**
- ▶ To select the desired software option, tap its check mark



- ▶ To deselect an entry, tap the check mark for the respective software option

- ▶ Tap **Creating a request**
- ▶ In the dialog, select the storage location in which you want to save the license key request
- ▶ Enter a suitable file name
- ▶ Confirm entry with **RET**
- ▶ Tap **Save as**
- The license key request is created and saved in the selected folder
- ▶ If the license key request is stored on the unit, move the file to a connected USB mass storage device (FAT32 format) or to the network drive
- Further information:** "Moving a file", Page 216
- ▶ Contact a HEIDENHAIN service agency and submit the file you created in order to request a license key for the product
- The license key and the license file are generated and sent by e-mail

### Activating a license key

You can activate a license key by

- Reading the license key from the provided license file into the product
- Entering the license key manually into the product

### Uploading license key from license file



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Software options**
  - **Activate options**
- ▶ Tap **Read license file**
- ▶ Select the license file in the file system, on the USB mass storage device or on the network drive
- ▶ Confirm your selection with **Select**
- ▶ Tap **OK**
- > The license key is activated
- ▶ Tap **OK**
- > You may need to restart the product, depending on the software option
- ▶ Confirm the restart with **OK**
- > The activated software option is available

### Entering license key manually



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Software options**
  - **Activate options**
- ▶ Enter the license key into the **License key** input field
- ▶ Confirm the entry with **RET**
- ▶ Tap **OK**
- > The license key is activated
- ▶ Tap **OK**
- > You may need to restart the product, depending on the software option
- ▶ Confirm the restart with **OK**
- > The activated software option is available

### Checking the Software options

On the overview page, you can check which **Software options** are enabled for the product.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Software options**
  - **Overview**
- > A list of enabled **Software options** is displayed

## 7.5.2 Setting the date and time



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Date and time**
- ▶ The set values are displayed in the following format: Year, month, day, hour, minute
- ▶ To set the date and time in the middle line, drag the columns up or down
- ▶ Tap **Set** to confirm
- ▶ Select the desired format from the **Date format** list:
  - MM-DD-YYYY: Display as month, day, year
  - DD-MM-YYYY: Display as day, month, year
  - YYYY-MM-DD: Display as year, month, day

**Further information:** "Date and time", Page 227

## 7.5.3 Setting the units of measure

You can set various parameters to define the units of measure, rounding methods and decimal places.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Units**
- ▶ To set a unit of measure, tap the corresponding drop-down list and select the unit
- ▶ To set the rounding method, tap the corresponding drop-down list and select the rounding method
- ▶ To set the number of decimal places displayed, tap - or +

**Further information:** "Units", Page 228

## 7.6 Configuring the axes

The procedure varies depending on the interface type of the connected encoder and on the type of axis:

- Encoders with EnDat interface:  
The encoder applies the parameters automatically  
**Further information:** "Configuring axes for encoders with EnDat interface", Page 102
- Encoders with 1 V<sub>pp</sub> or 11 μA<sub>pp</sub> interface:  
The parameters must be configured manually
- **Spindle, Gear spindle, and Spindle with orientation** axis type  
The inputs, outputs, and additional parameters must be configured manually  
**Further information:** "Spindle axis S", Page 261
- **Axis + NC, Electronic handwheel** (software option) axis type: The inputs, outputs, and additional parameters must be configured manually  
**Further information:** "<Axis name> (settings of the axis)", Page 244

For the parameters of HEIDENHAIN encoders that are typically connected to the product, refer to the overview of typical encoders.

**Further information:** "Overview of typical encoders", Page 101

## 7.6.1 Overview of typical encoders

The following overview lists the parameters of the HEIDENHAIN encoders that are typically connected to the product.



When connecting other encoders, refer to the encoder's documentation for the required parameters.

### Linear encoders

#### Examples of incremental encoders that are typically used

Encoder series	Interface	Signal period	Reference mark	Maximum traverse path
LS 388C/688C	1 V <sub>PP</sub>	20 μm	Coded	20 mm
LS 187/487C	1 V <sub>PP</sub>	20 μm	Coded	20 mm
LB 382C	1 V <sub>PP</sub>	40 μm	Coded	80 mm

#### Examples of absolute encoders that are typically used

Encoder series	Interface	Measuring step
LC 415	EnDat 2.2	5 nm

### Angle encoders and rotary encoders

Encoder series	Interface	Line count/ output signals per revolution	Reference mark	Nominal increment
RON 285C	1 V <sub>PP</sub>	18000	Coded	20°
ROD 280C	1 V <sub>PP</sub>	18000	Coded	20°
ROD 480	1 V <sub>PP</sub>	1000 ... 5000	One	-
ERN 180	1 V <sub>PP</sub>	1000 ... 5000	One	-
ERN 480	1 V <sub>PP</sub>	1000 ... 5000	One	-



The formulae below enable you to calculate the nominal increment of the distance-coded reference marks with angle encoders:

Nominal increment =  $360^\circ \div \text{number of reference marks} \times 2$

Nominal increment =  $(360^\circ \times \text{nominal increment in signal periods}) \div \text{line count}$

#### Examples of absolute encoders that are typically used

Encoder series	Interface	Measuring step
ROC 425	EnDat 2.2	25 bits
RCN 5310	EnDat 2.2	26 bits

## 7.6.2 Configuring axes for encoders with EnDat interface

If the corresponding encoder input has already been assigned to an axis, a connected encoder with EnDat interface is automatically detected upon restart, and the settings are adapted. Alternatively, you can assign the encoder input after you have connected the encoder.

**Prerequisite:** An encoder with EnDat interface is connected to the product.



The configuration procedure is the same for each axis. The procedure will now be explained using one axis as an example.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
  - ▶ Tap the axis name or **Not defined**, if applicable
  - ▶ If applicable, select the axis name for the axis in the **Axis name** drop-down list
  - ▶ Tap **Encoder**
  - ▶ Select the connection for the corresponding encoder from the **Encoder input** drop-down list:
    - X1
    - X2
    - X3
    - X4
    - X5
    - X6
  - > The available encoder information is transmitted to the product
  - > The settings are updated
  - ▶ Select the encoder model from the **Encoder model** drop-down list:
    - **Linear encoder**
    - **Angle encoder**
    - **Angle encoder as linear encoder**
  - ▶ If you selected **Angle encoder as linear encoder**, then enter the **Mechanical ratio**
  - ▶ If you selected **Angle encoder**, specify the **Display mode**
  - ▶ Tap **Reference point displacement**
  - ▶ Use the **ON/OFF** slide switch to activate or deactivate **Reference point displacement** (calculation of the offset between the reference mark and the machine zero point)
  - ▶ If activated, enter the offset value for **Reference point displacement**
  - ▶ Confirm the entry with **RET**
- or
- ▶ To apply the current position as the offset value, tap **Apply** under **Current position for reference point shift**



- ▶ To switch to the previous display, tap **Back**
- > To view the electronic ID label of the encoder, tap **ID label**
- > In order to see the results of the encoder diagnosis, tap **Diagnosis**

**Further information:** "<Axis name> (settings of the axis)", Page 244

### 7.6.3 Configuring the axes for encoders with a 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface



The configuration procedure is the same for each axis. The procedure will now be explained using one axis as an example.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap the axis name or **Not defined**, if applicable
- ▶ If applicable, select the axis name for the axis in the **Axis name** drop-down list
- ▶ Tap **Axis type**



- ▶ Select the **Axis type Axis**
- ▶ In order to switch to the previous axis, tap **Back**
- ▶ Tap **Encoder**
- ▶ Select the connection for the corresponding encoder from the **Encoder input** drop-down list:
  - **X1**
  - **X2**
  - **X3**
  - **X4**
  - **X5**
  - **X6**
- ▶ Select the type of incremental signal from the **Incremental signal** drop-down list:
  - **1 V<sub>pp</sub>**: Sinusoidal voltage signal
  - **11 μA<sub>pp</sub>**: Sinusoidal current signal
- ▶ Select the encoder model from the **Encoder model** drop-down list:
  - **Linear encoder**: Linear axis
  - **Angle encoder**: Rotary axis
  - **Angle encoder as linear encoder**: A rotary axis is displayed as a linear axis
- ▶ Depending on the selection, enter further parameters:
  - For **Linear encoder**, enter the **Signal period** (see "Linear encoders", Page 101)
  - For **Angle encoder**, enter the **Line count** (see "Angle encoders and rotary encoders", Page 101), or determine it using a teach sequence (see "Ascertaining the line count per revolution", Page 106)
  - For an **Angle encoder as linear encoder**, enter the **Line count** and the **Mechanical ratio**
- ▶ Confirm each input with **RET**
- ▶ For **Angle encoder**, select the **Display mode**, if applicable
- ▶ Tap **Reference marks**
- ▶ Select the reference mark from the **Reference mark** drop-down list:





- **None:** There is no reference mark
- **One:** The encoder has one reference mark
- **Coded:** The encoder has distance-coded reference marks
- ▶ If the linear encoder has coded reference marks, enter the **Maximum traverse path** (see "Linear encoders", Page 101)
- ▶ If the angle encoder has coded reference marks, enter the parameter for the **Nominal increment** (see "Angle encoders and rotary encoders", Page 101)
- ▶ Confirm the entry with **RET**
- ▶ Use the **ON/OFF** slider to activate or deactivate the **Inversion of reference mark pulses** function
- ▶ Tap **Reference point displacement**
- ▶ Use the **ON/OFF** slide switch to activate or deactivate **Reference point displacement** (calculation of the offset between the reference mark and the machine zero point)
- ▶ If activated, enter the offset value for **Reference point displacement**
- ▶ Confirm the entry with **RET**
- ▶ To apply the current position as the offset value, tap **Apply** under **Current position for reference point shift**
- ▶ In order to switch to the previous display, tap **Back** twice
- ▶ Select the frequency of the low-pass filter for suppressing high-frequency interference signals from the **Analog filter frequency** drop-down list:
  - **33 kHz:** Interference frequencies above 33 kHz
  - **400 kHz:** Interference frequencies above 400 kHz
- ▶ Use the **ON/OFF** slider to activate or deactivate the **Terminating resistor** function



The terminating resistor is automatically deactivated for incremental signals of the current signal type (11  $\mu\text{A}_{PP}$ )

- ▶ Select the type of error monitoring from the **Error monitor** drop-down list:
  - **Off:** Error monitoring not active
  - **Amplitude:** Error monitoring of the signal amplitude
  - **Frequency:** Error monitoring of the signal frequency
  - **Frequency & amplitude:** Error monitoring of the signal amplitude and signal frequency
- ▶ Select the desired counting direction from the **Counting direction** drop-down list:
  - **Positive:** The direction of traverse is in the counting direction of the encoder
  - **Negative:** The direction of traverse is opposite to the counting direction of the encoder

**Further information:** "<Axis name> (settings of the axis)", Page 244

## Ascertaining the line count per revolution

For angle encoders with interfaces of the type 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> you can use a teach sequence to ascertain the exact line count per revolution.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap the desired axis designation or **Not defined**, if applicable
- ▶ If applicable, select the name of the axis from the **Axis name** drop-down list
- ▶ Tap **Encoder**
- ▶ From the **Encoder model** drop-down list, select **Angle encoder**
- ▶ For **Display mode** select the - ∞ ... ∞ option
- ▶ Tap **Reference marks**
- ▶ Select one of the following options from the **Reference mark** drop-down list:
  - **None**: There is no reference mark
  - **One**: The encoder has one reference mark



- ▶ In order to switch to the previous axis, tap **Back**
- ▶ To start the teach sequence, tap **Start**
- > The teach sequence is started and the wizard is displayed
- ▶ Follow the instructions of the wizard
- > The line count determined during the teach sequence is transferred to the **Line count** field



The ascertained line count remains stored if you select a different display mode after the teach sequence.

**Further information:** "Settings for encoders with interfaces of the type 1 V<sub>PP</sub> or 11 A<sub>PP</sub>", Page 248

## 7.6.4 Performing error compensation

Mechanical influences such as guideway errors, tilting in the end positions, tolerances of the mounting surface or poor mounting (Abbe error) may lead to measuring errors. Error compensation enables the device to automatically compensate for systematic measuring errors during machining of the workpieces. One or more compensation factors can be defined by comparing nominal and actual values.

A distinction is made between the following methods:

- Linear error compensation (LEC): The compensation factor is calculated based on the specified length of a calibration standard (nominal length) and the actual distance traversed (actual length). The compensation factor is applied linearly to the entire measuring range.
- Segmented linear error compensation (SLEC): The axis is divided into multiple segments with the help of a maximum of 200 supporting points. A distinct compensation factor is defined and applied for every segment.

### NOTICE

#### Subsequent modifications to the encoder settings can result in measuring errors

If encoder settings such as the encoder input, encoder model, signal period, or reference marks are changed, previously determined compensation factors may no longer apply.

- ▶ If you change encoder settings, then you need to reconfigure the error compensation



For all methods, the actual error curve must be exactly measured (e.g., with the help of a comparator measuring device or calibration standard).



Linear error compensation and segmented linear error compensation cannot be combined with each other.



If you enable a reference point shift, then you need to reconfigure the error compensation. This helps you avoid measuring errors.

## Configuring linear error compensation (LEC)

With linear error compensation (LEC), the product applies a compensation factor that is calculated from the specified length or angle of a reference standard (nominal length or nominal angle) and the actual traverse path (actual length and actual angle). The compensation factor is applied to the entire measuring range.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Select the axis
- ▶ Open in succession:
  - **Error compensation**
  - **Linear error compensation (LEC)**
- ▶ Enter the length or angle of the reference standard (nominal length or nominal angle)
- ▶ Confirm the entry with **RET**
- ▶ Enter the length or angle of the actual traverse path determined by measuring (actual length or actual angle)
- ▶ Confirm the entry with **RET**
- ▶ Activate **Compensation** with the **ON/OFF** slide switch



You can also use **Linear error compensation (LEC)** for angle encoders if the rotation angle is less than 360°.

**Further information:** "Linear error compensation (LEC)", Page 254

## Configuring segmented linear error compensation (SLEC)

For a segmented linear error compensation (SLEC), you divide the axis into short segments by defining up to 200 supporting points. The deviations between the actual distance traversed and the segment length in the individual segments determine the compensation values that compensate the mechanical influences acting on the axis.



If the  $-\infty \dots \infty$  display mode is selected for the angle encoder, the error compensation of angle encoders does not affect negative values of the supporting points.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Select the axis
- ▶ Open in succession:
  - **Error compensation**
  - **Segmented linear error compensation (SLEC)**
- ▶ Use the **ON/OFF** slider to deactivate the **Compensation** function
- ▶ Tap **Create table of supporting points**
- ▶ Tap **+** or **-** to set the desired **Number of supporting points** (max. 200)
- ▶ Enter the desired **Spacing of the supporting points**
- ▶ Confirm the entry with **RET**
- ▶ Enter a value in **Start point**
- ▶ Confirm the entry with **RET**
- ▶ Tap **Create** to create the table of supporting points
- > The table of supporting points is created
- > The table lists the **supporting point positions (P)** and the **compensation values (D)** of the individual segments
- ▶ Enter the compensation value (D) **"0.0"** for supporting point **0**
- ▶ Confirm the entry with **RET**
- ▶ Enter the measured compensation value into the **compensation value (D)** input field for each supporting point created
- ▶ Confirm the entry with **RET**



- ▶ To switch to the previous display, tap **Back** twice
- ▶ Activate **Compensation** with the **ON/OFF** slide switch
- > The error compensation for the axis is applied

**Further information:** "Segmented linear error compensation (SLEC)", Page 254

### Adjusting an existing table of supporting points

After a table of supporting points for segmented linear error compensation has been created, this table can then be modified as needed.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Select the axis
- ▶ Open in succession:
  - **Error compensation**
  - **Segmented linear error compensation (SLEC)**
- ▶ Use the **ON/OFF** slide switch to deactivate the **Compensation** function
- ▶ Tap **Table of supporting points**
- ▶ The table lists the **supporting point positions (P)** and the **compensation values (D)** of the individual segments
- ▶ Adjust the **compensation value (D)** for the supporting points
- ▶ Confirm the entries with **RET**



- ▶ To switch to the previous display, tap **Back**
- ▶ Activate **Compensation** with the **ON/OFF** slide switch
- ▶ The adjusted error compensation for the axis is applied

**Further information:** "Segmented linear error compensation (SLEC)", Page 254

## 7.6.5 Configuring the spindle axis

Depending on the configuration of the connected machine tool, you must configure the inputs and outputs and further parameters of the spindle axis prior to operation. If your machine tool uses a **Gear spindle**, then you can also configure the corresponding gear stages.

You can activate a **Spindle with orientation**. You can use the **Spindle with orientation** for **Thread cutting**.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap **S** or, if applicable, **Not defined**
- ▶ Tap **Axis type**
- ▶ Select the **Axis type**:
  - **Spindle**
  - **Gear spindle**
  - **Spindle with orientation**



- ▶ To switch to the previous display, tap **Back**
- ▶ If applicable, select the axis name **S** for the axis from the **Axis name** drop-down list

## Basic configuration for the spindle axis

To use a spindle, you must configure some basic parameters. An overview of the basic configuration of a spindle is provided below.



For a description of further configuration options, refer to the Settings chapter.

**Further information:** "Axes", Page 236

A spindle axis can be started and stopped either via the M3/M4 **M functions** or manually.

If no M3/M4 **M functions** are available, then the spindle can be operated only manually. To do so, configure the parameters of the **Spindle start** and **Spindle stop** digital inputs.

Control of the spindle axis	Analog output	Inputs	
		Spindle start	Spindle stop
Manually	Assigned	Assigned	Assigned
<b>M functions</b> M3/M4	Assigned	Not connected	Not connected

### Outputs

For operating a spindle, assign at least one analog output to the spindle axis.

Path: **Settings ► Axes ► S ► Outputs**

- **Type of motor**
- **Analog output** or **Output for stepper motor**
- **Minimum step frequency:** for "stepper motor" motor type
- **Minimum step frequency:** for "stepper motor" motor type
- **Open position control loop:** not enabled (position control loop closed); only for **Spindle with orientation** axis type
- **Smax**
- **Umax:** for "unipolar servo motor" or "bipolar servo motor" motor type
- **Enable clockwise rotation:** Assign the input if the motor type is a unipolar servo motor
- **Enable counterclockwise rotation:** Assign the input if the motor type is a unipolar servo motor

**Further information:** "Outputs (S)", Page 263

### Inputs

Path: **Settings ► Axes ► S ► Inputs**

- **Movement commands from digital input:** e.g. jog buttons for Spindle Start and Spindle Stop
- **Digital enable inputs**
- **Spindle speed display via analog input:** Assign the input if the actual speed is to be displayed; indication of the spindle speed at an input voltage of 5 V

**Further information:** "Movement commands from digital input (S)", Page 265

**Further information:** "Special functions OEM bar item", Page 275

### Parameters for Spindle axis type

Path: **Settings ▶ Axes ▶ Spindle axis S**

- Start-up time for upper spindle speed range
- Start-up time for lower spindle speed range
- Break point of characteristic curve for start-up times
- Minimum spindle speed

**Further information:** "Spindle axis S", Page 261

### Parameters for Spindle with orientation axis type

Path: **Settings ▶ Axes ▶ Spindle axis S**

- Start-up time for upper spindle speed range
- Start-up time for lower spindle speed range
- Break point of characteristic curve for start-up times
- Minimum spindle speed
- Kv factor P
- Kv factor L

**Further information:** "Spindle axis S", Page 261

### Parameters for Gear spindle axis type

Path: **Settings ▶ Axes ▶ S ▶ Gear stages**

- Name
- Smax
- Start-up time for upper spindle speed range
- Start-up time for lower spindle speed range
- Break point of characteristic curve for start-up times
- Minimum spindle speed

**Further information:** "Adding Gear stages", Page 266

**Further information:** "Gear stages", Page 267

## 7.6.6 Configuring Axis+ NC

Depending on the setup of the connected machine tool, you can configure various parameters for your NC-controlled axes.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap <Axis name> or **Not defined**, if applicable
- ▶ Tap **Axis type**
- ▶ Select **Axis+ NC** (software option)



- ▶ To switch to the previous display, tap **Back**
- ▶ If applicable, select the name of the axis from the **Axis name** drop-down list



## Basic configuration for Axis + NC

For an NC-controlled movement of an axis, you must configure some basic parameters. The following basic configuration is required for NC-controlled axes:



For a description of further configuration options, refer to the Settings chapter.

**Further information:** "Axes", Page 236

### Outputs

Path: **Settings ► Axes ► Axis name ► Outputs**

- **Type of motor**
- **Analog output** or **Output for stepper motor**
- **Minimum step frequency:** for "stepper motor" motor type
- **Minimum step frequency:** for "stepper motor" motor type
- **Open position control loop:** not enabled (position control loop closed)
- **Fmax**
- **Umax:** for "unipolar servo motor" or "bipolar servo motor" motor type
- **Enable clockwise rotation:** Assign the input if the motor type is a unipolar servo motor
- **Enable counterclockwise rotation:** Assign the input if the motor type is a unipolar servo motor

**Further information:** "Outputs", Page 255

### Inputs

Path: **Settings ► Axes ► Axis name ► Inputs**

- Select **Movement commands from digital input** (e.g., jog buttons) or **Movement commands from analog input** (e.g., joystick)
- If you selected **Movement commands from analog input**, further parameters must be entered

**Further information:** "Inputs", Page 257

**Parameter**

Path: **Settings ▶ Axes ▶ Axis name**

- **Start-up time**
- **Kv factor P**
- **Kv factor L**

**Further information:** "<Axis name> (settings of the axis)", Page 244

Path: **Settings ▶ Axes ▶ General settings ▶ Switching functions ▶ Inputs**

- **Control voltage on:** Assign the input (e.g., machine key)
- **Rapid traverse:** Assign the input (e.g., machine key)
- **Automatic feed:** Assign the input (e.g., NC Start)

**Further information:** "Inputs (Switching functions)", Page 238

Path: **Settings ▶ Axes ▶ General settings ▶ Overrides**

- **Input for feed override:** Assign the input (e.g., feed-rate potentiometer)
- **Umax**

**Further information:** "Overrides", Page 241

## 7.6.7 Configuring an Electronic handwheel

Depending on the setup of the connected machine tool, you can configure various parameters for your electronic handwheel.

Proceed as follows:

- Select the **Electronic handwheel** axis type
- Define the settings for the handwheel used
- Assign the handwheel to the desired axis



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap <Axis name> or **Not defined** as needed
- ▶ Tap **Axis type**
- ▶ Select **Electronic handwheel** (software option)



- ▶ To switch to the previous display, tap **Back**
- > The name is automatically assigned

### Basic configuration for an electronic handwheel

If you want to use an electronic handwheel to move an axis, you need to configure the basic parameters. An overview of the basic configuration of an electronic handwheel is provided below.

## Encoder

Path: **Settings ▶ Axes ▶ Handwheel name ▶ Encoder**

You first enter the parameters of the encoder used for the electronic handwheel.

- ▶ Configure the axes

**Further information:** "Configuring the axes for encoders with a 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface", Page 104

**Further information:** "Configuring axes for encoders with EnDat interface", Page 102

## Inputs

Now you assign the handwheel to the axis you want to move and define the settings for the handwheel.

Path: **Settings ▶ Axes ▶ Axis name ▶ Inputs ▶  
Movement commands from electronic handwheel**

- ▶ **Enable movement commands from electronic handwheel:** Set to ON
- ▶ **Selection of the electronic handwheel:** Select the handwheel you want to use for the axis
- ▶ **Permissive button for movement commands from electronic handwheel:** Assign the input (e.g., machine key)

All other parameters are populated with default values. Adapt these values based on the requirements of your machine

**Further information:** "Movement commands from electronic handwheel", Page 259

## 7.6.8 Coupling axes

If you couple axes with each other, the product offsets the position values of the two axes according to the selected calculation type. The position display shows only the principal axis with the calculated position value. Coupled axes are not shown in the position display.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Tap <Axis name> or, if applicable, **Not defined** for the axis you wish to couple with a principal axis



- ▶ Tap **Axis type**
- ▶ Select the **Coupled axis** axis type
- ▶ To switch to the previous display, tap **Back**
- ▶ Select the desired principal axis from the **Coupled main axis** drop-down list
- ▶ Select the desired calculation type from the **Calculation with main axis** drop-down list:
  - **+**: principal axis + coupled axis
  - **-**: principal axis - coupled axis
- ▶ The position values of both axes are offset against each other according to the selected type of calculation

**Further information:** "<Axis name> (settings of the axis)", Page 244

## 7.6.9 Activating the reference mark search

The product uses the reference marks to reference the machine table to the machine. If the reference mark search has been activated, a wizard appears on startup of the product and asks the user to move the axes for the reference mark search.

**Prerequisite:** The installed encoders have reference marks that have been configured in the axis parameters.



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.



The automatic reference mark search on startup of the product can be canceled depending on the configuration.

**Further information:** "Reference marks (Encoder)", Page 250



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Open in succession:
  - **General settings**
  - **Reference marks**
- ▶ Activate **Reference mark search after unit start** with the **ON/OFF** slide switch
- > The reference marks must be traversed every time the product is started
- > The functions of the product will only be available after the reference mark search has been completed
- > The Reference symbol stops blinking upon successful completion of the reference mark search
- Further information:** "Operating elements of the position display", Page 78

## 7.7 Configuring thread cutting (NC software option)

You have the option of turning threads NC-controlled on your lathe. The spindle with orientation S or the C axis configured as NC axis can be used as rotational axis for thread cutting.

Prerequisites:

- Z axis configured as NC axis
- X axis configured as NC axis
- C axis configured as NC axis or spindle with orientation



Please note that with the **Encoder configuration for axis C**, the **Display mode** is configured either from **0° ... 360°** or from **-180° ... 180°**. The **Display mode - ∞ ... ∞** is not supported.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Open in sequence:
  - **General settings**
  - **Thread cutting**
- ▶ Select the axis name for the configured **Rotation axis S** or **C** from the drop-down list
- ▶ Enter the desired value in the **Speed for pre-positioning the rotational axis** field

**Further information:** "Thread cutting", Page 244

## 7.8 Configuring M functions

Depending on the configuration of the machine tool, you can also use M functions (machine functions) for machining operations. You can use M functions to influence the following factors:

- functions on the machine tool, such as switching the spindle rotation and coolant on and off
- the program execution

You can use all M functions as block type in programming and program run.

**Further information:** "Machine functions", Page 204

A graphic can also be optionally displayed for calling the M functions in the program run.

**Further information:** "Configuring M functions", Page 277

The product differentiates between standard M functions and the manufacturer-specific M functions.

## 7.8.1 Standard M functions

The product supports the following standard M functions (oriented to DIN 66025/ISO 6983):

Code	Description
M2	<b>Program STOP, spindle STOP, coolant OFF</b>
M3	<b>Spindle rotation in clockwise direction</b>
M4	<b>Spindle rotation in counterclockwise direction</b>
M5	<b>Spindle STOP</b>
M8	<b>Coolant ON</b>
M9	<b>Coolant OFF</b>
M30	<b>Program STOP, spindle STOP, coolant OFF</b>

These M functions are independent of the machine; some M functions however depend on the machine tool configuration (e.g. spindle functions).

## 7.8.2 Manufacturer-specific M functions



The manufacturer-specific M functions M100 to M120 are only available if the connected output has been previously configured.

**Further information:** "Configuring M functions", Page 241

The product also supports manufacturer-specific M functions with the following characteristics:

- Number range definable from M100 to M120
- Function depends on the machine manufacturer
- Use in the button of the OEM bar

**Further information:** "Configuring the OEM bar", Page 120

## 7.9 OEM area

In the **OEM area**, commissioning engineers can customize the product in various ways:

- **Documentation:** Adding the OEM documentation, e.g. service information
- **Startup screen:** Defining a startup screen with the OEM's company logo
- **OEM bar:** Configuring an OEM bar with specific functions
- **Settings:** Selecting the application, customizing the display elements and messages
- **Screenshots:** Configuring the unit for screenshots with the program ScreenshotClient

## 7.9.1 Adding documentation

You can store and display the product's documentation right on the product.



Only documents in the \*.pdf file format can be added as a documentation. The product does not display documents provided in other file formats.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **OEM area**
  - **Documentation**
  - **Add OEM service info**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ To navigate to the desired file, tap the location where the file is stored



If you have accidentally tapped the wrong folder, you can return to the previous folder.

- ▶ Tap the file name that is displayed above the list

- ▶ Navigate to the folder containing the file
- ▶ Tap the file name
- ▶ Tap **Select**
- ▶ The file is copied to the unit's **Service info** area  
**Further information:** "Service info", Page 229
- ▶ Confirm the successful transfer with **OK**

**Further information:** "Documentation", Page 279

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- ▶ The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device

## 7.9.2 Adding a startup screen

You can define an OEM-specific startup screen, e.g. the company name or logo, which will be displayed when the product is switched on. An image file with the following properties needs to be stored on the product for this purpose:

- File type: PNG or JPG
- Resolution: 96 ppi
- Image format: 16:10 (other formats will be scaled proportionally)
- Image size: Max. 1280 x 800 px

### Adding a startup screen



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **OEM area**
  - **Startup screen**
  - **Add startup screen**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ To navigate to the desired file, tap the location where the file is stored



If you have accidentally tapped the wrong folder, you can return to the previous folder.

- ▶ Tap the file name that is displayed above the list

- ▶ Navigate to the folder containing the file
- ▶ Tap the file name
- ▶ Tap **Select**
- ▶ The graphic file is copied to the product and displayed as the startup screen the next time the product is started
- ▶ Confirm the successful transfer with **OK**

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations
- ▶ Tap **Safely remove**



- ▶ The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



When you save the user files, the OEM-specific opening screen is also saved and can be restored.

**Further information:** "Back up user files", Page 133

## 7.9.3 Configuring the OEM bar

You can configure the appearance and the menu items of the OEM bar.



If you configure more menu entries than can be shown in the **OEM bar**, then you can scroll the **OEM bar** vertically.



### Showing or hiding the OEM bar



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
- ▶ Use the **ON/OFF** slider to activate or deactivate the **Show bar** function

### Configuring the OEM logo

You can display an OEM-specific company logo on the OEM bar. By tapping the OEM logo, you can optionally open a PDF file of the OEM documentation.

#### Configuring an OEM logo



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**



- ▶ Tap **Add**
- ▶ Tap the **Description** input field
- ▶ Enter a description for the menu item
- ▶ Confirm the entry with **RET**
- ▶ Tap **Logo** in the **Type** drop-down list
- ▶ Tap **Select logo** to choose a stored image file
- ▶ If required, tap **Upload image file** to select a new image file  
**Further information:** "OEM bar item: Logo", Page 273
- ▶ Navigate to the folder containing the image file, and select the file
- ▶ Tap **Select**
- ▶ Select the desired option in the **Link to documentation** drop-down list

## Configuring nominal values for the spindle speed

On the OEM bar, you can define menu items that control the spindle speeds depending on the configuration of the machine tool.



You can overwrite configured spindle speeds with the value of the currently set speed of the spindle axis by pressing and holding the desired **Spindle speed** field.

**Further information:** "Calling functions of the OEM bar", Page 87

## Configuring nominal values for the spindle speed



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**



- ▶ Tap **Add**
- ▶ Tap the **Description** input field
- ▶ Enter a description for the menu item
- ▶ Confirm the entry with **RET**
- ▶ Tap **Spindle speed** in the **Type** drop-down list
- ▶ Tap the name of the spindle in the **Spindle** drop-down list
- ▶ Enter the desired nominal value into the **Spindle speed** input field

## Configuring M functions

On the OEM bar, you can define menu items that control the use of M functions depending on the configuration of the machine tool.



The manufacturer-specific M functions M100 to M120 are only available if the connected output has been previously configured.

**Further information:** "Configuring M functions", Page 241

### Configuring M functions



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**



- ▶ Tap **Add**
- ▶ Tap the **Description** input field
- ▶ Enter a description for the menu item
- ▶ Confirm the entry with **RET**
- ▶ Tap **M function** in the **Type** drop-down list
- ▶ Enter the number into the **Number of the M function** input field:
  - **100.T ... 120.T (TOGGLE** switches between the states when tapped)
  - **100.P ... 120.P (PULSE** outputs a short pulse when activated; it can be extended by setting the **Pulse time**)
- ▶ Confirm the entry with **RET**
- ▶ For every M function, you can also define corresponding images for displaying the status using **Select image for active function** and **Select image for inactive function**

**Further information:** "M function OEM bar item", Page 274

## Configuring special functions

On the OEM bar, you can define menu items that control special functions of the connected machine tool.



The available functions depend on the configuration of the device and of the connected machine tool.

### Configuring special functions



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**



- ▶ Tap **Add**
- ▶ Tap the **Description** input field
- ▶ Enter a description for the menu item
- ▶ Confirm the entry with **RET**
- ▶ Tap **Special functions** in the **Type** drop-down list
- ▶ Tap the desired special function in the **Function** drop-down list
  - **Thread cutting**
  - **Spindle direction**
  - **Coolant**
  - **Coolant during spindle operation**
  - **Clamp axes**
  - **Zero the tool axis**
- ▶ For each special function, you can also define corresponding images for displaying the status using **Select image for active function** and **Select image for inactive function**  
**Further information:** "Special functions OEM bar item", Page 275

## Configuring documents

On the OEM bar, you can define menu items that display additional documents. The file to be displayed needs to be stored in PDF format on the product for this purpose.

### Configuring documents



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**



- ▶ Tap **Add**
- ▶ Tap the **Description** input field
- ▶ Enter a description for the menu item
- ▶ Confirm the entry with **RET**
- ▶ Tap **Document** in the **Type** drop-down list
- ▶ Tap **Select a document** to choose a stored document
- ▶ Tap **Select image for display** to select the image file you want to display
- ▶ Navigate to the folder containing the image file, and select the file
- ▶ Tap **Select**

## Deleting menu items

You can delete individual menu items from the OEM bar.

### Deleting menu items



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **OEM bar**
  - **Bar items**
- ▶ Tap the desired menu item
- ▶ Tap **Remove bar entry**
- ▶ Tap **OK** to confirm deletion
- > The menu item is deleted from the OEM bar

## 7.9.4 Adjusting the display

You can adjust the override display in the **Manual operation** and **MDI** menus. You can also define the layout of the screen keyboard.

### Adjusting the Override display



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Settings**
- ▶ Select the desired unit from the **Override display** drop-down list:
  - **Percent**: percentage difference of the traversing speed
  - **Value**: absolute value of the traversing speed

### Defining the keyboard design



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Settings**
- ▶ Select the desired layout for the screen keyboard from the **Keyboard theme** drop-down list

## 7.9.5 Defining error messages

As an OEM, you can define specific error messages that overwrite standard error messages or are triggered by defined input signals as additional messages. For this purpose, you can create a text database that contains your specific error messages.

## Creating a Text database

To create a text database containing the OEM-specific error messages, you create a file of the \*.xml type and add your entries for the individual message texts to this file.

The XML file must be in UTF-8 format. The following figure shows the correct structure of the XML file:

```

1  <?xml version="1.0" encoding="UTF-8"?>
2  <source version="1">
3    <entry id="ID_OEM_EMERGENCY_STOP">
4      <text lang="de">Der Not-Aus ist aktiv.</text>
5      <text lang="cs">Nouzové zastavení je aktivní.</text>
6      <text lang="en">The emergency stop is active.</text>
7      <text lang="fr">L&apos;arrêt d&apos;urgence est actif.</text>
8      <text lang="it">L&apos;arresto d&apos;emergenza è attivo.</text>
9      <text lang="es">La parada de emergencia está activa.</text>
10     <text lang="ja">緊急停止がアクティブです.</text>
11     <text lang="pl">Wyłączenie awaryjne jest aktywne.</text>
12     <text lang="pt">O desligamento de emergência está ativo.</text>
13     <text lang="ru">Активен аварийный останов.</text>
14     <text lang="zh">急停激活.</text>
15     <text lang="zh-tw">緊急停止啟動.</text>
16     <text lang="ko">비상 정지가 작동 중입니다.</text>
17     <text lang="tr">Acil kapatma etkin.</text>
18     <text lang="nl">De noodstop is actief.</text>
19   </entry>
20   <entry id="ID_OEM_CONTROL_VOLTAGE">
21     <text lang="de">Es liegt keine Steuerspannung an.</text>
22     <text lang="cs">Není použito žádné řídící napětí.</text>
23     <text lang="en">No machine control voltage is being applied.</text>
24     <text lang="fr">Aucune tension de commande n&apos;est appliquée.</text>
25     <text lang="it">Non è applicata alcuna tensione di comando.</text>
26     <text lang="es">No está aplicada la tensión de control.</text>
27     <text lang="ja">御電圧は適用されていません.</text>
28     <text lang="pl">Brak zasilania sterowania.</text>
29     <text lang="pt">Não existe tensão de comando.</text>
30     <text lang="ru">Управляющее напряжение отсутствует.</text>
31     <text lang="zh">无控制电压.</text>
32     <text lang="zh-tw">並無供應控制電壓.</text>
33     <text lang="ko">공급된 제어 전압이 없습니다.</text>
34     <text lang="tr">Kumanda gerilimi mevcut değil.</text>
35     <text lang="nl">Er is geen sprake van stuurspanning.</text>
36   </entry>
37 </source>

```

Figure 23: Example – XML file for text database

Then you import the XML file by means of a USB mass storage device (FAT32 format) into the product and save it, for example, to the **Internal/Oem** storage location.

### Importing a Text database



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - 
  - **Text database**
- ▶ To navigate to the desired file, tap the location where the file is stored



If you have accidentally tapped the wrong folder, you can return to the previous folder.

- ▶ Tap the file name that is displayed above the list

- ▶ Navigate to the folder containing the XML file
- ▶ Tap the file name
- ▶ Tap **Select**
- ▶ Confirm the successful transfer with **OK**
- > You have now successfully imported the **Text database**

**Further information:** "Text database", Page 277



## Configuring error messages

The OEM-specific error messages can be gated to inputs as additional messages. The error messages will then be displayed when the input is activated. For this to work, you need to assign the error messages to the desired input signals.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Settings**
  - **Messages**



- ▶ Tap **Add**
- ▶ Tap the **Name** input field
- ▶ Enter a unique name
- ▶ Confirm the entry with **RET**
- ▶ Tap the **Text ID or text** input field
- ▶ Enter the new message text
- or
- ▶ Enter the text ID of a message text from the text database
- ▶ Select the desired message type in the **Message type** drop-down list:
  - **Standard**: The message is displayed as long as the input is active
  - **Acknowledgment by user**: The message is displayed until the user acknowledges it
- ▶ Tap **Input**
- ▶ Select the desired digital input
- ▶ To switch to the previous display, tap **Back**



**Further information:** "Messages", Page 278

## Deleting error messages

You can delete individual existing error messages.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Settings**
  - **Messages**
- ▶ Tap the desired message entry
- ▶ Tap **Remove the entry**
- ▶ Tap **OK** to confirm deletion
- ▶ The error message is deleted

## 7.9.6 Backing up and restoring OEM settings

All settings of the OEM area can be backed up as a file so that they are available after a reset to the factory default settings has been performed or for installation on multiple units.

### Back-up OEM-specific folders and files

The settings of the OEM area can be backed up as a ZIP file on a USB mass storage device or connected network drive.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Back up and restore**
  - **Back-up OEM-specific folders and files**
  - **Save as ZIP**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Select the folder to which you want to copy the data
- ▶ Specify a name for the data, e.g. "<yyyy-mm-dd>\_OEM\_config"
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- ▶ Tap **OK** to confirm the successful backup of the data
- > The data were saved

### Restore OEM specific folders and files



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in the sequence
  - **OEM area**
  - **Back up and restore**
  - **Restore OEM specific folders and files**
  - **Load as ZIP**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Navigate to the folder containing the backup file
- ▶ Select the backup file
- ▶ Tap **Select**
- ▶ Confirm the successful transfer with **OK**

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations
- ▶ Tap **Safely remove**
- ▶ The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device

## 7.9.7 Configuring the unit for screenshots

### ScreenshotClient

With the ScreenshotClient PC software, you can use a computer to take screenshots of the active screen of the product.

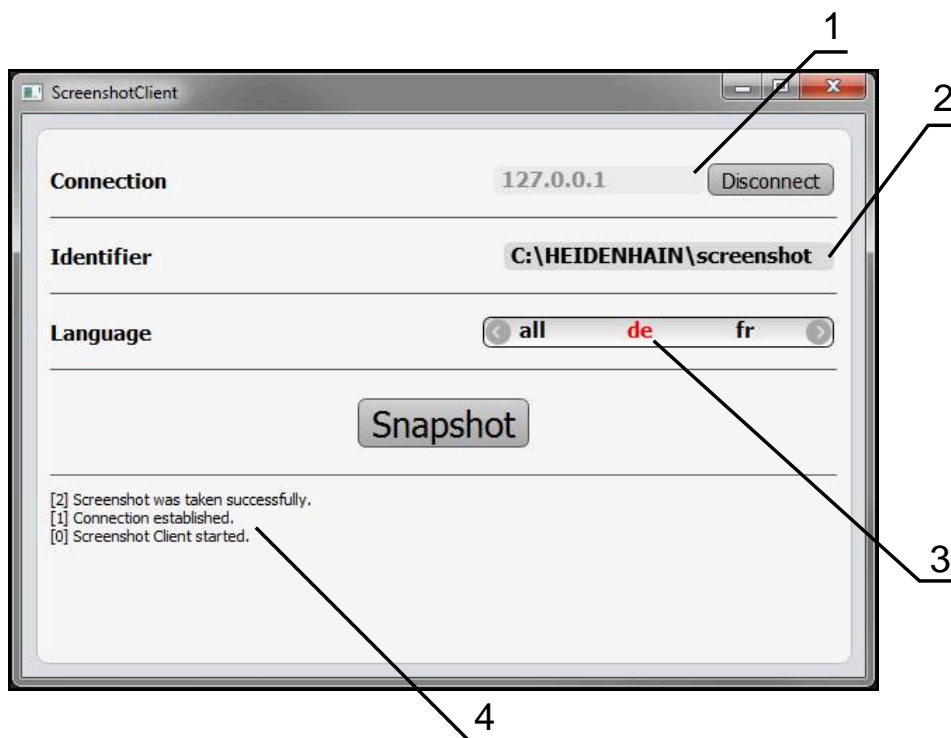


Figure 24: The ScreenshotClient user interface

- 1 Connection status
- 2 File path and file name
- 3 Language selection
- 4 Status messages



ScreenshotClient is included in the standard installation of **POSITIP 8000 Demo**.



For a detailed description, please refer to the **POSITIP 8000 Demo User's Manual**. This User's Manual is available in the "Documentation" folder of the product website.

**Further information:** "Demo software for the product", Page 18

## Activating remote access for screenshots

To connect ScreenshotClient with the product via the computer you need to activate **Remote access for screenshots** on the product.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Tap **OEM area**
- ▶ Activate **Remote access for screenshots** with the **ON/OFF** slide switch

**Further information:** "OEM area", Page 271

## 7.10 Backing up data

### 7.10.1 Back up settings

The product's settings can be backed up as a file so that they are available after a reset to the factory default settings has been performed or for installation on multiple units.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Back up and restore**
  - **Back up settings**

#### Performing a Complete backup

During a complete backup of the configuration, all settings of the product are backed up.

- ▶ Tap **Complete backup**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Select the folder to which you want to copy the configuration data
- ▶ Specify a name for the configuration data, e.g. "<yyyy-mm-dd>\_config"
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- ▶ Tap **OK** to confirm the successful backup of the configuration
- > The configuration file was backed up

**Further information:** "Back up and restore", Page 269

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device

## 7.10.2 Back up user files

The user files of the product can be backed up as a file to make it available after a reset to the factory default settings. This, together with the backing up of the settings, enables you to back up the complete configuration of your product.

**Further information:** "Back up settings", Page 132



All files from all user groups that are stored in the respective folders are backed up and can be restored as user files.

The files in the **System** folder are not restored.

### Performing back up

The user files can be backed up as a ZIP file on a USB mass storage device or connected network drive.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Back up and restore**
  - **Back up user files**
- ▶ Tap **Save as ZIP**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Select the folder to which you want to copy the ZIP file
- ▶ Specify a name for the ZIP file, e.g. "<yyyy-mm-dd>\_config"
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- ▶ Tap **OK** to confirm successful backup of the user files
- > The user files were backed-up.

**Further information:** "Back up and restore", Page 269

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



# 8

**Setup**

## 8.1 Overview

This chapter contains all the information necessary for setting up the product.

During setup, the setup engineer (**Setup**) configures the product for use on the machine tool in the respective applications. This includes, for example, setting up operators and creating preset tables and tool tables.



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

## 8.2 Logging in for setup

### 8.2.1 User login

To set up the product, the **Setup** user must log in.



- ▶ Tap **User login** in the main menu
- ▶ If required, log out the user who is currently logged in
- ▶ Select the **Setup** user
- ▶ Tap the **Password** input field
- ▶ Enter the password "**setup**"



If the password does not match the default password, ask a **Setup** user or **OEM** user for the assigned password.

If the password is no longer known, contact a HEIDENHAIN service agency.

- ▶ Confirm the entry with **RET**
- ▶ Tap **Log in**





## 8.2.2 Performing the reference mark search after startup



If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining operation.

**Further information:** "Defining the upper limit for the spindle speed", Page 173



If the reference mark search after unit start is active, then all of the unit's functions will be disabled until the reference mark search has been successfully completed.

**Further information:** "Reference marks (Encoder)", Page 250



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

If the reference mark search is active on the unit, then a wizard will ask you to traverse the reference marks of the axes.

- ▶ After logging in, follow the instructions of the wizard
- > The Reference symbol stops blinking upon successful completion of the reference mark search

**Further information:** "Operating elements of the position display", Page 78

**Further information:** "Activating the reference mark search", Page 116

## 8.2.3 Setting the language

The user interface language is English. You can change to another language, if desired.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
  - > The logged-in user is indicated by a check mark
  - ▶ Select the logged-in user
  - > The language selected for the user is indicated by a national flag in the **Language** drop-down list
  - ▶ Select the flag for the desired language from the **Language** drop-down list
  - > The user interface is displayed in the selected language

## 8.2.4 Changing the password

You must change the password to prevent unauthorized configuration.

The password is confidential and must not be disclosed to any other person.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
- > The logged-in user is indicated by a check mark
- ▶ Select the logged-in user
- ▶ Tap **Password**
- ▶ Enter the current password
- ▶ Confirm entry with **RET**
- ▶ Enter the new password and repeat it
- ▶ Confirm entry with **RET**
- ▶ Tap **OK**
- ▶ Close the message with **OK**
- > The new password is available the next time the user logs in

## 8.3 Single steps for setup



The following setup steps build on each other.

- ▶ To correctly set up the product, make sure to perform the steps in the order described here

**Prerequisite:** You are logged on as a user of the **Setup** type (see "Logging in for setup", Page 136).

---

### Basic settings

---

- Setting the date and time
- Setting the units of measure
- Entering and configuring users
- Adding the Operating Instructions
- Configuring the network
- Configuring the network drive
- Configuring operation with a mouse or touchscreen
- Configuring the USB keyboard

---

### Preparing machining processes

---

- Creating a tool table
- Creating a preset table

---

### Backing up data

---

- Back up settings
- Back up user files

## NOTICE

### Loss of or damage to configuration data!

If the product is disconnected from the power source while it is on, the configuration data can be lost or corrupted.

- ▶ Back up the configuration data and keep the backup for recovery purposes

### 8.3.1 Basic settings



The commissioning engineer (**OEM**) may have already carried out several basic settings.

## Setting the date and time



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Date and time**
- The set values are displayed in the following format: Year, month, day, hour, minute
- ▶ To set the date and time in the middle line, drag the columns up or down
- ▶ Tap **Set** to confirm
- ▶ Select the desired format from the **Date format** list:
  - MM-DD-YYYY: Display as month, day, year
  - DD-MM-YYYY: Display as day, month, year
  - YYYY-MM-DD: Display as year, month, day

**Further information:** "Date and time", Page 227

## Setting the units of measure

You can set various parameters to define the units of measure, rounding methods and decimal places.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Units**
- ▶ To set a unit of measure, tap the corresponding drop-down list and select the unit
- ▶ To set the rounding method, tap the corresponding drop-down list and select the rounding method
- ▶ To set the number of decimal places displayed, tap - or +

**Further information:** "Units", Page 228

## Entering and configuring users

The following user types, which have different rights, are defined in the product's factory default settings:

- **OEM**
- **Setup**
- **Operator**

### Creating a user and password

You can create new **Operator** users. You can use any characters for the user ID and the password. These entries are case-sensitive.

**Prerequisite:** An **OEM** or **Setup** user is logged in.



It is not possible to create new **OEM** or **Setup**-type users.



▶ Tap **Settings** in the main menu



▶ Tap **User**



▶ Tap **Add**

▶ Tap the **User ID** input field



The **User ID** is displayed for user selection, e.g. at the login prompt.

The **User ID** cannot be changed once it has been defined.

- ▶ Enter the user ID
- ▶ Confirm the entry with **RET**
- ▶ Tap the **Name** input field
- ▶ Enter the name of the new user
- ▶ Confirm the entry with **RET**
- ▶ Tap the **Password** input field
- ▶ Enter the new password and repeat it
- ▶ Confirm the entry with **RET**



You can show the contents of the password fields in plain text and hide them again.

- ▶ Use the **ON/OFF** sliding switch to show or hide the contents

- ▶ Tap **OK**
- > A message appears
- ▶ Close the message with **OK**
- > The user is created with the basic data. The user can then further edit the data himself later

## Configuring the user

After creating a new **Operator**-type user, you can add or edit the following user data:

- Name
- First name
- Department
- Password
- Language
- Auto login



If automatic user login is active for one or more users, the last user who logged in is automatically logged in when the product is switched on. Neither the user ID nor the password needs to be entered.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
- ▶ Select the user
- ▶ Tap the input field whose contents you want to edit: **Name**, **First name**, **Department**
- ▶ Edit the contents and confirm your changes with **RET**
- ▶ To change the password, tap **Password**
- > The **Change password** dialog box appears
- ▶ When changing the password of the logged-in user, enter the current password
- ▶ Confirm the entry with **RET**
- ▶ Enter the new password and repeat it
- ▶ Confirm the entries with **RET**
- ▶ Tap **OK**
- > A message appears
- ▶ Close the message with **OK**
- ▶ To change the language, select the flag for the desired language in the **Language** drop-down list
- ▶ Use the **ON/OFF** slider to activate or deactivate the **Auto login** function

## Deleting users

You can remove **Operator**-type users that are no longer needed.



**OEM** and **Setup**-type users cannot be deleted.

**Prerequisite:** A user of **OEM** or **Setup**-type is logged in.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **User**
- ▶ Tap the user you want to delete
- ▶ Tap **Remove user account**
- ▶ Enter the password of the authorized user (**OEM** or **Setup**)
- ▶ Tap **OK**
- > The user is deleted

## Adding the Operating Instructions

The product provides the possibility to upload the corresponding Operating Instructions in the desired language. You can copy the Operating Instructions from the supplied USB mass storage device to the product.

The most recent version of the Operating Instructions is also available at [www.heidenhain.com](http://www.heidenhain.com).

**Prerequisite:** The Operating Instructions are available as a PDF file.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Documentation**
  - **Add Operating Instructions**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Navigate to the folder containing the new Operating Instructions



If you have accidentally tapped the wrong folder, you can return to the previous folder.

- ▶ Tap the file name that is displayed above the list

- ▶ Select file
- ▶ Tap **Select**
- > The Operating Instructions are copied to the product
- > Any existing Operating Instructions will be overwritten
- ▶ Confirm the successful transfer with **OK**
- > The Operating Instructions can be opened and displayed on the product

## Configuring the network

### Network settings



Contact your network administrator for the correct network settings for configuring the product.

**Prerequisite:** The unit is connected to a network.

**Further information:** "Connecting a network peripheral", Page 54



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Interfaces**
- ▶ Tap **Network**
- ▶ Tap the desired interface (**X116** or **X117**)
- > The MAC address is detected automatically
- ▶ Depending on the network environment, use the **ON/OFF** slider to activate or deactivate the **DHCP** function
- > If DHCP is active, the network settings are obtained automatically as soon as the IP address is assigned
- ▶ If DHCP is not active, enter the **IPv4 address, IPv4 subnet mask** and **IPv4 standard gateway**
- ▶ Confirm the entries with **RET**
- ▶ Depending on the network environment, use the **ON/OFF** slider to activate or deactivate the **IPv6 SLAAC** function
- > If IPv6 SLAAC is active, the network settings are obtained automatically as soon as the IP address is assigned
- ▶ If IPv6 SLAAC is not active, enter the **IPv6 address, IPv6 subnet prefix length** and **IPv6 standard gateway**
- ▶ Confirm the entries with **RET**
- ▶ Enter the **Preferred DNS server** and, if required, the **Alternative DNS server**
- ▶ Confirm the entries with **RET**
- > The configuration of the network connection is applied

**Further information:** "Network", Page 230



## Configuring the network drive

You will need the following data for configuring the network drive:

- **Name**
- **Server IP address or host name**
- **Shared folder**
- **User name**
- **Password**
- **Network drive options**



Contact your network administrator for the correct network settings for configuring the product.

**Prerequisite:** The product is connected to a network and a network drive is available.

**Further information:** "Connecting a network peripheral", Page 54



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Interfaces**
- ▶ Tap **Network drive**
- ▶ Enter the network drive details
- ▶ Confirm the entries with **RET**
- ▶ Use the **ON/OFF** slider to activate or deactivate the **Show password** function
- ▶ If required, select **Network drive options**
  - Select **Authentication** for encrypting the password in the network
  - Configure the **Mount options**
  - Tap **OK**
- ▶ Tap **Mount**
- ▶ The connection to the network drive is established

**Further information:** "Network drive", Page 231

## Configuring operation with a mouse or touchscreen

The product can be operated either via the touchscreen or a connected (USB) mouse. If the product is in its factory default setting, touching the touchscreen deactivates the mouse. Alternatively, you can set that the product is operated either only via the mouse or only via the touchscreen.

**Prerequisite:** A USB mouse is connected to the product.

**Further information:** "Connecting input devices", Page 54

You can modify the touch sensitivity of the touchscreen to allow operation under special conditions (e.g. for operation with gloves).



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Input devices**
- ▶ Select the desired option from the **Touchscreen sensitivity** drop-down list
- ▶ Select the desired option from the **Mouse substitute for multitouch gestures** drop-down list

**Further information:** "Input devices", Page 226

## Configuring the USB keyboard

The factory default language for the keyboard assignment is English. You can switch the keyboard assignment to the desired language.

**Prerequisite:** A USB keyboard is connected to the product.

**Further information:** "Connecting input devices", Page 54



- ▶ Tap **Settings** in the main menu



- ▶ Tap **General**
- ▶ Tap **Input devices**
- ▶ Select the flag for the desired language from the **USB keyboard layout** drop-down list
- ▶ The keyboard assignment corresponds to the selected language

**Further information:** "Input devices", Page 226

### 8.3.2 Preparing machining processes

Depending on the intended use, the machine setter (**Setup**) can prepare the unit for a special machining process through configuration of the tool tables and preset tables.



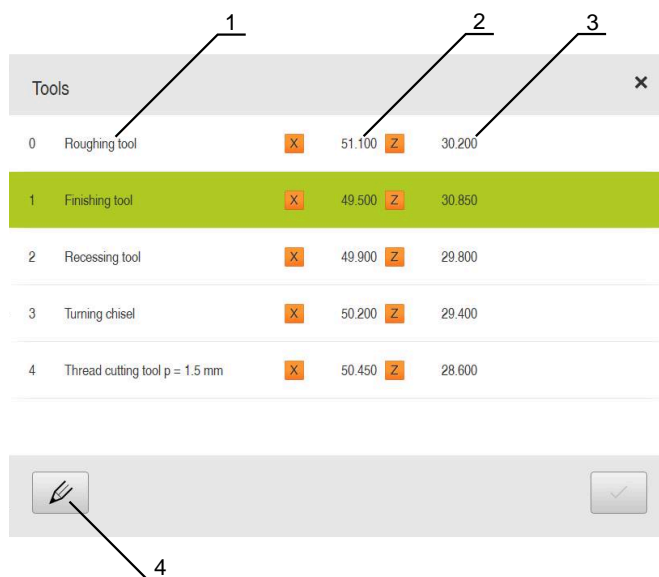
The following activities can also be performed by **Operator**-type users.

#### Creating a tool table

You usually enter the coordinates in accordance with how the workpiece is dimensioned in the drawing.

You must specify the **X** tool coordinate and the **Z** tool coordinate of the turning tool to be used. The **Set tool data** function allows you to calibrate your tools directly on the lathe.

From the status bar, you can access the tool table, which contains these specific parameters for each tool that is used. You can save a maximum of 99 tools in the tool table.



- 1 Tool type
- 2 Tool diameter
- 3 Tool length
- 4 Edit tool table

#### Tool parameters

You can define the following parameters:

Description	Parameter	
<b>Tool type</b>	<b>X</b> tool coordinate	<b>Z</b> tool coordinate
Designation that uniquely identifies the tool	Tip of the tool cutting edge in the Z axis	Tip of the tool cutting edge in the X axis

### Creating a tool



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears



- ▶ Tap **Open table**
- > The **Tool table** dialog box appears



- ▶ Tap **Add**
- ▶ Enter a name in the **Tool type** input field
- ▶ Confirm the entry with **RET**
- ▶ Tap the input fields one after the other, and enter the corresponding values
- ▶ Change the unit of measure in the selection menu, if required
- > The entered values are converted
- ▶ Confirm the entry with **RET**
- > The defined tool is added to the tool table



- ▶ To protect the entry for a tool from accidental changes or deletion, tap the **Lock** symbol next to the tool's entry



- > The symbol changes and the entry is locked



- ▶ Tap **Close**
- > The **Tool table** dialog box is closed

### Calibrating a tool



- ▶ Tap **Manual operation** in the main menu
- > The user interface for Manual mode appears



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Tool data** in the dialog box
- > The **Set tool data** dialog opens
- ▶ Move the tool to the desired position



- ▶ Tap **Save position**
- > The current position of the tool is saved
- ▶ Retract the tool to a safe position
- ▶ Enter the desired position data in the input fields



- ▶ Tap **Confirm** in the wizard
- > The **Select the tool** dialog box appears
- ▶ Select the desired tool in the **Selected tool** input field:
  - ▶ To overwrite an existing tool, select an entry from the tool table
  - ▶ To add a new tool, enter a number that has not yet been assigned in the tool table and confirm by pressing **RET**



- ▶ Tap **Confirm** in the wizard
- > The probed coordinates are adopted for the tool

### Deleting a tool



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears



- ▶ Tap **Open table**
- > The **Tool table** dialog box appears
- ▶ To select one or more tools, tap the checkbox in the relevant row
- > The active checkbox is highlighted in green



The entry for a tool can be locked to prevent accidental changes or deletion.

- ▶ Tap the **Unlock** symbol next to the entry
- > The symbol changes and the entry is unlocked



- ▶ Tap **Delete**
- > A message appears
- ▶ Close the message with **OK**
- > The selected tool is deleted from the tool table

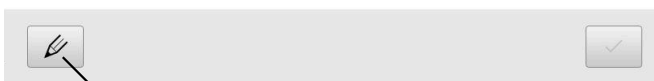


- ▶ Tap **Close**
- > The **Tool table** dialog box is closed

### Creating a preset table

You can access the preset table on the status bar. The preset table contains the absolute positions of the presets with respect to the reference mark. You can save a maximum of 99 presets in the preset table.

Presets				x
0		Xe	0.000 Z	0.000
1	Preset 1	Xe	-54.250 Z	78.230
2	Preset 2	Xe	183.998 Z	-69.251



- 1 Designation
- 2 Coordinates
- 3 Edit the preset table

## Defining presets

You can define the preset table in the following ways:

Designation	Description
Touch-off	Probing a workpiece using a tool. You must define the respective tool position manually as a preset
Numerical input	You must manually enter the numeric value of the preset into the preset table



Depending on the application, users of the type **Operator** define the presets.

## Touching off presets



- ▶ Tap **Manual operation** in the main menu
- > The user interface for Manual mode is displayed



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Presets** in the dialog box
- > The **Set preset data** dialog box opens
- ▶ Move the tool to the desired position



- ▶ Tap **Save position**
- > The current position of the tool is saved
- ▶ Retract the tool to a safe position
- ▶ Enter the desired position data in the input fields



- ▶ Tap **Confirm** in the wizard
- > The dialog Select preset opens
- ▶ Select the desired preset in the **Selected preset** input field:
  - ▶ To overwrite an existing preset, select an entry from the preset table
  - ▶ To create a new preset, enter a number that has not yet been assigned in the preset table and confirm with **RET**



- ▶ Tap **Confirm** in the wizard
- > The probed coordinates are adopted as a preset

## 8.4 Back up settings

The product's settings can be backed up as a file so that they are available after a reset to the factory default settings has been performed or for installation on multiple units.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Back up and restore**
  - **Back up settings**

### Performing a Complete backup

During a complete backup of the configuration, all settings of the product are backed up.

- ▶ Tap **Complete backup**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product .
- ▶ Select the folder to which you want to copy the configuration data
- ▶ Specify a name for the configuration data, e.g. "<yyy-mm-dd>\_config"
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- ▶ Tap **OK** to confirm the successful backup of the configuration
- > The configuration file was backed up

**Further information:** "Back up and restore", Page 269

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device

## 8.5 Back up user files

The user files of the product can be backed up as a file to make it available after a reset to the factory default settings. This, together with the backing up of the settings, enables you to back up the complete configuration of your product.

**Further information:** "Back up settings", Page 132



All files from all user groups that are stored in the respective folders are backed up and can be restored as user files.  
The files in the **System** folder are not restored.

### Performing back up

The user files can be backed up as a ZIP file on a USB mass storage device or connected network drive.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Open in succession:
  - **Back up and restore**
  - **Back up user files**
- ▶ Tap **Save as ZIP**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Select the folder to which you want to copy the ZIP file
- ▶ Specify a name for the ZIP file, e.g. "<yyyy-mm-dd>\_config"
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- ▶ Tap **OK** to confirm successful backup of the user files
- > The user files were backed-up.

**Further information:** "Back up and restore", Page 269

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



# 9

**Quick Start**

## 9.1 Overview

This chapter describes the production of an example workpiece. This chapter will guide you step by step through the unit's various machining options as you machine the example workpiece. For successful machining of the stud bolt you will need to perform the following machining steps:

Machining step	Mode of operation
Setting up the lathe	Manual operation
Roughing the outside contour	Manual operation
recess	Manual operation
Turning the chamfer	Manual operation
Finishing the outside contour	Manual operation
Thread cutting	MDI mode

### Requirements:

- X axis as NC axis
- Z axis as NC axis
- Rotational axis as NC axis or spindle with orientation

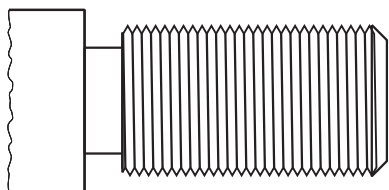


Figure 25: Example workpiece



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57

## 9.2 Logging in for Quick Start

### User login

For Quick Start, the **Operator** user must log in.



- ▶ Tap **User login** in the main menu
- ▶ If required, log out the user who is currently logged in
- ▶ Select the **Operator** user
- ▶ Tap the **Password** input field
- ▶ Enter the password "operator"

**i** If the password does not match the default password, ask a **Setup** user or **OEM** user for the assigned password.  
If the password is no longer known, contact a HEIDENHAIN service agency.

- ▶ Confirm entry with **RET**
- ▶ Tap **Log in**



## 9.3 Requirements

Use a manually operated lathe to machine the stud bolt. The following dimensioned technical drawing is available for the stud bolt:

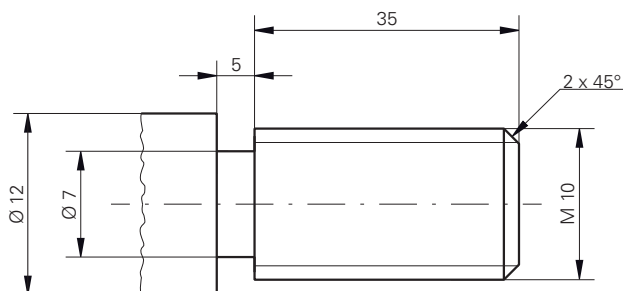


Figure 26: Example workpiece – technical drawing

### Lathe

- The lathe is switched on
- A workpiece blank with  $\varnothing$  12 mm is clamped into the lathe

### Product

- The axes are referenced  
**Further information:** "Conducting the reference mark search", Page 174

**Tools**

The following tools are available:

Tool	Image
Roughing tool	
Finishing tool	
Recessing tool 3 mm	
Turning chisel (45°)	
Thread turning insert P = 1.5 mm	

**Tool table**

For the example it is presumed that the tools for machining are not yet defined. All of the tools to be used must be added to the tool table by you in advance.

**Further information:** "Creating a tool table", Page 147



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears



- ▶ Tap **Open table**
- > The **Tool table** dialog box appears



- ▶ Tap **Add**
- ▶ Enter the designation **Finishing tool** in the **Tool type** input field
- ▶ Confirm your input with **RET**
- ▶ Enter the value **0** in the **X** input field
- ▶ Confirm your input with **RET**
- ▶ Enter the value **0** in the **Z** input field
- ▶ Confirm your input with **RET**
- > The defined finishing tool is added to the tool table
- ▶ Repeat this process for the other tools



- ▶ Tap **Close**
- > The **Tool table** dialog box is closed

## 9.4 Setting up the lathe

In the first machining step, you will set up the lathe. The unit requires the parameters of the individual tools for the calculation for the relative coordinate system. In order to manufacture a workpiece, you will need one of the presets you defined.

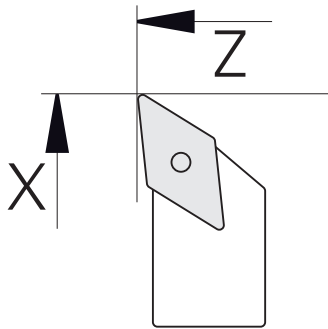


Figure 27: Finishing tool parameters

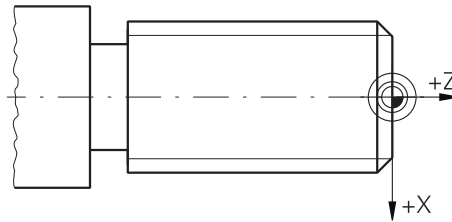


Figure 28: Preset

### Activation



- ▶ Tap **Manual operation** in the main menu
- > The user interface for manual operation is displayed

### Coupling axes



For a lathe with a **Z** saddle and a **Z<sub>0</sub>** top slide, you have the option of coupling both the **Z** and **Z<sub>0</sub>** axes.



- ▶ In the working space, drag the **Z axis key** to the right



- ▶ Tap **Couple**
- > The **Z<sub>0</sub>** axis is now coupled with the **Z** axis



- > The icon for the coupled axes is shown next to the **Z axis key**
- > The position value for the coupled axes is shown as a sum

### 9.4.1 Measuring the reference tool

For every tool used, determine the position of the cutting edges (for X and/or Z) in relation to the machine coordinate system or to the workpiece preset. To do so, first define a tool based on which all further parameters of the other tools are calculated. In this example, the finishing tool will be used as the reference tool.



- ▶ Insert the finishing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog appears
- ▶ Tap **Finishing tool**



- ▶ Tap **Confirm**
- > The **finishing tool** is shown in the status bar
- ▶ Set a spindle speed of 1500 rpm



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Tool data**
- > The **Set tool data** dialog box opens
- ▶ Approach the workpiece blank with the finishing tool and perform a touch-off



- ▶ When the appropriate Z value is reached, tap **Save position**
- ▶ Perform face turning with the finishing tool
- ▶ Move the tool to a safe position
- ▶ In the **Z** input field, enter the value **0**



- ▶ Approach the workpiece blank with the finishing tool
- ▶ When the appropriate X value is reached, tap **Save position**
- ▶ Turn a step on the outside diameter of the workpiece blank using the finishing tool
- ▶ Move the tool to a safe position
- ▶ Spindle OFF



- ▶ Measure the turned outside diameter using an appropriate measuring tool
- ▶ Enter the measured value in the **X** input field



- ▶ Tap **Confirm** in the wizard
- > The **Select the tool** dialog appears
- ▶ Tap **Finishing tool**
- ▶ Tap **Confirm** in the wizard
- > The parameters are added to the tool table

## 9.4.2 Tool measurement

You have already defined a finishing tool as the reference tool. For every additional tool, you must determine its offset from the reference tool. During measurement, the parameters of the measured tools are automatically offset from the parameters of the reference tool. The measured parameters are separate for each tool and are retained even after you have deleted the reference tool. In the example, the roughing tool is added as a tool.



- ▶ Insert the roughing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog appears
- ▶ Tap **Roughing tool**



- ▶ Tap **Confirm**
- > The **roughing tool** is shown in the status bar
- ▶ Set a spindle speed of 1500 rpm
- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Tool data**
- > The **Set tool data** dialog box opens
- ▶ Move the tool to the plane surface until tiny chips occur
- ▶ When the appropriate Z value is reached, tap **Save position**
- ▶ Move the tool to a safe position
- ▶ In the **Z** input field, enter the value **0**
- ▶ Approach the workpiece blank with the roughing tool
- ▶ When the appropriate X value is reached, tap **Save position**
- ▶ Turn a step on the outside diameter of the workpiece blank using the roughing tool
- ▶ Move the tool to a safe position
- ▶ Spindle OFF
- ▶ Measure the turned outside diameter using an appropriate means of measurement
- ▶ Enter the measured value in the **X** input field



- ▶ Tap **Confirm** in the wizard
- > The **Select the tool** dialog appears
- ▶ Tap **roughing tool**



- ▶ Tap **Confirm** in the wizard
- > The parameters are added to the tool table
- ▶ Repeat this process for the other tools



### 9.4.3 Finding the preset

To machine the stud bolt, you will need to find the preset. According to the drawing, the dimensions are referenced to the start of the thread. Based on this preset the product then calculates all values for the relative coordinate system.

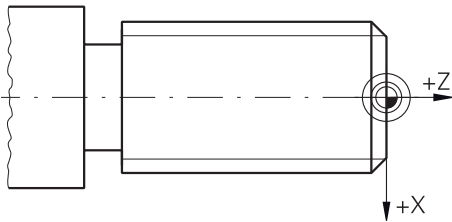


Figure 29: Example workpiece – finding the preset



- ▶ Insert the finishing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog appears



- ▶ Tap **Finishing tool**
- ▶ Tap **Confirm**
- > The **finishing tool** is shown in the status bar



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Presets** in the dialog
- > The **Set preset data** dialog box opens
- ▶ Move the finish-turning tool in the negative direction for approx. 1 mm behind the plane surface machined before



- ▶ Tap **Save position**
- > The current position of the tool is saved
- ▶ Move the tool to a safe position



- ▶ In the **Z** input field, enter the value **0**
- ▶ Tap **Confirm** in the wizard
- > The **Select preset** dialog box appears




- ▶ Select preset **0** in the **Selected preset** input field

- ▶ Tap **Confirm** in the wizard
- > The probed coordinate is loaded as preset


## 9.5 Roughing the outside contour

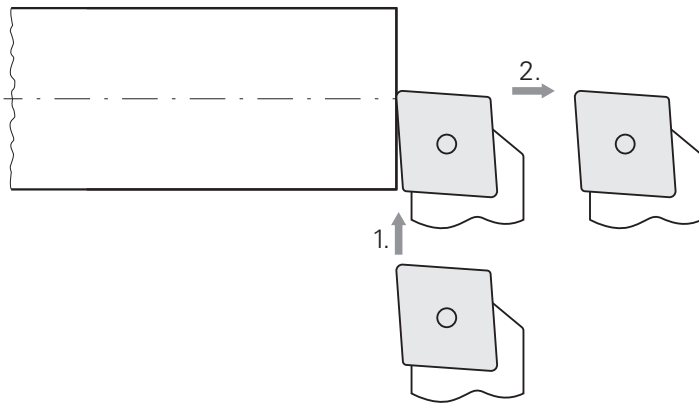In the second machining step, you will rough the outside contour. Turn the entire contour with a finishing allowance.

### Transverse roughing




- ▶ Insert the roughing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears
- ▶ Tap **Roughing tool**
- ▶ Tap **Confirm**
- > The associated tool parameters are applied by the product automatically
- > The **Tools** dialog box is closed
- ▶ Set a spindle speed of 1500 rpm
- ▶ Position the tool:
  - X:  $\emptyset$  14.0 mm
  - Z: 0.2 mm
- ▶ Position the tool:
  - X:  $\emptyset$  -0.4 mm (1.)
- ▶ Move the tool to a safe position (2.)

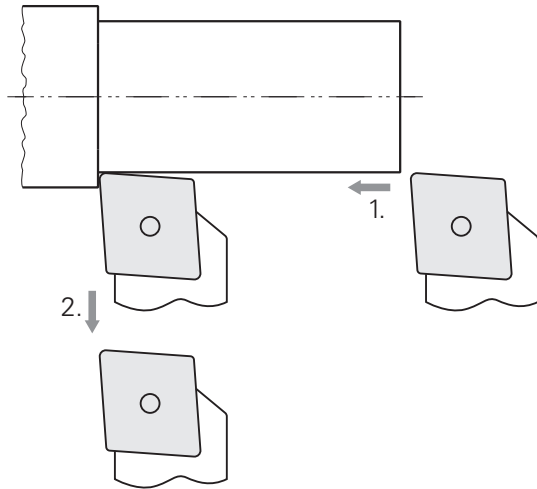**Longitudinal roughing**

- ▶ Position the tool:
  - X:  $\varnothing$  10.4 mm
  - Z: 2.0 mm
- ▶ Position the tool:
  - Z: -39.5 mm (1.)
- ▶ Position the tool:
  - X:  $\varnothing$  14.0 mm (2.)
- ▶ Move the tool to a safe position
- ▶ Switch off the spindle
- ▶ You have now successfully roughed the outside contour

## 9.6 Turning the recess

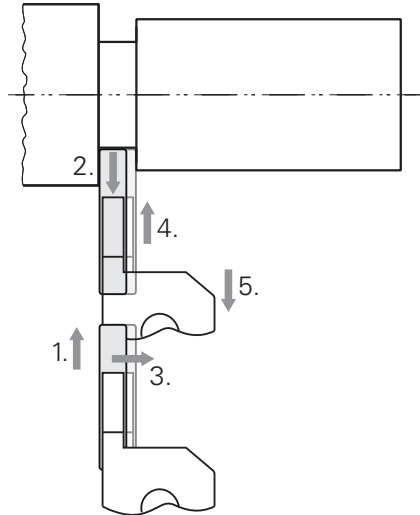
In the third machining step, you will turn the recess that serves as undercut.



- ▶ Insert the recessing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- ▶ The **Tools** dialog box appears
- ▶ Tap **Recessing tool 3 mm**
- ▶ Tap **Confirm**
- ▶ The associated tool parameters are applied automatically
- ▶ The **Tools** dialog box is closed
- ▶ Set a spindle speed of 400 rpm
- ▶ Position the tool:
  - X:  $\varnothing$  13.0 mm
  - Z: -40.0 mm
- ▶ Position the tool:
  - X:  $\varnothing$  7.0 mm (1.)
- ▶ Position the tool:
  - X:  $\varnothing$  13.0 mm (2.)
- ▶ Position the tool:
  - Z: -38.0 mm (3.)
- ▶ Position the tool:
  - X:  $\varnothing$  7.0 mm (4.)
- ▶ Position the tool:
  - X:  $\varnothing$  13.0 mm (5.)
- ▶ Move the tool to a safe position
- ▶ Switch off the spindle
- ▶ You have successfully machined the recess

## 9.7 Turning the chamfer

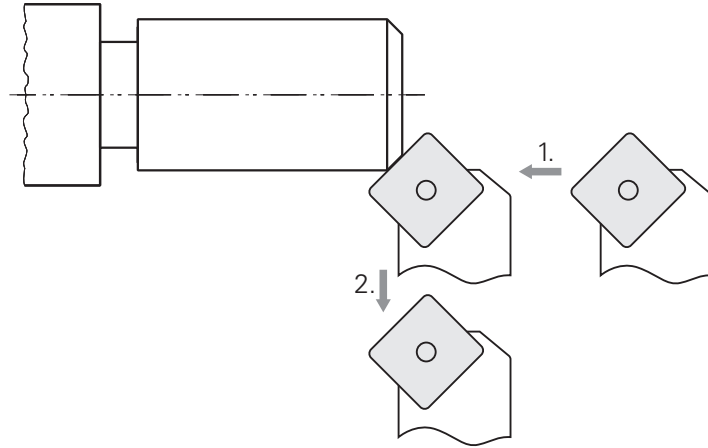In the fourth machining step, you will turn the chamfer. The chamfer is necessary for the stud bolt to engage better when it is screwed in.




- ▶ Insert the turning chisel (45°) into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears
- ▶ Tap **Turning tool 45°**
- ▶ Tap **Confirm**
- > The associated tool parameters are applied by the product automatically
- > The **Tools** dialog box is closed
- ▶ Set a spindle speed of 1500 rpm
- ▶ Position the tool:
  - X: Ø 7.0 mm
  - Z: 2.0 mm
- ▶ Move the tool to the workpiece edge until tiny chips occur
- ▶ Note down the Z axis value
- ▶ Feed the tool by 2.2 mm in the Z axis (oversize of 0.2 mm + 2 mm from the chamfer) (1.)
- ▶ Move the tool to a safe position (2.)
- ▶ Switch off the spindle
- > You have successfully turned the chamfer


## 9.8 Finishing the outside contour

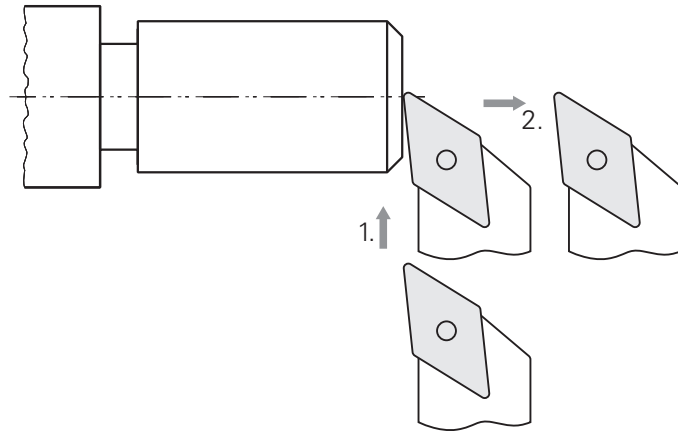In the fourth machining step, you will machine the outside contour using the finishing tool.

### Transverse finishing



- ▶ Insert the finishing tool into the tool holder
- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears
- ▶ Tap **Finishing tool**
- ▶ Tap **Confirm**
- > The associated tool parameters are applied by the product automatically
- > The **Tools** dialog box is closed
- ▶ Set a spindle speed of 2000 rpm
- ▶ Position the tool:
  - X:  $\emptyset$  14.0 mm
  - Z: 0.0 mm
- ▶ Position the tool:
  - X:  $\emptyset$  -0.4 mm (1.)
- ▶ Move the tool to a safe position (2.)

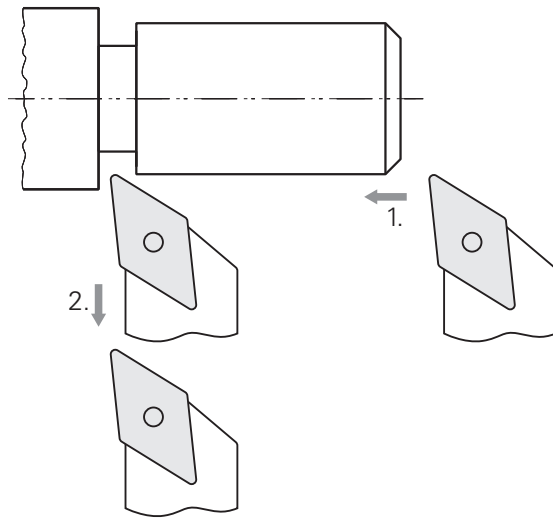**Longitudinal finishing**

- ▶ Position the tool:
  - X:  $\varnothing$  10.0 mm
  - Z: 2.0 mm
- ▶ Position the tool:
  - Z: -38.0 mm (1.)
- ▶ Move the tool to a safe position (2.)
- ▶ Switch off the spindle
- ▶ You have now successfully finish turned the outside contour

## 9.9 Machining threads

The thread is machined in MDI mode. You can find the input parameters for the thread in a book of metal tables, for example.

### Requirements:

- X axis as NC axis
- Z axis as NC axis
- Rotational axis as NC axis or spindle with orientation



If your lathe does not meet the requirements, you can machine the thread with a threading die, for example. Alternatively, you can use the wheels for the 1.5 mm pitch and turn the thread using the clasp nut.

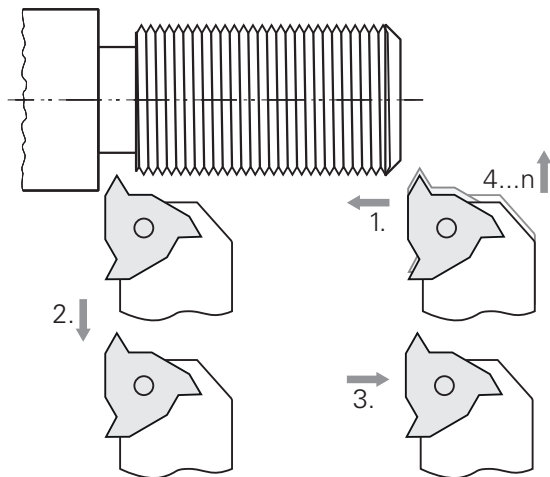


Figure 30: Example workpiece – machining the thread

### Activation



- ▶ Tap **MDI** in the main menu
- > The user interface for MDI mode is displayed



### 9.9.1 Defining threads



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog appears
- ▶ Tap **Thread turning insert P = 1.5**



- ▶ Tap **Confirm**
- > The associated tool parameters are applied automatically
- > The **Tools** dialog is closed



- ▶ Tap **Create** on the status bar
- > A new block is displayed
- ▶ In the **Block type** drop-down list, select the **Thread cutting (extended)** block type

- ▶ Enter the following parameters according to the book of metal tables:

- **Thread position:** External thread
- **Direction of rotation:** Clockwise
- **Safety clearance:** 5
- **Thread diameter:** 10
- **Thread depth:** 0.92
- **Cut depth:** 0.1
- **Finishing allowance:** 0.0
- **Thread pitch:** 1.5
- **Contour start in Z:** 0
- **Contour end in Z:** -37
- **Overrun path:** 3
- **Starting angle:** 0
- **Rotational speed:** 500
- **Feed rate in X:** 50
- **Air cuts:** 3



- ▶ Confirm each entry with **RET**
- ▶ To execute the block, tap **END**
- > The positioning aid is displayed
- > If the simulation window is activated, the thread is visualized

## 9.9.2 Thread cutting



- ▶ Insert the thread turning insert  $P = 1.5 \text{ mm}$  in the tool holder
- ▶ Tap the **NC START key**

- ▶ Set a spindle speed of 500 rpm
- ▶ Follow the instructions in the wizard
- ▶ After the first cut, measure over 10 turns and check the distances (15 mm)



- ▶ Follow the instructions in the wizard
- ▶ Tap **Close**
- > Program run is terminated
- > The wizard closes
- > Check the thread, for example with a counterpart or a thread ring gage
- > You have successfully machined the thread

# 10

**Manual operation**

## 10.1 Overview

This chapter describes the Manual operation mode and how to execute simple machining operations in this mode on a workpiece.

**i** Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.  
**Further information:** "Basic operation", Page 57

### Short description

By traversing the reference marks on the encoder scales, you make it possible to define an absolute position. When you have completed the reference mark search in Manual mode, you then set the presets that will be used as the basis for machining the workpiece in accordance with the drawing.

**i** Presetting in the Manual Operation mode is required in order to use the product in MDI mode.

**i** The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

Position measurement and tool selection for simple machining operations are described below.

### Activation



- ▶ Tap **Manual operation** in the main menu
- The user interface for manual operation is displayed

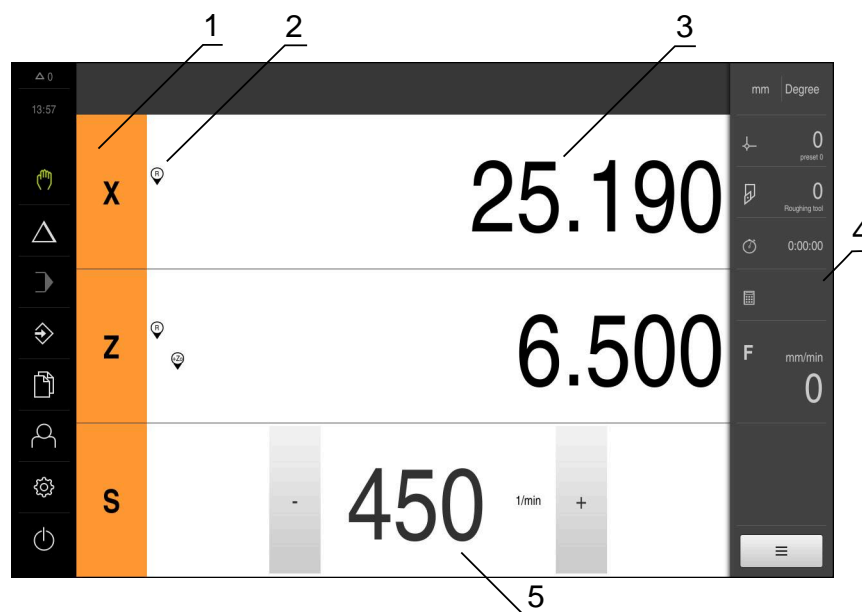


Figure 31: **Manual operation** menu

- 1 Axis key
- 2 Reference
- 3 Position display
- 4 Status bar
- 5 Spindle speed (machine tool)

## 10.2 Defining the upper limit for the spindle speed

If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining sequence.

For this purpose, the **Upper limit for spindle speed** appears every time the product is switched on.

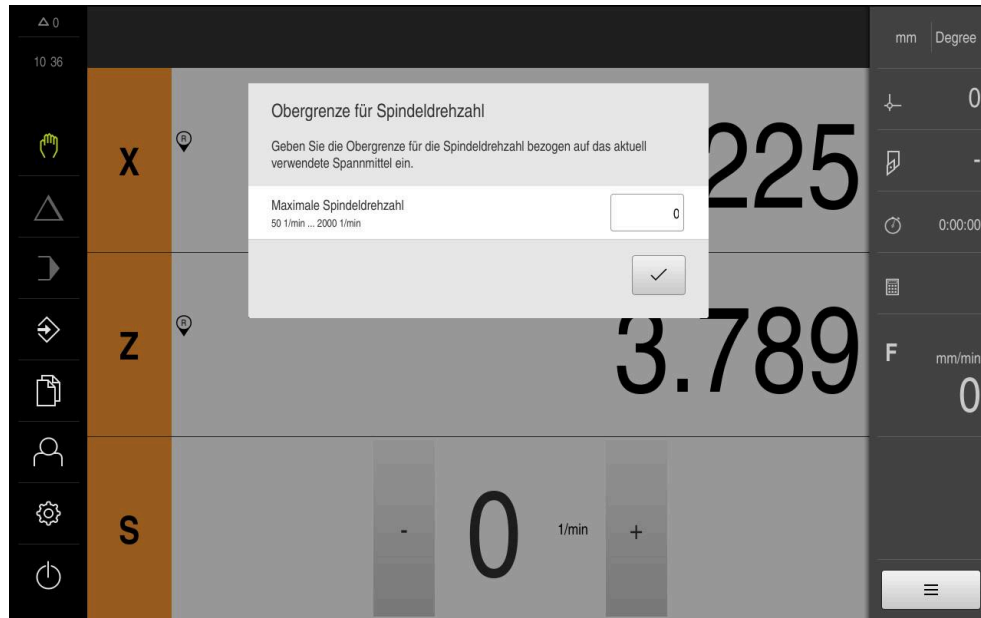


Figure 32: **Upper limit for spindle speed** dialog box

- ▶ Tap the **Maximum spindle speed** input field
- ▶ Enter the upper limit for the spindle speed with respect to the currently used clamping equipment
- ▶ Confirm your input with **RET**
- ▶ Tap **Confirm**
- > The upper limit is now adopted by the product
- > The **Upper limit for spindle speed** dialog box is closed



## 10.3 Conducting the reference mark search

With the help of reference marks, the unit can assign axis positions of the encoder to the machine.

If no reference marks for the encoder are provided by a defined coordinate system, you need to perform a reference mark search before you start measuring.



If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining operation.

**Further information:** "Defining the upper limit for the spindle speed", Page 173



If the reference mark search after unit start is active, then all of the unit's functions will be disabled until the reference mark search has been successfully completed.

**Further information:** "Reference marks (Encoder)", Page 250



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

If the reference mark search is active on the unit, then a wizard will ask you to traverse the reference marks of the axes.

- ▶ After logging in, follow the instructions of the wizard
- > The Reference symbol stops blinking upon successful completion of the reference mark search

**Further information:** "Operating elements of the position display", Page 78

**Further information:** "Activating the reference mark search", Page 116

### Starting the reference mark search manually

If the reference mark search was not performed on startup, you can start it manually later.



- ▶ Tap **Manual operation** in the main menu
- > The user interface for manual operation is displayed



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Reference marks**
- > Existing reference marks are cleared
- > The Reference symbol blinks
- ▶ Follow the instructions of the wizard
- > The Reference symbol stops blinking upon successful completion of the reference mark search

## 10.4 Defining presets

You can define presets on a workpiece in the Manual Operation mode in the following ways:

- Probing a workpiece with a tool (touch-off). Use this method to define the respective tool position as a datum.
- Move to the position and set it as a preset, or overwrite position value



The setup engineer (**Setup**) may have already made settings in the datum table.

**Further information:** "Creating a preset table", Page 149



When touching the workpiece with a tool, the product uses the parameters stored in the tool table.

**Further information:** "Creating a tool table", Page 147

### Requirement:

- A workpiece is clamped on the machine tool
- The axes have been homed

### 10.4.1 Touching off presets



- ▶ Tap **Manual operation** in the main menu
- > The user interface for Manual mode is displayed
- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Presets** in the dialog box
- > The **Set preset data** dialog box opens
- ▶ Move the tool to the desired position



- ▶ Tap **Save position**
- > The current position of the tool is saved
- ▶ Retract the tool to a safe position
- ▶ Enter the desired position data in the input fields



- ▶ Tap **Confirm** in the wizard
- > The dialog Select preset opens
- ▶ Select the desired preset in the **Selected preset** input field:
  - ▶ To overwrite an existing preset, select an entry from the preset table
  - ▶ To create a new preset, enter a number that has not yet been assigned in the preset table and confirm with **RET**



- ▶ Tap **Confirm** in the wizard
- > The probed coordinates are adopted as a preset

## 10.4.2 Setting a position as a preset

For simple machining operations, you can use the current position as a preset and perform simple position calculations.

### Prerequisite:

- A workpiece is clamped on the machine tool
- The axes are referenced



In a system with reference marks, zeroing and presetting are only possible after a reference run has been performed.

After a restart of the device, it would not be possible to determine the position of the presets without such a reference. In addition, the preset table would lose its validity without referencing, since it would not be possible to approach the stored points correctly.

**Further information:** "Conducting the reference mark search", Page 174



If you use the axis label X for direct input, the current preset will be shifted. As a result, the center point will be displaced from the center of the spindle.

Direct input via axis label X can be disabled.

**Further information:** "Diameter axis", Page 242

### Setting the current position as preset



- ▶ Approach the desired position
- ▶ Long-press the **axis key**
- > The active preset in the preset table is overwritten with the current position
- > The active preset is applied as the new value
- ▶ Perform the desired machining operation

### Defining the position values of the current position



- ▶ Approach the desired position
- ▶ In the working space, tap the **axis key** or the position value
- ▶ Enter the desired position value
- ▶ Confirm the entry with **RET**
- > The position value is applied to the current position
- > The entered position value is linked with the current position and overwrites the active preset in the preset table
- > The active preset is applied as the new value
- ▶ Perform the desired machining operation



## 10.5 Creating a tool

In the Manual Operation mode, you can enter the tools you want to use into the tool table.



The setup engineer (**Setup**) may have already made the settings in the tool table.

**Further information:** "Creating a tool table", Page 147

- A workpiece is clamped on the machine tool
- The axes have been homed



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears



- ▶ Tap **Open table**
- > The **Tool table** dialog box appears



- ▶ Tap **Add**
- ▶ Enter a name in the **Tool type** input field
- ▶ Confirm the entry with **RET**
- ▶ Tap the input fields one after the other, and enter the corresponding values
- ▶ Change the unit of measure in the selection menu, if required
- > The entered values are converted
- ▶ Confirm the entry with **RET**
- > The defined tool is added to the tool table
- ▶ To protect the entry for a tool from accidental changes or deletion, tap the **Lock** symbol next to the tool's entry
- > The symbol changes and the entry is locked



- ▶ Tap **Close**
- > The **Tool table** dialog box is closed

## 10.6 Calibrating tools

In order to determine the tool coordinates **X** and **Z**, and store them in the tool table, you can calibrate the tool with the **Set tool data** function.



- ▶ Tap **Manual operation** in the main menu
- > The user interface for Manual mode appears



- ▶ Tap **Auxiliary functions** in the status bar



- ▶ Tap **Tool data** in the dialog box
- > The **Set tool data** dialog opens
- ▶ Move the tool to the desired position



- ▶ Tap **Save position**
- > The current position of the tool is saved
- ▶ Retract the tool to a safe position



- ▶ Enter the desired position data in the input fields
- ▶ Tap **Confirm** in the wizard
- > The **Select the tool** dialog box appears
- ▶ Select the desired tool in the **Selected tool** input field:
  - ▶ To overwrite an existing tool, select an entry from the tool table
  - ▶ To add a new tool, enter a number that has not yet been assigned in the tool table and confirm by pressing **RET**



- ▶ Tap **Confirm** in the wizard
- > The probed coordinates are adopted for the tool

## 10.7 Selecting a tool

The currently selected tool is displayed on the status bar. Here you can also access the tool table where you can select the tool you want to use. The associated tool parameters are applied automatically.



The setup engineer (**Setup**) may have already made the settings in the tool table.

**Further information:** "Creating a tool table", Page 147



- ▶ Tap **Tools** on the status bar
- > The **Tools** dialog box appears
- ▶ Tap the tool you want to use



- ▶ Tap **Confirm**
- > The associated tool parameters are applied automatically
- > The selected tool is shown on the status bar
- ▶ Mount the desired tool on the machine tool

11

**MDI mode**

## 11.1 Overview

This chapter describes the Manual Data Input (MDI) operating mode and how to execute machining steps in single blocks in this mode.



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57

### Short description

MDI mode allows you to execute one machining block at a time. The values to be entered can be applied directly in the input field from a properly dimensioned production drawing.



Before you can use the product in the MDI mode, the presets must be set in the Manual Operation mode.

**Further information:** "Defining presets", Page 175

The functions provided by MDI mode enable efficient single-part production. For small-batch production, you can program the machining steps in Programming mode and then execute them in Program run mode.

**Further information:** "Programming", Page 201

**Further information:** "Program run", Page 191

### Calling up



- ▶ Tap **MDI** in the main menu



- ▶ Tap **Create** on the status bar
- The user interface for MDI mode is displayed

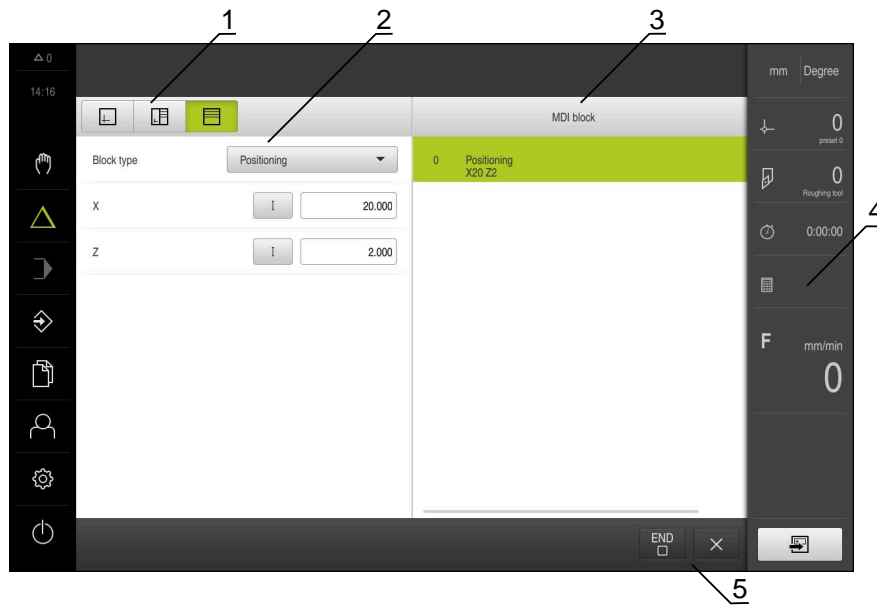


Figure 33: **MDI** menu

- 1 View bar
- 2 Block parameters
- 3 MDI block
- 4 Status bar
- 5 Block tools

## 11.2 Defining the upper limit for the spindle speed

If the product is configured with a **spindle axis S**, then you must define an upper limit for the spindle speed prior to a possible machining sequence.

For this purpose, the **Upper limit for spindle speed** appears every time the product is switched on.

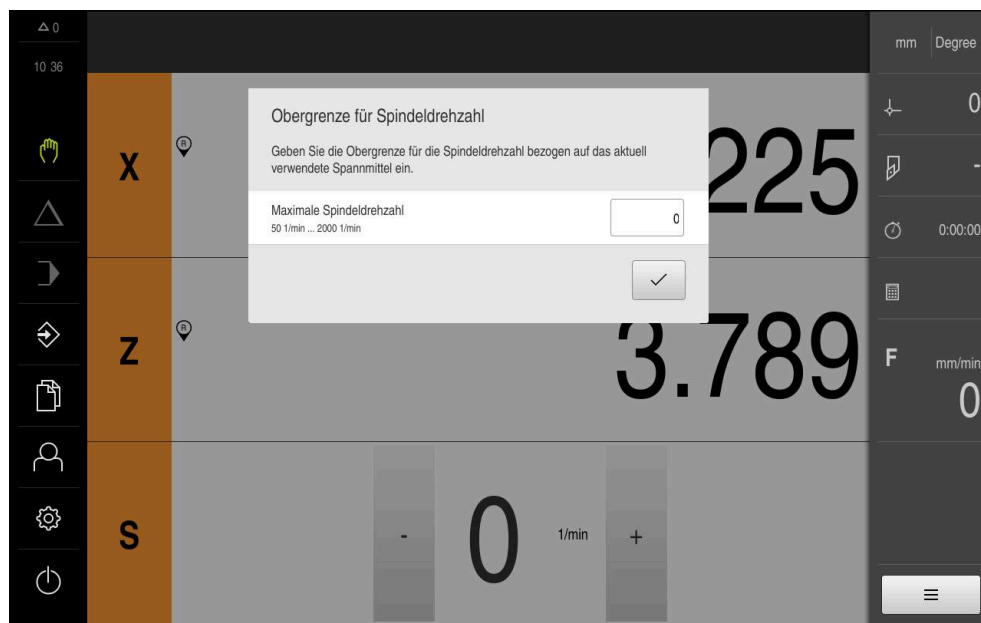


Figure 34: **Upper limit for spindle speed** dialog box

- ▶ Tap the **Maximum spindle speed** input field
- ▶ Enter the upper limit for the spindle speed with respect to the currently used clamping equipment
- ▶ Confirm your input with **RET**
- ▶ Tap **Confirm**
- > The upper limit is now adopted by the product
- > The **Upper limit for spindle speed** dialog box is closed




## 11.3 Block types

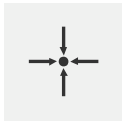You can use the following block types for machining in the MDI mode:

- Positioning functions
- Machining cycle

### 11.3.1 Positioning

You can manually define position values for positioning. Depending on the configuration of the connected machine tool, you can then move the tool to these positions either automatically or manually.



#### Actual position

Applies the current axis position to the input fields of the various block types

The following parameters are available:

#### Positioning block type

Parameter	Description
I	Incremental position value, i.e. the position value is referenced to the actual position

### 11.3.2 Machining cycle

If the lathe is configured for thread cutting, two machining cycles are available. Thread cutting (basic) allows you to execute a simple thread cut without downfeed. Thread cutting (extended) allows you to define an extended thread cycle with downfeed.

**i** Before defining a machining pattern, you must

- Define a suitable tool in the tool table
- Select the tool on the status bar

**Further information:** "Creating a tool table", Page 147

### Thread cutting (basic) block

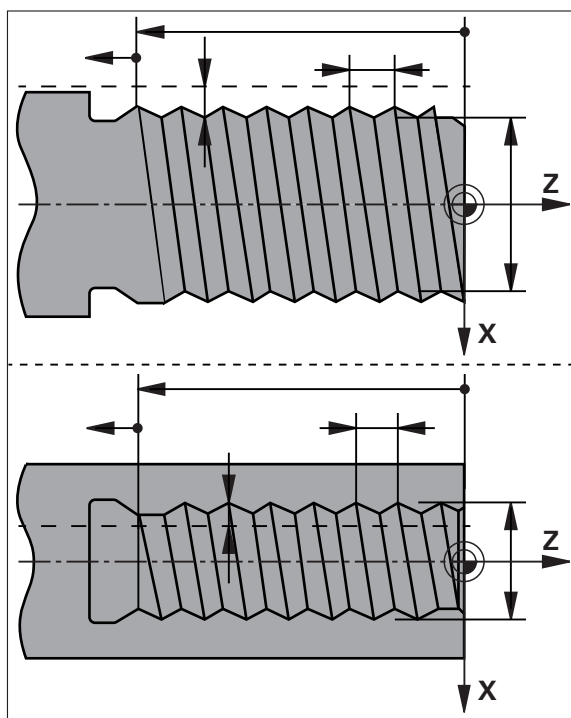



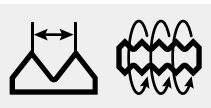





Figure 35: Schematic depiction of the **Thread cutting (basic)** block

Parameter	Description
<b>Thread position</b> 	Position of the thread <ul style="list-style-type: none"> <li>■ External thread</li> <li>■ Internal thread</li> </ul>
<b>Direction of rotation</b> 	Direction of rotation of the rotational axis <ul style="list-style-type: none"> <li>■ Right</li> <li>■ Left</li> </ul>
<b>Safety clearance</b>	Incremental to the thread depth, radial dimension
<b>Thread depth (diameter)</b>	Thread depth, diameter dimension
<b>Thread pitch</b> 	Pitch of the thread <ul style="list-style-type: none"> <li>■ In mm</li> <li>■ In threads per inch</li> </ul>
<b>Contour start in Z</b>	Start of the thread in Z
<b>Contour end in Z</b>	End of the thread in Z
<b>Overrun path</b>	Path at the end of thread for stopping the axes
<b>Starting angle</b>	Entrance angle in the rotational axis
<b>Rotational speed</b>	Rotational speed in rpm
<b>Feed rate in X</b>	Feed rate for downfeed to thread depth

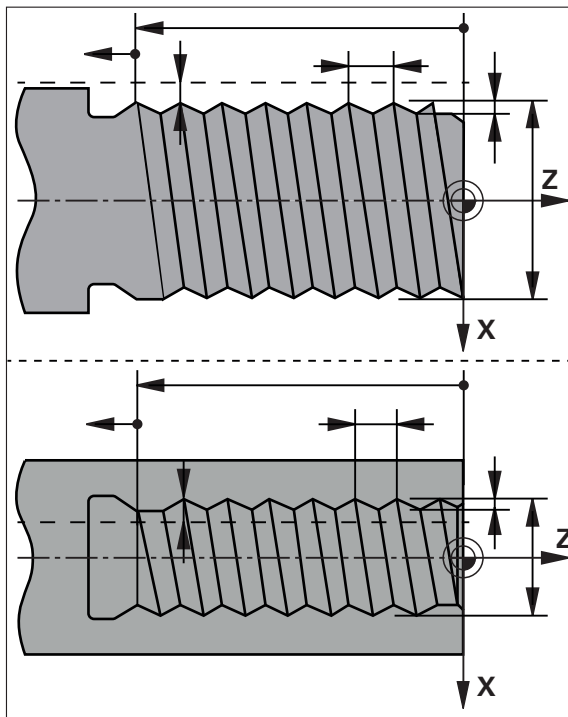

**Thread cutting block (extended)**Figure 36: Schematic depiction of the **Thread cutting (extended)** block

Parameter	Description
<b>Thread position</b>	Position of the thread <ul style="list-style-type: none"> <li>■ External thread</li> <li>■ Internal thread</li> </ul>
	
<b>Direction of rotation</b>	Direction of rotation of the rotational axis <ul style="list-style-type: none"> <li>■ Right</li> <li>■ Left</li> </ul>
	
<b>Safety clearance X</b>	Incremental to the thread diameter, radial dimension
<b>Thread diameter</b>	Rated diameter of thread (diameter dimension)
<b>Thread depth</b>	Incremental to the thread diameter, radial dimension
<b>Finishing allowance</b>	Finishing allowance for downfeed, radial dimension
<b>Thread pitch</b>	Pitch of the thread <ul style="list-style-type: none"> <li>■ In mm</li> <li>■ In threads per inch</li> </ul>
	
<b>Contour start in Z</b>	Start of the thread in Z
<b>Contour end in Z</b>	End of the thread in Z
<b>Overrun path</b>	Path at the end of thread for stopping the axes
<b>Starting angle</b>	Entrance angle in the rotational axis
<b>Rotational speed</b>	Rotational speed in rpm

Parameter	Description
Feed rate in X	Feed rate for downfeed to thread depth
Air cuts	Number of air cuts at the end (0 – 10)

## 11.4 Executing blocks

You can execute a positioning function and execute this block.



If enabling signals are missing, the running program is halted and the drives of the machine are stopped.

**Further information:** Manufacturer's documentation for the machine

### Executing blocks



- ▶ Tap **Create** on the status bar
- > A new block is displayed
- or
- > The last programmed MDI block is loaded along with all of its parameters
- ▶ Select the desired block type from the **Block type** drop-down list



- ▶ Based on the block type, define the relevant parameters
- ▶ To load the current axis position, tap **Actual position capture** in the appropriate input fields
- ▶ Confirm each input with **RET**



- ▶ To execute the block, tap **END**
- > The positioning aid is displayed
- > If the simulation window is activated, the current block is visualized
- > Depending on the block, user intervention may be required; the wizard will display the relevant instructions
- ▶ Follow the instructions in the wizard



- ▶ If you are using NC-controlled axes, then tap or press **NC START** on the product or machine tool



- ▶ In multi-step blocks, such as machining patterns, tap **Next** to jump to the next instruction

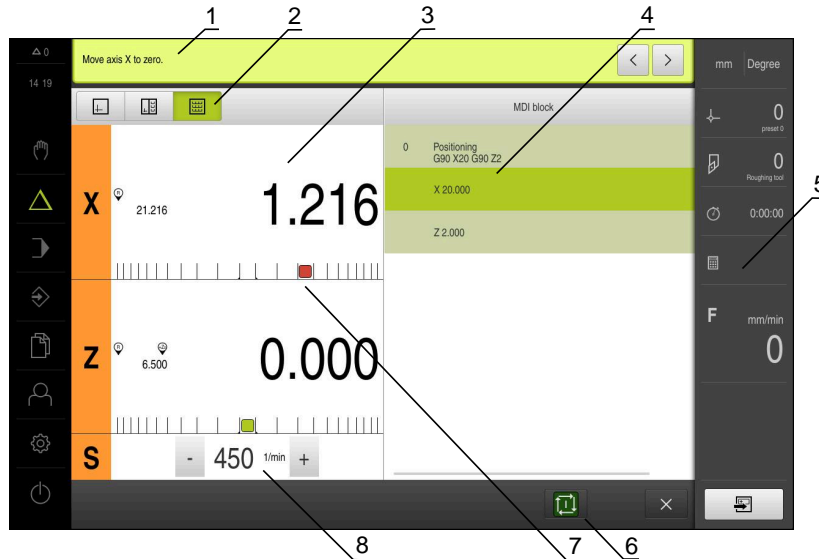


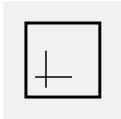
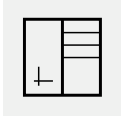

Figure 37: Example of a block in **MDI** mode

- 1 Wizard
- 2 View bar
- 3 Distance-to-go display
- 4 MDI block
- 5 Status bar
- 6 NC START key
- 7 Positioning aid
- 8 Spindle speed (machine tool)

## 11.5 Using the simulation window

You can display a visualization of the selected block in the optional simulation window.

The following options are available on the view bar:

Operating element	Function
	<b>Graphic</b> Display of simulation and blocks
	<b>Graphic-Position</b> Display of simulation, parameters (position values for program run, if required) and blocks
	<b>Position</b> Display of parameters (position values for program run, if required) and blocks

### 11.5.1 Depiction as contour view

The simulation window displays a contour view. The contour view aids in the precise positioning of the tool or with contour tracking in the machining plane.

The contour view uses the following colors (defaults):

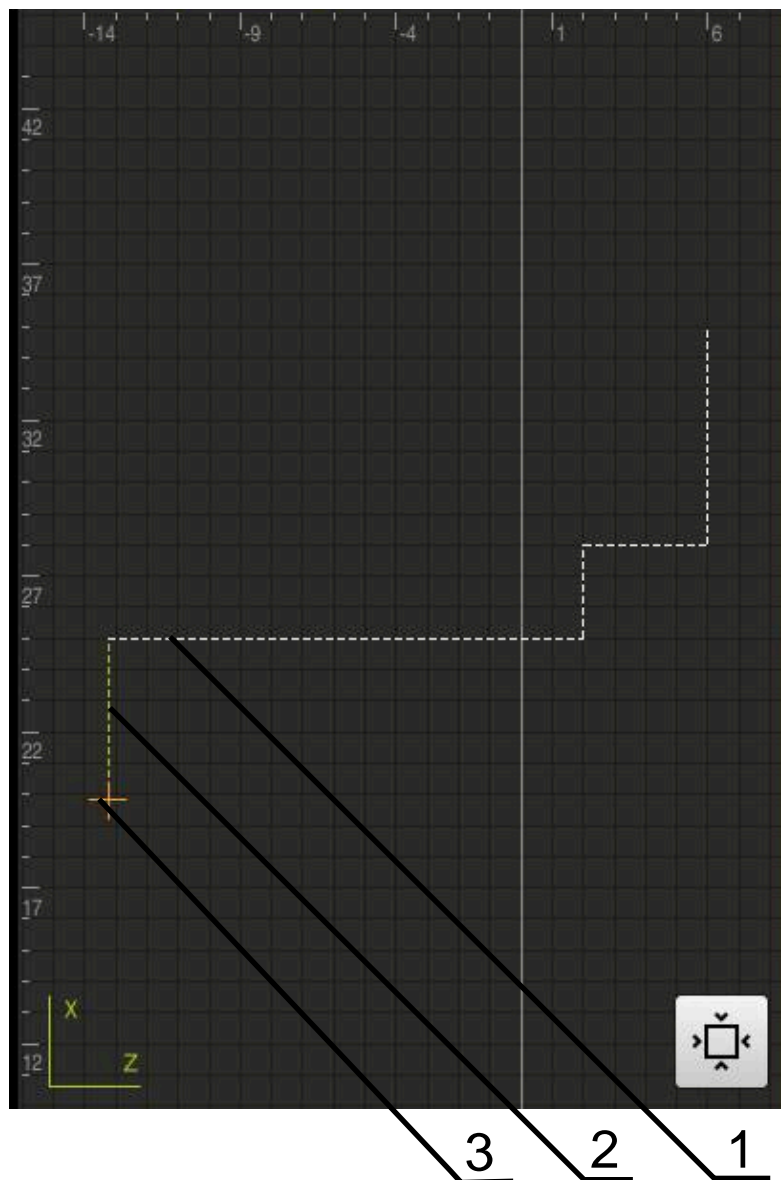


Figure 38: Simulation window with contour view

- 1 Machining pattern (white)
- 2 Current block or machining position (green)
- 3 Tool contour, tool position and tool track (orange)

#### Activating the simulation window



- ▶ Tap **Graphic-Position**
- The simulation window for the currently selected block appears



- ▶ Tap **Graphic** on the view bar to enlarge the simulation window
- The parameter view is hidden and the simulation window is enlarged

## 11.6 Working with the positioning aid

During positioning to the next nominal position, the product assists you by displaying a graphic positioning aid ("traversing to zero"). A scale is shown underneath each axis you traverse to zero. The graphic positioning aid is a small square that symbolizes the target position of the tool.

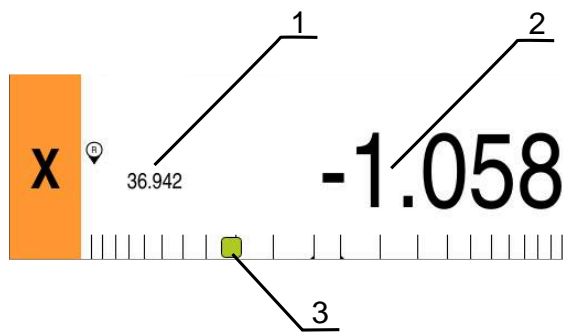


Figure 39: **Distance to go with position** view with graphical positioning aid

- 1 Actual value
- 2 Distance-to-go
- 3 Positioning aid

The positioning aid moves across the measuring scale when the tool center is located within a range of  $\pm 5$  mm of the nominal position. The color also changes in the following way:

Display of positioning aid	Meaning
Red	The tool center is moving away from the nominal positions
Green	The tool center is moving toward the nominal position

## 11.7 Applying the Scaling factor

If a scaling factor is activated for one or more axes, this scaling factor is multiplied by the stored nominal position during execution of a block. This enables you to mirror and scale a block.

You can activate a scaling factor in the quick access menu.

**Further information:** "Adjusting settings in the quick access menu", Page 84

**Example:**

The following **MDI block** is programmed:

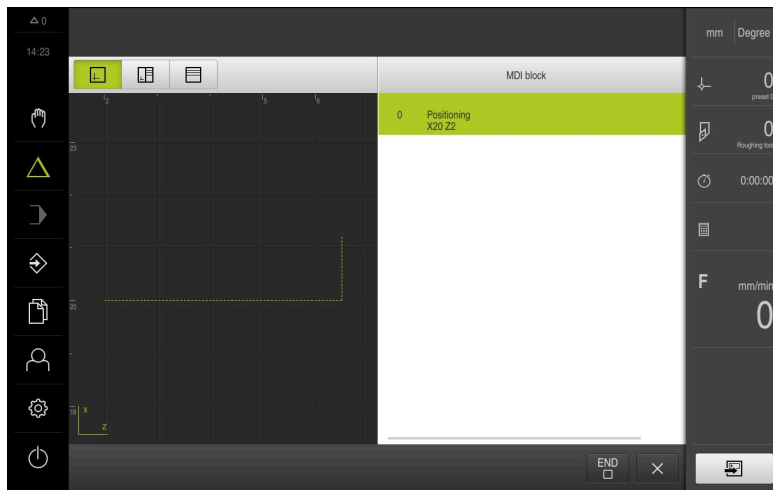


Figure 40: Example – MDI block

A **Scaling factor** of **-0.5** is activated for the **X** axis. The following **MDI block** will therefore be executed:

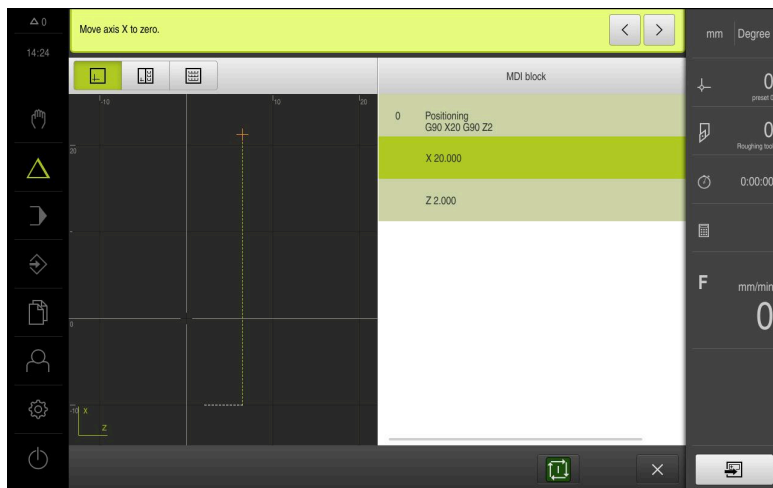


Figure 41: Example – Execution of an MDI block with scaling factor



If the calculated dimensions cannot be attained with the selected tool, the execution of the block is aborted.



The scaling factor cannot be changed during execution of a block.

# 12

**Program run**

## 12.1 Overview

This chapter describes the Program run operating mode and how to execute a previously created program in this mode.



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57

### Short description

In the Program run operating mode, you use an already created program for part production. It is not possible to change the program in this operating mode, but you can check in Single Block mode when running the program.

**Further information:** "In Single block mode", Page 195

The execution of the program run may vary depending on the machine tool and the product version:

- If the machine tool has NC-controlled axes, and the product uses a POSITIP 8000 NC1 software option, then the parameters for positioning movements are transferred directly to the machine tool. The individual steps are initiated via the NC START key on the machine tool.
- If the machine tool does not have any NC-controlled axis, then the you must perform positioning movements manually using the handwheel or the manual direction key.

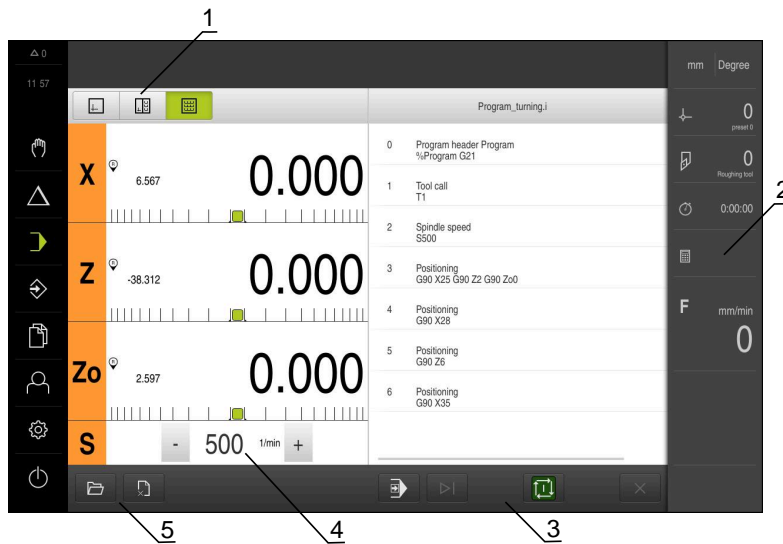
During execution of a program, the wizard guides you through the individual program steps. The optional simulation window can serve as a graphical positioning aid for the axes you need to move.



**Calling up**



- ▶ Tap **Program run** in the main menu
- > The user interface for Program Run is displayed



- 1 View bar
- 2 Status bar
- 3 Program control
- 4 Spindle speed (machine tool)
- 5 Program management

**i** If the **Z** axis and the **Zo** axis have been coupled, the Program run operating mode is disabled.

## 12.2 Using the program

The product displays a loaded program with the blocks and, when applicable, with the individual working steps of the blocks.

**m** If enabling signals are missing, the running program is halted and the drives of the machine are stopped.  
**Further information:** Manufacturer's documentation for the machine

**Requirement:**

- The appropriate workpiece and tool have been clamped
- A program \*.i file type has been loaded

**Further information:** "Managing programs", Page 199

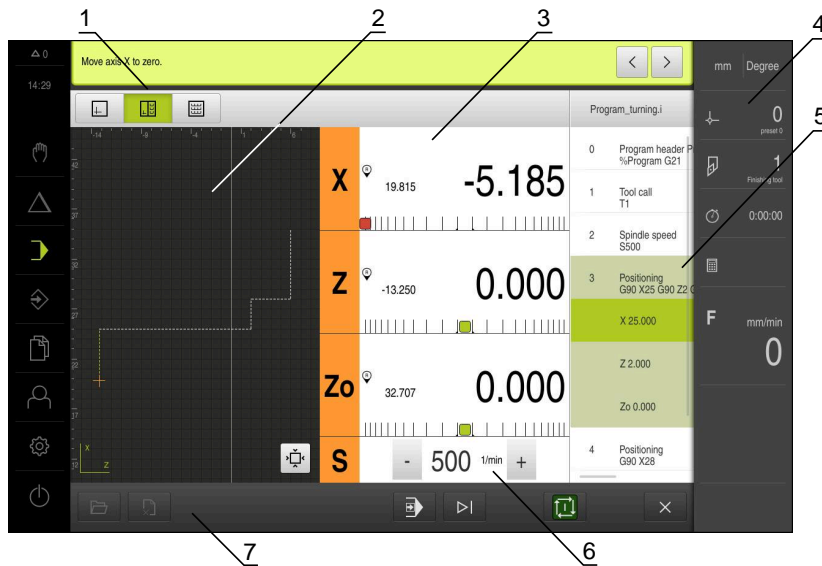


Figure 42: Example of a program in the **Program run** operating mode

- 1 View bar
- 2 Simulation window (optional)
- 3 Distance-to-go display
- 4 Toolbar
- 5 Program blocks
- 6 Spindle speed (machine tool)
- 7 Program management


### 12.2.1 Running the program

#### With NC-controlled axes and software option POSITIP 8000 NC1

 If the program does not contain a **Feed rate** block, the product uses the feed rate value "0."

- ▶ Press the NC START key on the machine tool
- The product selects the first block of the program
- ▶ Press the NC START key on the machine tool again
- User intervention may be required, depending on the block. The wizard shows the appropriate instruction  
With a tool call for example, the spindle is automatically stopped and you are requested to change the corresponding tool
- ▶ With multi-step blocks, such as machining patterns, tap **Next** to proceed to the next step in the wizard
- ▶ Follow the wizard's instructions for the block



 Blocks that do not require any action by the user (such as presetting) are executed automatically.


- ▶ Press the NC START key to execute the next block, and continue in this manner until the end of the program

#### With manual machine tools



- ▶ Tap **NC START** on the program control
- The product selects the first block of the program
- ▶ Tap **NC START** on the program control once again
- User intervention may be required, depending on the block. The wizard shows the appropriate instruction  
With a tool call for example, the spindle is automatically stopped and you are requested to change the corresponding tool
- ▶ With multi-step blocks, such as machining patterns, tap **Next** to proceed to the next step in the wizard
- ▶ Follow the wizard's instructions for the block



 Blocks that do not require any action by the user (such as presetting) are executed automatically.



- ▶ Tap **NC START** to execute the next block, and continue in this manner until the end of the program

#### In Single block mode



- ▶ Tap **Single block** on the program control to activate Single Block mode
- When the Single Block mode is active, the program stops after each block of the program control (this also includes blocks that do not require any action by the user)

### 12.2.2 Proceeding to a specific program block

To go to a specific block, you can skip blocks one by one within a program until you reach the desired block. It is not possible to jump back in the program.



- ▶ Tap **Next program step** on the program control
- > The next block is selected

### 12.2.3 Aborting program run

If errors or problems occur, you can abort the execution of a program. The tool position and the spindle speed remain unchanged when the program run is aborted.



The program run cannot be aborted if the current block is executing a traverse motion.

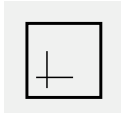
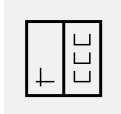



- ▶ Tap **Stop program** in the program management
- > The program run is aborted

### 12.2.4 Using the simulation window

You can display a visualization of the selected block in the optional simulation window.

The following options are available on the view bar:

Operating element	Function
	<b>Graphic</b> Display of simulation and blocks
	<b>Graphic-Position</b> Display of simulation, position values and blocks
	<b>Position</b> Display of position values and blocks

### Depiction as contour view

The simulation window displays a contour view. The contour view aids in the precise positioning of the tool or with contour tracking in the machining plane.

The contour view uses the following colors (defaults):

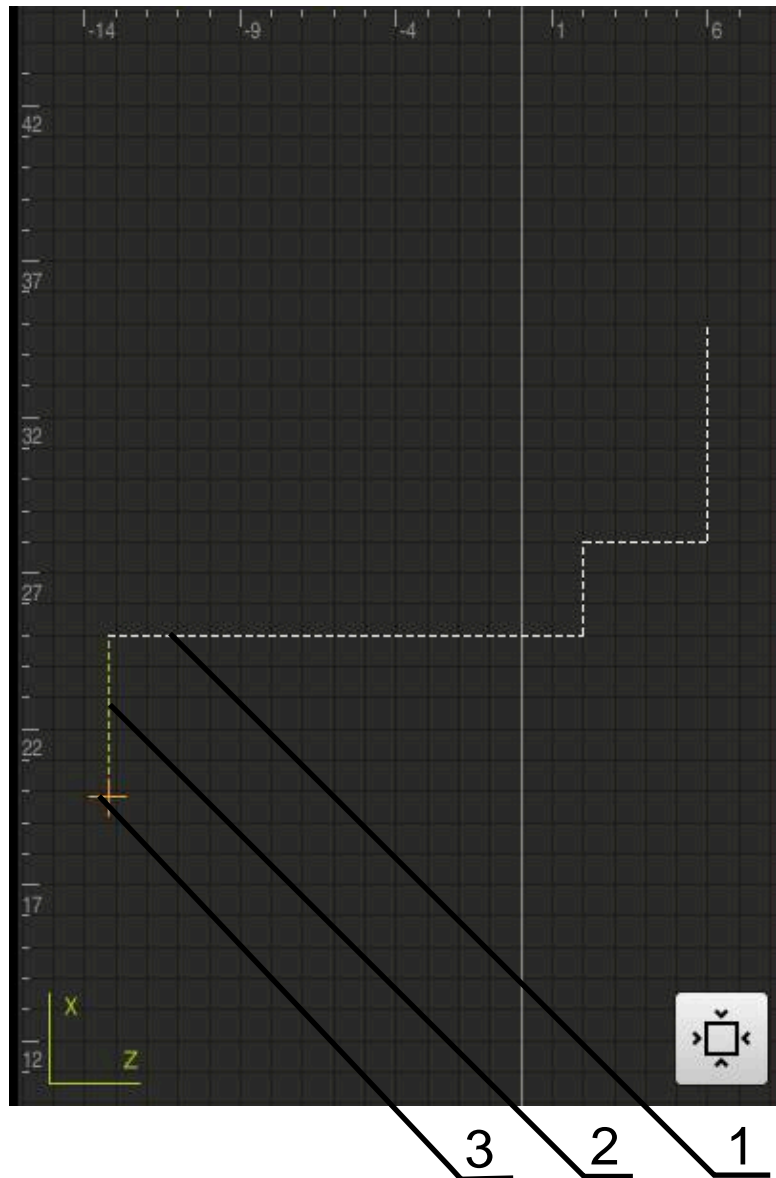


Figure 43: Simulation window with contour view

- 1 Machining pattern (white)
- 2 Current block or machining position (green)
- 3 Tool contour, tool position and tool track (orange)



You can modify the colors and line thicknesses used in the contour view.

**Further information:** "Simulation window", Page 225

### Activating the simulation window



- ▶ Tap **Graphic-Position**
- > The simulation window for the currently selected block appears



- ▶ Tap **Graphic** on the view bar to enlarge the simulation window
- > The parameter view is hidden and the simulation window is enlarged

### Modifying the contour view



- ▶ Tap **Detail view**
- > The detail view shows the tool path and the possible machining positions for the currently selected block



- ▶ Tap **Overview**
- > The overview shows the entire workpiece

#### 12.2.5 Applying the Scaling factor

If a scaling factor is activated for one or more axes, this scaling factor is multiplied by the stored nominal position during execution of a block. This enables you to mirror and scale a block.

You can activate a scaling factor in the quick access menu.

**Further information:** "Adjusting settings in the quick access menu", Page 84




If the calculated dimensions cannot be attained with the selected tool, the execution of the block is aborted.



The scaling factor cannot be changed during execution of a block.

### 12.2.6 Setting the spindle speed

You can control the spindle speed depending on the configuration of the connected machine tool.



- ▶ To switch from the display of the spindle speed to the input field (if required), drag the display to the right.
  - > The **Spindle speed** input field is displayed
  - ▶ Tap or long-press **+** or **-** to set the spindle speed to the desired value
- or
- ▶ Tap the **Spindle speed** input field
  - ▶ Enter the desired value
  - ▶ Confirm entry with **RET**
  - > The product applies the entered spindle speed as the nominal value and controls the spindle of the machine tool accordingly
  - ▶ To return to the display of the spindle speed, drag the input field to the left



If no entry is made in the **spindle speed** input field for three seconds, the device switches back to the display of the current spindle speed.

## 12.3 Managing programs

To run a program, open the program file, which must be of the \*.i type.



The default storage location for programs is **Internal/Programs**.

### 12.3.1 Opening a program



- ▶ Tap **Open program** in the program management
- ▶ Select the storage location in the dialog, e. g. **Internal/Programs** or USB mass storage device
- ▶ Tap the folder containing the file
- ▶ Tap the file
- ▶ Tap **Open**
- > The selected program is loaded

### 12.3.2 Closing a program



- ▶ Tap **Close program** in the program management
- > The opened program is closed





# 13

**Programming**

## 13.1 Overview

This chapter describes the Programming operating mode and how to create new programs and edit existing programs in this mode.

**i** Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.  
**Further information:** "Basic operation", Page 57

### Short description

The product uses programs for recurring tasks. Programs are created through the defining of various blocks, such as positioning functions or machine functions. A sequence of multiple blocks then forms a program. You can save a maximum of 100 blocks within a program.

**i** Programming does not require connecting the product to a machine tool.

**i** To obtain a better overview during programming, you can use the POSITIP 8000 Demo software for programming. You can export the generated programs and load them onto the device.

### Calling up



- ▶ Tap **Programming** in the main menu
- > The user interface for programming is displayed



Figure 44: **Programming** menu

- 1 View bar
- 2 Toolbar
- 3 Program management

**i** The status bar and the optional OEM bar are not available in the **Programming** menu.

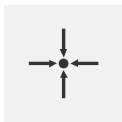
## 13.2 Block types

You can use the following block types for programming:

- Positioning functions
- Change of coordinate system (preset)
- Machine functions
- Machining cycle

### 13.2.1 Positioning

You can manually define position values for positioning. Depending on the configuration of the connected machine tool, you can then move the tool to these positions either automatically or manually.




#### Actual position

Applies the current axis position to the input fields of the various block types

The following parameters are available:

#### Positioning block type


Parameter	Description
	Incremental position value, i.e. the position value is referenced to the actual position

### 13.2.2 Coordinate systems

To change a coordinate system, you can call presets from the preset table. The coordinate system of the selected preset will then be used after the call.

**Further information:** "Setting a position as a preset", Page 176


#### Preset block

Parameter	Description
<b>Preset number</b>	ID from the preset table
	Optional: Selection from preset table

### 13.2.3 Machine functions


You can call machine functions to machine the workpiece.

The available functions depend on the configuration of the connected machine tool. The following blocks and parameters are available:

Block type	Parameter / Description
<b>Spindle speed</b>	Rotational speed of the tool spindle
<b>Feed rate</b>	Speed of the tool axis (only for an NC-controlled axis)
	<div style="border: 1px solid black; padding: 5px;">  If the program does not contain a <b>Feed rate</b> block, the product uses the feed rate value "0."         </div>
<b>Cutting speed</b>	Cutting speed of the turning tool
<b>Tool call</b>	Number of the tool Optional: Selection from tool table <b>Further information:</b> "Selecting a tool", Page 178 When a tool call is run, the spindle is automatically stopped and the user is requested to load the corresponding tool.
<b>M function</b>	Number of the M function Optional: Selection from function table
<b>Dwell time</b>	Time interval between machining steps

### 13.2.4 Machining cycle

If the lathe is configured for thread cutting, two machining cycles are available. Thread cutting (basic) allows you to execute a simple thread cut without downfeed. Thread cutting (extended) allows you to define an extended thread cycle with downfeed.

 Before defining a machining pattern, you must

- Define a suitable tool in the tool table
- Select the tool on the status bar

**Further information:** "Creating a tool table", Page 147

### Thread cutting (basic) block







Figure 45: Schematic depiction of the **Thread cutting (basic)** block

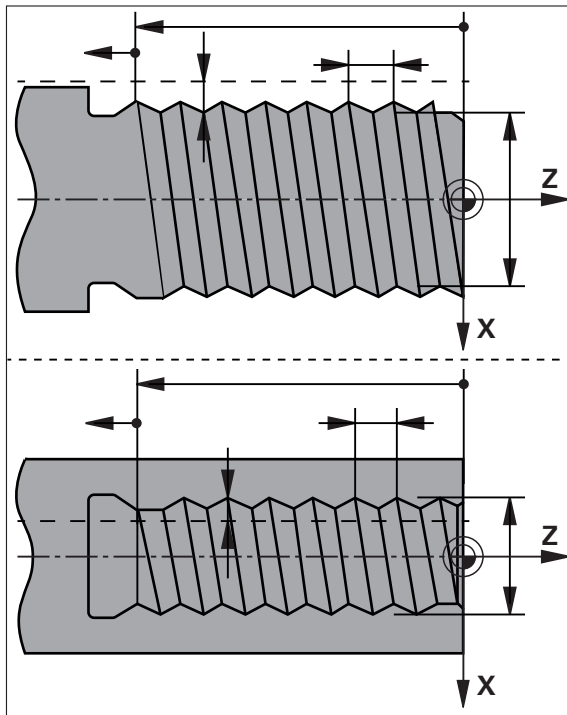Parameter	Description
<b>Thread position</b> 	Position of the thread <ul style="list-style-type: none"> <li>■ External thread</li> <li>■ Internal thread</li> </ul>
<b>Direction of rotation</b> 	Direction of rotation of the rotational axis <ul style="list-style-type: none"> <li>■ Right</li> <li>■ Left</li> </ul>
<b>Safety clearance</b>	Incremental to the thread depth, radial dimension
<b>Thread depth (diameter)</b>	Thread depth, diameter dimension
<b>Thread pitch</b> 	Pitch of the thread <ul style="list-style-type: none"> <li>■ In mm</li> <li>■ In threads per inch</li> </ul>
<b>Contour start in Z</b>	Start of the thread in Z
<b>Contour end in Z</b>	End of the thread in Z
<b>Overrun path</b>	Path at the end of thread for stopping the axes
<b>Starting angle</b>	Entrance angle in the rotational axis
<b>Rotational speed</b>	Rotational speed in rpm
<b>Feed rate in X</b>	Feed rate for downfeed to thread depth

### Thread cutting block (extended)

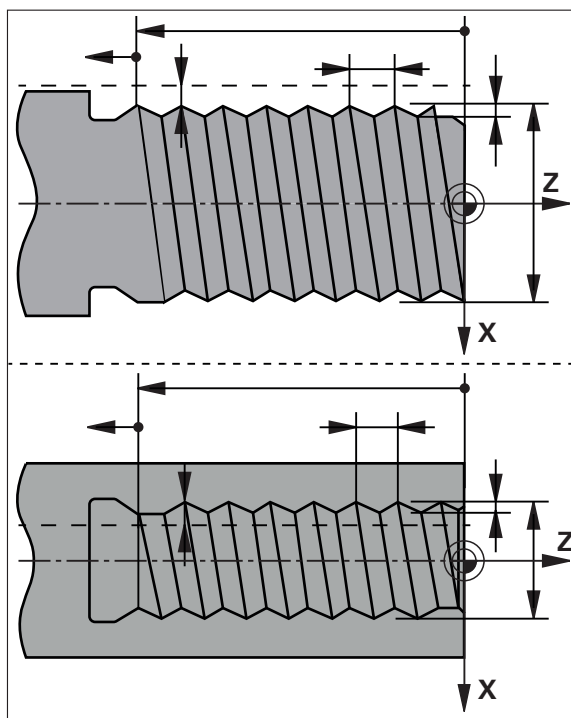





Figure 46: Schematic depiction of the **Thread cutting (extended)** block

Parameter	Description
<b>Thread position</b>	Position of the thread <ul style="list-style-type: none"> <li>■ External thread</li> <li>■ Internal thread</li> </ul>
	
<b>Direction of rotation</b>	Direction of rotation of the rotational axis <ul style="list-style-type: none"> <li>■ Right</li> <li>■ Left</li> </ul>
	
<b>Safety clearance X</b>	Incremental to the thread diameter, radial dimension
<b>Thread diameter</b>	Rated diameter of thread (diameter dimension)
<b>Thread depth</b>	Incremental to the thread diameter, radial dimension
<b>Finishing allowance</b>	Finishing allowance for downfeed, radial dimension
<b>Thread pitch</b>	Pitch of the thread <ul style="list-style-type: none"> <li>■ In mm</li> <li>■ In threads per inch</li> </ul>
	
<b>Contour start in Z</b>	Start of the thread in Z
<b>Contour end in Z</b>	End of the thread in Z
<b>Overrun path</b>	Path at the end of thread for stopping the axes
<b>Starting angle</b>	Entrance angle in the rotational axis
<b>Rotational speed</b>	Rotational speed in rpm

Parameter	Description
Feed rate in X	Feed rate for downfeed to thread depth
Air cuts	Number of air cuts at the end (0 – 10)

### 13.3 Creating a program

A program always consists of a program header and a sequence of blocks. You can define various block types, edit the associated block parameters, and delete individual blocks from the program.

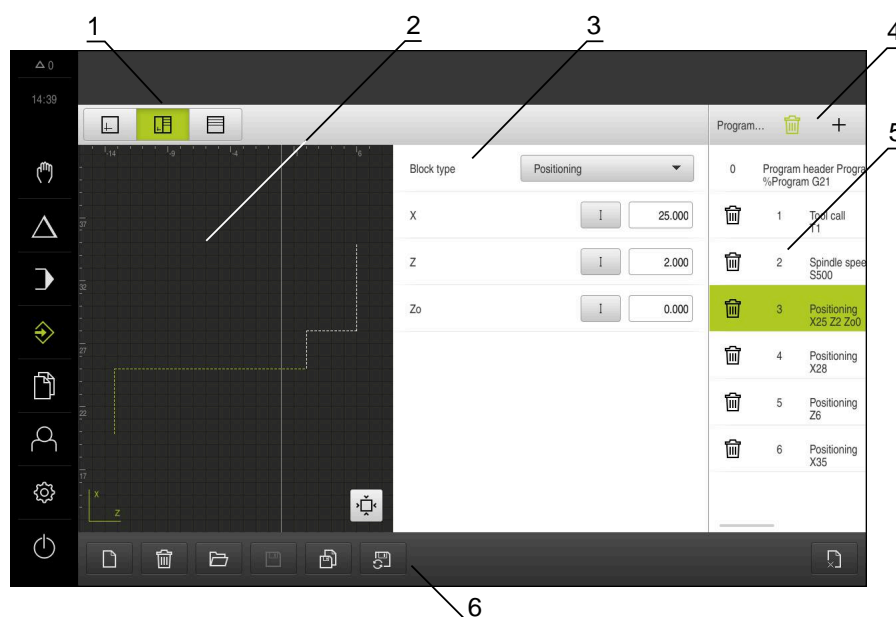


Figure 47: Example of a program in the **Programming** operating mode

- 1 View bar
- 2 Simulation window (optional)
- 3 Block parameters
- 4 Toolbar
- 5 Program blocks
- 6 Program management

#### 13.3.1 Programming support

The product provides the following features to assist you in creating programs:

- When you add a block, the wizard displays information on the parameters that are required for the selected block type.
  - If a block contains errors or undefined parameters, it is displayed in red type in the list.
  - If problems occur, the wizard displays the message **The program contains incomplete program blocks**. You can switch between program blocks by tapping the arrow keys.
  - The optional simulation window shows a visualization of the current block.
- Further information:** "Using the simulation window", Page 187



- All changes to a program can be automatically saved.
- ▶ Tap **Save program automatically** in the program management
  - ▶ All changes will be automatically saved immediately

### 13.3.2 Creating a program header



- ▶ Tap **Create new program** in the program management
- ▶ In the dialog select the storage location, e.g. **Internal/Programs**, in which you want to save the program
- ▶ Enter a name for the program
- ▶ Confirm the entry with **RET**
- ▶ Tap **Create**
- > A new program containing the **Program header** start block is created
- > The name of the program is displayed on the toolbar
- ▶ Enter a unique name in the **Name** field
- ▶ Confirm the entry with **RET**
- ▶ Change the unit of measure with the slide switch, if required

### 13.3.3 Adding blocks



- ▶ Tap **Add block** on the toolbar
- > A new block is inserted below the current position
- ▶ Select the desired block type from the **Block type** drop-down list
- ▶ Define the relevant parameters, depending on the block type
- Further information:** "Block types", Page 203
- ▶ Confirm each entry with **RET**
- > If the simulation window is active, the current block is visualized

### 13.3.4 Deleting blocks



- ▶ Tap **Delete** on the toolbar
- > The blocks contained in the program are marked with a Delete symbol
- ▶ Tap the Delete symbol for the blocks you want to delete in the program
- > The selected blocks are deleted from the program
- ▶ Tap **Delete** on the toolbar again

### 13.3.5 Saving a program



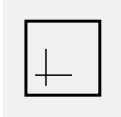
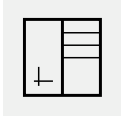

- ▶ Tap **Save program** in the program management
- > The program is saved



## 13.4 Using the simulation window

The simulation window visualizes the selected block. You can also use the simulation window to check a created program step by step.

The following options are available on the view bar:

Control	Function
	<b>Graphic</b> Display of simulation and blocks
	<b>Graphic position</b> Display of simulation, position values, and blocks
	<b>Position</b> Display of position values and blocks

### 13.4.1 Depiction as contour view

The simulation window displays a contour view. The contour view aids in the precise positioning of the tool or with contour tracking in the machining plane.

The contour view uses the following colors (defaults):

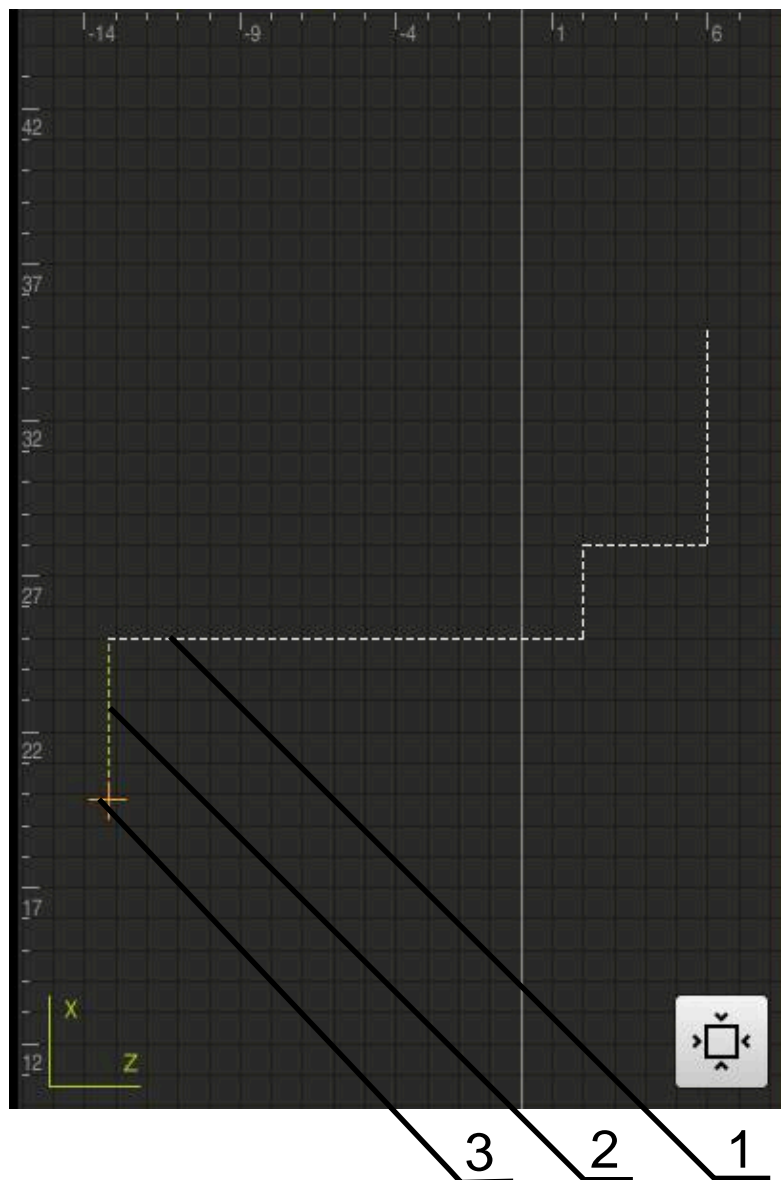


Figure 48: Simulation window with contour view

- 1 Machining pattern (white)
- 2 Current block or machining position (green)
- 3 Tool contour, tool position and tool track (orange)

### 13.4.2 Activating the simulation window



- ▶ Tap **Graphic-Form**
- The simulation window for the highlighted block appears



- ▶ Tap **Graphic** on the view bar to enlarge the simulation window
- The parameter view is hidden and the simulation window is enlarged

### 13.4.3 Checking a program in the simulation window



- ▶ Tap **Graphic**
- > The simulation window for the current program appears
- ▶ Tap each program block, one after the other
- > The program steps are displayed in the simulation window; you can enlarge the detail view as needed



- ▶ To enlarge the view, tap **Detail view**



- ▶ To return to the overview view, tap **Overview**

## 13.5 Managing programs

After you have created a program, you can save it for automatic program run or subsequent editing.



The default storage location for programs is **Internal/Programs**.

### 13.5.1 Opening a program



- ▶ Tap **Open program** in the program management
- ▶ Select the storage location in the dialog, e. g. **Internal/Programs** or USB mass storage device
- ▶ Tap the folder containing the file
- ▶ Tap the file
- ▶ Tap **Open**
- > The selected program is loaded

### 13.5.2 Closing a program



- ▶ Tap **Close program** in the program management
- > The opened program is closed

### 13.5.3 Saving a program



- ▶ Tap **Save program** in the program management
- > The program is saved

### 13.5.4 Saving a program under a new name



- ▶ Tap **Save program as** in the program management
- ▶ In the dialog, select the storage location, e. g. **Internal/Programs** or USB mass storage device, in which you want to save the program
- ▶ Enter a name for the program
- ▶ Confirm the entry with **RET**
- ▶ Tap **Save as**
- > The program is saved
- > The name of the program is displayed on the toolbar

### 13.5.5 Saving a program automatically



- ▶ Tap **Save program automatically** in the program management
- > All changes to the program will be automatically saved immediately

### 13.5.6 Deleting a program



- ▶ Tap **Delete the program** in the program management
- ▶ Tap **Delete selection**
- ▶ Tap **OK** to confirm deletion
- > The program is deleted

## 13.6 Editing program blocks

You can make later changes to any block of a program. To apply the changes to the program, you need to save the program again after you have made the changes.

### Editing program blocks



- ▶ Tap **Open program** in the program management
- ▶ Select the storage location in the dialog, e.g. **Internal/Programs**
- ▶ Tap the folder containing the file
- ▶ Tap the file
- ▶ Tap **Open**
- > The selected program is loaded
- ▶ Tap the desired block
- > The parameters of the selected block are displayed
- ▶ Edit the relevant parameters, depending on the block type
- ▶ Confirm each entry with **RET**



- ▶ Tap **Save program** in the program management
- > The edited program is saved

# 14

**File management**

## 14.1 Overview

This chapter describes the **File management** menu and its functions.



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57

### Short description

The **File management** menu shows an overview of the files stored in the product's memory.

Any connected USB mass storage devices (FAT32 format) or available network drives are shown in the list of storage locations. The USB mass storage devices and the network drives are displayed with their name or drive designation.

### Calling up



- ▶ Tap **File management** in the main menu
- > The file management user interface is displayed

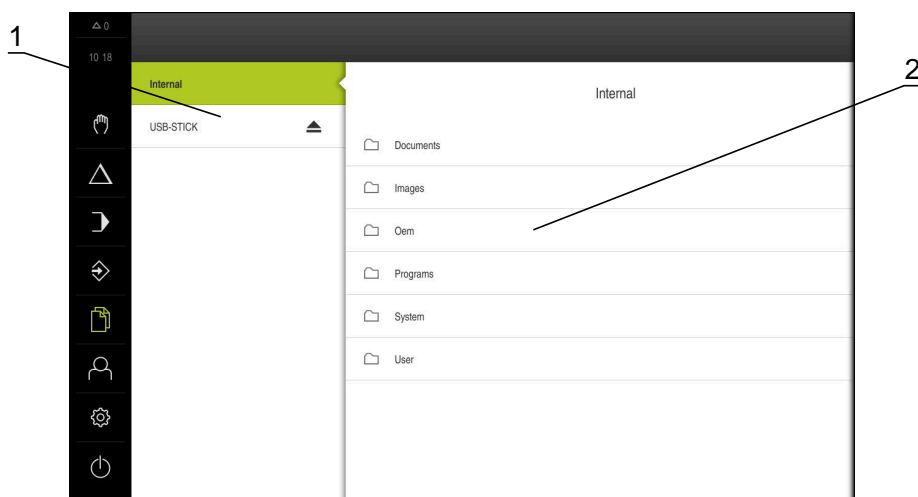


Figure 49: **File management** menu

- 1 List of available storage locations
- 2 List of folders in the selected storage location

## 14.2 File types

In the **File management** menu you can edit the following file types:

Type	Use	Manage	View	Open	Print
*.i	Programs	✓	–	–	–
*.mcc	Configuration files	✓	–	–	–
*.dro	Firmware files	✓	–	–	–
*.svg, *.ppm	Image files	✓	–	–	–
*.jpg, *.png, *.bmp	Image files	✓	✓	–	–
*.csv	Text files	✓	–	–	–
*.txt, *.log, *.xml	Text files	✓	✓	–	–
*.pdf	PDF files	✓	✓	–	✓

## 14.3 Managing folders and files

### Folder structure

In the **File management** menu, the files in the **Internal** storage location are saved in the following folders:

Folders	Application
<b>Documents</b>	Document files
<b>Images</b>	Image files
<b>Oem</b>	Files for configuring the OEM bar (visible only to <b>OEM</b> users)
<b>System</b>	Audio files and system files
<b>User</b>	User data

### Creating a new folder



- ▶ Drag the icon of the folder in which you want to create a new folder to the right
- > The operating elements are displayed
- ▶ Tap **Create a new folder**
- ▶ Tap the input field in the dialog and enter a name for the new folder
- ▶ Confirm entry with **RET**
- ▶ Tap **OK**
- > A new folder is created

### Moving a folder



- ▶ Drag the icon of the folder you want to move to the right
- > The operating elements are displayed
- ▶ Tap **Move to**
- ▶ In the dialog, select the folder to which you want to move the folder
- ▶ Tap **Select**
- > The folder is moved

### Copying a folder



- ▶ Drag the icon of the folder you want to copy to the right
- > The operating elements are displayed
- ▶ Tap **Copy to**
- ▶ In the dialog, select the folder to which you want to copy the folder
- ▶ Tap **Select**
- > The folder is copied



If you copy a folder to the folder it is stored in, the suffix "\_1" is appended to the name of the copied folder.

### Renaming a folder



- ▶ Drag the icon of the folder you want to rename to the right
- > The operating elements are displayed
- ▶ Tap **Rename folder**
- ▶ Tap the input field in the dialog and enter a name for the new folder
- ▶ Confirm the entry with **RET**
- ▶ Tap **OK**
- > The folder is renamed

### Moving a file



- ▶ Drag the icon of the file you want to move to the right
- > The operating elements are displayed
- ▶ Tap **Move to**
- ▶ In the dialog, select the folder to which you want to move the file
- ▶ Tap **Select**
- > The file is moved



If you move a file into a folder containing a file with the same name, that file is overwritten.



### Copying a file



- ▶ Drag the icon of the file you want to copy to the right
- > The operating elements are displayed
- ▶ Tap **Copy to**
- ▶ In the dialog, select the folder to which you want to copy the file
- ▶ Tap **Select**
- > The file is copied



If you copy a file to the folder it is stored in, the suffix "\_1" is appended to the name of the copied file.

### Renaming a file



- ▶ Drag the icon of the file you want to rename to the right
- > The operating elements are displayed
- ▶ Tap **Rename file**
- ▶ Tap the input field in the dialog and enter a name for the new file
- ▶ Confirm the entry with **RET**
- ▶ Tap **OK**
- > The file is renamed

### Deleting a folder or file

The folders and files you delete will be permanently deleted and cannot be recovered. If you delete a folder, all subfolders and files contained in that folder will also be deleted.



- ▶ Drag the icon of the folder or file you want to delete to the right
- > The operating elements are displayed
- ▶ Tap **Delete selection**
- ▶ Tap **Delete**
- > The folder or file is deleted

## 14.4 Viewing files

### Viewing files



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the storage location of the desired file
- ▶ Tap the file
- A preview image (only with PDF and image files) as well as information about the file are displayed

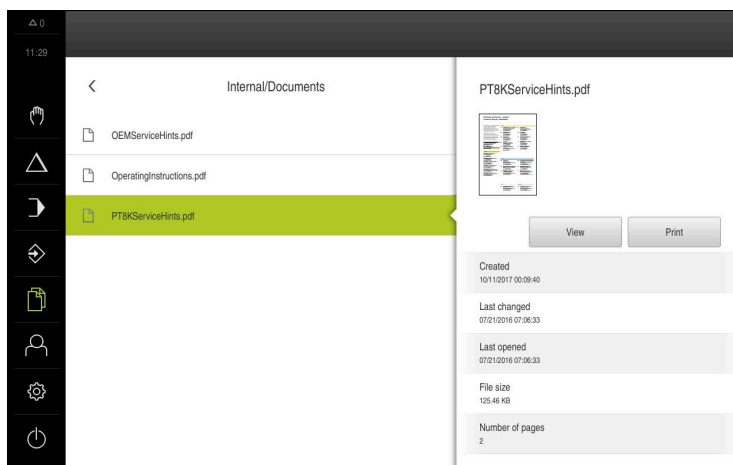


Figure 50: **File management** menu with preview image and file information

- ▶ Tap **View**
- The file contents are displayed
- ▶ Tap **Close** to close the view



## 14.5 Exporting files

You can export files to an external USB mass storage device (FAT32 format) or to the network drive. You can either copy or move the files:

- If you copy files, duplicates of the files will remain stored in the product
- If you move files, the files will be deleted in the product



- ▶ Tap **File management** in the main menu
- ▶ In the **Internal** storage location, navigate to the file you want to export
- ▶ Drag the icon of the file to the right
- The operating elements are displayed
- ▶ To copy the file, tap **Copy file**



- ▶ To move the file, tap **Move file**
- ▶ In the dialog, select the storage location to which you want to export the file
- ▶ Tap **Select**
- The file is exported to the USB mass storage device or the network drive

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device

## 14.6 Importing files

You can import files from a USB mass storage device (FAT32 format) or a network drive into the product. You can either copy or move the files:

- If you copy files, duplicates of the files will remain on the USB mass storage device or the network drive
- If you move files, the files will be deleted from the USB mass storage device or the network drive



- ▶ Tap **File management** in the main menu
- ▶ On the USB mass storage device or network drive, navigate to the file you want to import
- ▶ Drag the icon of the file to the right
- > The operating elements are displayed



- ▶ To copy the file, tap **Copy file**



- ▶ To move the file, tap **Move file**
- ▶ In the dialog, select the storage location to which you want to save the file
- ▶ Tap **Select**
- > The file is stored on the product

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



# 15

**Settings**

## 15.1 Overview

This chapter describes the setting options and the associated settings parameters for the product.

The basic setting options and settings parameters for commissioning and product setup are outlined in the respective chapters:

**Further information:** "Commissioning", Page 91

**Further information:** "Setup", Page 135

### Short description



Depending on the type of user that is logged in to the product, settings and settings parameters can be edited and changed (edit permission).  
If a user logged in to the product has no edit permission for a setting or a settings parameter, the setting or settings parameter is grayed out and cannot be opened or edited.



Depending on the software options that have been activated on the product, various settings and settings parameters are available in the Settings menu.  
If, for example, the POSITIP 8000 NC1 software option is not activated on the unit, then the settings parameters that are necessary for this software option are not displayed on the unit.

Function	Description
<b>General</b>	General settings and information
<b>Interfaces</b>	Configuration of interfaces and network drives
<b>User</b>	Configuration of users
<b>Axes</b>	Configuration of connected encoders and error compensation
<b>Service</b>	Configuration of software options, service functions and information

### Calling up



- ▶ Tap **Settings** in the main menu

## 15.2 General

This chapter describes settings for configuring the operation and display .

### 15.2.1 Device information

Path: **Settings ► General ► Device information**

The overview displays basic information about the software.

Parameter	Displays the information
<b>Product designation</b>	Product designation of the product
<b>Part number</b>	ID number of the unit
<b>Serial number</b>	Serial number of the product
<b>Firmware version</b>	Version number of the firmware
<b>Firmware built on</b>	Firmware creation date
<b>Last firmware update on</b>	Date of most recent firmware update
<b>Free memory space</b>	Free memory space in the internal storage location <b>Internal</b>
<b>Free working memory (RAM)</b>	Free RAM on the system
<b>Number of unit starts</b>	Number of times the product was started up with the current firmware
<b>Operating time</b>	Operating time of the product with the current firmware


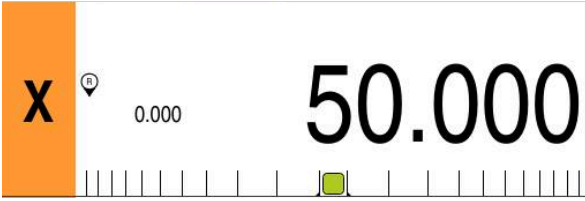
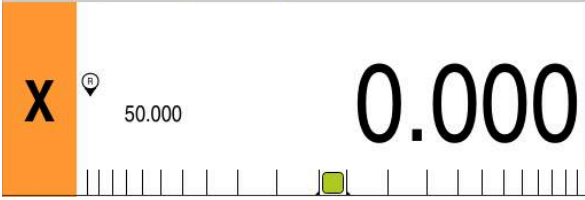

### 15.2.2 Screen

Path: **Settings ► General ► Screen**

Parameter	Explanation
<b>Brightness</b>	Brightness of the screen <ul style="list-style-type: none"> <li>■ Setting range: <b>1 % ... 100 %</b></li> <li>■ Default setting: <b>85 %</b></li> </ul>
<b>Energy-save-mode timeout</b>	Time until energy-save mode is activated <ul style="list-style-type: none"> <li>■ Setting range: <b>0 min ... 120 min</b> If the value is set to 0, the power-saving mode is deactivated</li> <li>■ Default setting: <b>30 minutes</b></li> </ul>
<b>Quit the energy saving mode</b>	Required actions to reactivate the screen <ul style="list-style-type: none"> <li>■ <b>Tap and drag:</b> Touch the touchscreen and drag the arrow upwards from the lower edge</li> <li>■ <b>Tap:</b> Touch the touchscreen</li> <li>■ <b>Tap or axis movement:</b> Touch the touchscreen or move the axis</li> <li>■ Default setting: <b>Tap and drag</b></li> </ul>

### 15.2.3 Display

Path: Settings ► General ► Display

Parameter	Explanation
<b>Position display</b>	<p>Configuration of the position display in the MDI mode and Program Run operating mode. The configuration also determines the actions requested by the wizard in the MDI mode and Program Run operating mode:</p> <ul style="list-style-type: none"> <li>■ <b>Position with distance to go:</b> The wizard prompts you to move the axis to the displayed position.</li> <li>■ <b>Distance to go with position:</b> The wizard prompts you to move the axis to 0, and a positioning aid is shown.</li> </ul> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Position:</b> The position is displayed in large digits</li> </ul>  <ul style="list-style-type: none"> <li>■ <b>Position with distance to go:</b> The position is displayed in large digits, and the distance to go in small digits</li> </ul>  <ul style="list-style-type: none"> <li>■ <b>Distance to go with position:</b> The distance to go is displayed in large digits, and the position in small digits</li> </ul>  <ul style="list-style-type: none"> <li>■ Default setting: <b>Distance to go with position</b></li> </ul>
<b>Position values</b>	<p>The position values can describe the actual values or nominal values of the axes.</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Actual value</b></li> <li>■ <b>Nominal value</b></li> <li>■ Default setting: <b>Actual value</b></li> </ul>
<b>Distance-to-go indicator</b>	<p>Display of the distance-to-go indicator in MDI mode</p>  <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>ON</b></li> </ul>



Parameter	Explanation
<b>Digits before the decimal point for size-adjusted axis display</b>	The number of digits in front of the decimal point indicates the size at which the position values are displayed. If the number of digits in front of the decimal point is exceeded, then the display is reduced in size so that all of the digits can be shown. <ul style="list-style-type: none"> <li>■ Setting range: <b>0 ... 6</b></li> <li>■ Default value: <b>3</b></li> </ul>
<b>Simulation window</b>	Configuration of the simulation window for MDI mode and program run. <p><b>Further information:</b> "Simulation window", Page 225</p>
<b>Radial machining axes</b>	Display of the radial machining axis <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Radius</b></li> <li>■ <b>Diameter</b></li> <li>■ Default value: <b>Radius</b></li> </ul>

#### 15.2.4 Simulation window

Path: **Settings ► General ► Display ► Simulation window**

Parameter	Explanation
<b>Line thickness of tool position</b>	Line thickness for displaying the tool position <ul style="list-style-type: none"> <li>■ Settings: <b>Standard</b> or <b>Bold</b></li> <li>■ Default value: <b>Standard</b></li> </ul>
<b>Color of tool position</b>	Definition of the color for displaying the tool position <ul style="list-style-type: none"> <li>■ Setting range: <b>Color scale</b></li> <li>■ Default setting: <b>Orange</b></li> </ul>
<b>Line thickness of current contour element</b>	Line thickness for displaying the current contour element <ul style="list-style-type: none"> <li>■ Settings: <b>Standard</b> or <b>Bold</b></li> <li>■ Default value: <b>Standard</b></li> </ul>
<b>Color of current contour element</b>	Definition of the color for displaying the current contour element <ul style="list-style-type: none"> <li>■ Setting range: <b>Color scale</b></li> <li>■ Default setting: <b>Green</b></li> </ul>
<b>Tool path</b>	Use of the tool path <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>ON</b></li> </ul>
<b>Tool always visible</b>	The tool is always visible in the simulation window. The contour and the current position of the tool are shown. The area is scaled during the procedure <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>

Parameter	Explanation
<b>Horizontal alignment</b>	Horizontal orientation of the coordinate system in the simulation window Settings: <ul style="list-style-type: none"> <li>■ <b>Rightward</b>: values increase to the right</li> <li>■ <b>Leftward</b>: values increase to the left</li> <li>■ Default value: <b>Rightward</b></li> </ul>
<b>Vertical alignment</b>	Vertical orientation of the coordinate system in the simulation window Settings: <ul style="list-style-type: none"> <li>■ <b>Upward</b>: values increase in the upward direction</li> <li>■ <b>Downward</b>: values increase in the downward direction</li> <li>■ Default value: <b>Upward</b></li> </ul>



The **Undo** buttons enable the color definitions of the simulation window to be reset to factory settings.

### 15.2.5 Input devices

Path: **Settings ► General ► Input devices**

Parameter	Explanation
<b>Touchscreen sensitivity</b>	The sensitivity of the touchscreen can be adjusted in three levels <ul style="list-style-type: none"> <li>■ <b>Low (contamination)</b>: allows operating the touchscreen if it is dirty</li> <li>■ <b>Normal (standard)</b>: allows operating the touchscreen under normal conditions</li> <li>■ <b>High (gloves)</b>: allows operating the touchscreen while wearing gloves</li> <li>■ Default setting: <b>Normal (standard)</b></li> </ul>
<b>Mouse substitute for multitouch gestures</b>	Specifies whether mouse operation should replace operation using the touchscreen (multitouch) Settings: <ul style="list-style-type: none"> <li>■ <b>Auto (until first multitouch)</b>: Touching the touchscreen causes mouse deactivation</li> <li>■ <b>On (no multitouch)</b>: Operation only possible with the mouse, the touchscreen is deactivated</li> <li>■ <b>Off (only multitouch)</b>: Operation only possible with the touchscreen, the mouse is deactivated</li> <li>■ Default setting: <b>Auto (until first multitouch)</b></li> </ul>
<b>USB keyboard layout</b>	If a USB keyboard is connected: <ul style="list-style-type: none"> <li>■ Language selection of the keyboard assignment</li> </ul>

## 15.2.6 Sounds

Path: **Settings ► General ► Sounds**

The available sounds are grouped into categories. The sounds differ within a category.

Parameter	Explanation
<b>Speaker</b>	Use of the built-in speaker on the rear panel of the product <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default setting: <b>ON</b></li> </ul>
<b>Speaker volume</b>	Volume of the product's speaker <ul style="list-style-type: none"> <li>■ Setting range: <b>0 % ... 100 %</b></li> <li>■ Default setting: <b>50 %</b></li> </ul>
<b>Message and Error</b>	Sound to be played when a message is displayed When you select a setting, the associated sound is played <ul style="list-style-type: none"> <li>■ Settings: <b>Standard, Guitar, Robot, Outer space, No sound</b></li> <li>■ Default setting: <b>Standard</b></li> </ul>
<b>Touch tone</b>	Sound to be played when using a touch element When you select a setting, the associated sound is played <ul style="list-style-type: none"> <li>■ Settings: <b>Standard, Guitar, Robot, Outer space, No sound</b></li> <li>■ Default setting: <b>Standard</b></li> </ul>

## 15.2.7 Printers

Path: **Settings ► General ► Printers**



The current firmware of the units in this series does not support this function.

## 15.2.8 Date and time

Path: **Settings ► General ► Date and time**

Parameter	Explanation
<b>Date and time</b>	Current date and time of the product <ul style="list-style-type: none"> <li>■ Settings: <b>Year, Month, Day, Hour, Minute</b></li> <li>■ Default setting: <b>Current system time</b></li> </ul>
<b>Date format</b>	Format in which the date is displayed Settings: <ul style="list-style-type: none"> <li>■ <b>MM-DD-YYYY</b>: month, day, year</li> <li>■ <b>DD-MM-YYYY</b>: day, month, year</li> <li>■ <b>YYYY-MM-DD</b>: year, month, day</li> <li>■ Default setting: <b>YYYY-MM-DD</b> (e.g. "2016-01-31")</li> </ul>

## 15.2.9 Units

Path: **Settings ► General ► Units**

Parameter	Explanation
<b>Unit for linear values</b>	Unit of measure for linear values <ul style="list-style-type: none"> <li>■ Settings: <b>Millimeters</b> or <b>Inch</b></li> <li>■ Default setting: <b>Millimeters</b></li> </ul>
<b>Rounding method for linear values</b>	Rounding method for linear values Settings: <ul style="list-style-type: none"> <li>■ <b>Commercial</b>: Decimal digits from 1 to 4 are rounded down, decimal digits from 5 to 9 are rounded up</li> <li>■ <b>Round off</b>: Decimal digits from 1 to 9 are rounded down</li> <li>■ <b>Round up</b>: Decimal digits from 1 to 9 are rounded up</li> <li>■ <b>Truncate</b>: Decimal digits are truncated without rounding up or down</li> <li>■ <b>Round to 0 and 5</b>: Decimal digits <math>\leq 24</math> or <math>\geq 75</math> are rounded to 0, decimal digits <math>\geq 25</math> or <math>\leq 74</math> are rounded to 5</li> <li>■ Default setting: <b>Commercial</b></li> </ul>
<b>Decimal places for linear values</b>	Number of decimal places for linear values Setting range: <ul style="list-style-type: none"> <li>■ <b>Millimeters: 0 ... 5</b></li> <li>■ <b>Inch: 0 ... 7</b></li> </ul> Default value: <ul style="list-style-type: none"> <li>■ <b>Millimeters: 4</b></li> <li>■ <b>Inch: 6</b></li> </ul>
<b>Unit for angular values</b>	Unit for angular values Settings: <ul style="list-style-type: none"> <li>■ <b>Radian</b>: angles in radian (rad)</li> <li>■ <b>Decimal degrees</b>: angles in degrees (<math>^{\circ}</math>) with decimal places</li> <li>■ <b>Deg-Min-Sec</b>: angles in degrees (<math>^{\circ}</math>), minutes ['] and seconds ["]</li> <li>■ Default setting: <b>Decimal degrees</b></li> </ul>
<b>Rounding method for angular values</b>	Rounding method for decimal angular values Settings: <ul style="list-style-type: none"> <li>■ <b>Commercial</b>: Decimal digits from 1 to 4 are rounded down, decimal digits from 5 to 9 are rounded up</li> <li>■ <b>Round off</b>: Decimal digits from 1 to 9 are rounded down</li> <li>■ <b>Round up</b>: Decimal digits from 1 to 9 are rounded up</li> <li>■ <b>Truncate</b>: Decimal digits are truncated without rounding up or down</li> <li>■ <b>Round to 0 and 5</b>: Decimal digits <math>\leq 24</math> or <math>\geq 75</math> are rounded to 0, decimal digits <math>\geq 25</math> or <math>\leq 74</math> are rounded to 5</li> <li>■ Default setting: <b>Commercial</b></li> </ul>

Parameter	Explanation
<b>Decimal places for angular values</b>	Number of decimal places for angular values Setting range: <ul style="list-style-type: none"> <li>■ <b>Radian: 0 ... 7</b></li> <li>■ <b>Decimal degrees: 0 ... 5</b></li> <li>■ <b>Deg-Min-Sec: 0 ... 2</b></li> </ul> Default value: <ul style="list-style-type: none"> <li>■ <b>Radian: 5</b></li> <li>■ <b>Decimal degrees: 3</b></li> <li>■ <b>Deg-Min-Sec: 0</b></li> </ul>
<b>Decimal separator</b>	Separator for the display of values <ul style="list-style-type: none"> <li>■ Settings: <b>Point</b> or <b>Comma</b></li> <li>■ Default setting: <b>Point</b></li> </ul>

### 15.2.10 Copyrights

Path: **Settings ► General ► Copyrights**

Parameter	Meaning and function
<b>Open source software</b>	Display of the licenses of the software used

### 15.2.11 Service info

Path: **Settings ► General ► Service info**

Parameter	Meaning and function
<b>HEIDENHAIN - Customer service</b>	Display of a document containing HEIDENHAIN service addresses
<b>OEM service info</b>	Display of a document containing service information from the machine manufacturer <ul style="list-style-type: none"> <li>■ Default: document containing HEIDENHAIN service addresses</li> </ul> <b>Further information:</b> "Adding documentation", Page 119

### 15.2.12 Documentation

Path: **Settings ► General ► Documentation**

Parameter	Meaning and function
<b>Operating Instructions</b>	Display of the operating instructions stored on the product <ul style="list-style-type: none"> <li>■ Default: no document; the document in the desired language can be added</li> </ul> <b>Further information:</b> "Documentation", Page 279

## 15.3 Interfaces

This chapter describes settings for configuring networks, network drives, and USB mass storage devices.

### 15.3.1 Network

Path: **Settings ► Interfaces ► Network ► X116**



Contact your network administrator for the correct network settings for configuring the product.

Parameter	Explanation
<b>MAC address</b>	Unique hardware address of the network adapter
<b>DHCP</b>	Dynamically assigned network address of the product <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>ON</b></li> </ul>
<b>IPv4 address</b>	Network address consisting of four octets The network address is automatically assigned if DHCP is active, or it can be entered manually <ul style="list-style-type: none"> <li>Setting range: <b>0.0.0.1 ... 255.255.255.255</b></li> </ul>
<b>IPv4 subnet mask</b>	Identifier within the network, consisting of four octets The subnet mask is automatically assigned if DHCP is active, or it can be entered manually. <ul style="list-style-type: none"> <li>Setting range: <b>0.0.0.0 ... 255.255.255.255</b></li> </ul>
<b>IPv4 standard gateway</b>	Network address of the router connecting a network <div data-bbox="699 1352 754 1411" data-label="Image"> </div> <ul style="list-style-type: none"> <li>The network address is automatically assigned if DHCP is active, or it can be entered manually.</li> <li>Setting range: <b>0.0.0.1 ... 255.255.255.255</b></li> </ul>
<b>IPv6 SLAAC</b>	Network address with extended namespace Only required if supported in the network <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul>
<b>IPv6 address</b>	Automatically assigned if <b>IPv6 SLAAC</b> is active
<b>IPv6 subnet prefix length</b>	Subnet prefix in IPv6 networks
<b>IPv6 standard gateway</b>	Network address of the router connecting a network
<b>Preferred DNS server</b>	Primary server for mapping the IP address
<b>Alternative DNS server</b>	Optional server for mapping the IP address

### 15.3.2 Network drive

Path: **Settings ► Interfaces ► Network drive**



Contact your network administrator for the correct network settings for configuring the product.

Parameter	Explanation
<b>Name</b>	Folder name displayed in the file management Default value: <b>Share</b> (cannot be changed)
<b>Server IP address or host name</b>	Name or network address of the server
<b>Shared folder</b>	Name of the shared folder
<b>User name</b>	Name of the authorized user
<b>Password</b>	Password of the authorized user
<b>Show password</b>	Display of the password in plain text <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Network drive options</b>	Configuration of the <b>Authentication</b> for encrypting the password in the network Settings: <ul style="list-style-type: none"> <li>■ <b>None</b></li> <li>■ <b>Kerberos V5 authentication</b></li> <li>■ <b>Kerberos V5 authentication and packet signing</b></li> <li>■ <b>NTLM password hashing</b></li> <li>■ <b>NTLM password hashing with signing</b></li> <li>■ <b>NTLMv2 password hashing</b></li> <li>■ <b>NTLMv2 password hashing with signing</b></li> <li>■ Default value: <b>None</b></li> </ul> Configuration of the <b>Mount options</b> Settings: <ul style="list-style-type: none"> <li>■ Default value: <b>nounix,noserverino</b></li> </ul>

### 15.3.3 USB

Path: **Settings ► Interfaces ► USB**

Parameter	Explanation
<b>Automatically detect attached USB mass storage devices</b>	Automatic recognition of a USB mass storage device <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default setting: <b>ON</b></li> </ul>

### 15.3.4 Axes (switching functions)

Path: **Settings ► Interfaces ► Switching functions ► Axes**

In the Manual operation and MDI modes of operation, all axes or individual axes can be reset to zero by setting the assigned digital input.



Not all of the described parameters and options may be available, depending on the product version, configuration and the connected encoders.

Parameter	Explanation
<b>General settings</b>	Assignment of the digital input in accordance with the pin layout in order to zero all axes Default setting: <b>Not connected</b>
<b>&lt;Axis name&gt;</b>	Assignment of the digital input in accordance with pin layout in order to set all axes to zero Default setting: <b>Not connected</b>

### 15.3.5 Position-dependent switching functions

Path: **Settings ► Interfaces ► Position-dependent switching functions ► +**

The position-dependent switching functions enable you to set logical outputs depending on the position of an axis in a defined reference system. Switching positions and position intervals are available for this.



Not all of the described parameters and options may be available, depending on the product version, configuration and the connected encoders.

Parameter	Explanation
<b>Name</b>	Name of the switching function
<b>Switching function</b>	Selecting whether the switching function should be activated or deactivated <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default setting: <b>ON</b></li> </ul>



Parameter	Explanation
Reference system	Selecting the desired reference system <ul style="list-style-type: none"> <li>■ Machine coordinate system</li> <li>■ Preset</li> <li>■ Target position</li> <li>■ Tool tip</li> </ul>
Axis	Selecting the desired axis
Switching point	Selecting the axis position of the trigger point Default setting: <b>0.0000</b>
Type of switching	Selecting the desired type of switching <ul style="list-style-type: none"> <li>■ Edge from LOW to HIGH</li> <li>■ Edge from HIGH to LOW</li> <li>■ Interval from LOW to HIGH</li> <li>■ Interval from HIGH to LOW</li> <li>■ Default setting: Edge from LOW to HIGH</li> </ul>
Output	Selecting the desired output <ul style="list-style-type: none"> <li>■ X105.13 ... X105.16 (Dout 0, Dout 2, Dout 4, Dout 6)</li> <li>■ X105.32 ... X105.35 (Dout 1, Dout 3, Dout 5, Dout 7)</li> <li>■ X113.04 (Dout 0)</li> </ul>
Output is inverted	If the function is enabled, the output is set if the switching condition is not fulfilled or if the switching function is inactive <ul style="list-style-type: none"> <li>■ Default value: Not active</li> </ul>
Pulse	Selecting whether the pulse should be activated or deactivated <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default setting: <b>ON</b></li> </ul>
Pulse time	Selecting the desired pulse length <ul style="list-style-type: none"> <li>■ <b>0.1 s ... 999 s</b></li> <li>■ Default setting: <b>0.0 s</b></li> </ul>
Lower limit	Selecting the lower limit of the axis position at which switching is to occur (only with <b>Interval</b> type of switching)
Upper limit	Selecting the upper limit of the axis position at which switching is to occur (only <b>Interval</b> type of switching)
Remove the entry	Removing the position-dependent switching function

## 15.4 User

This chapter describes settings for configuring users and user groups.

### 15.4.1 OEM

Path: **Settings ► User ► OEM**

The **OEM** (Original Equipment Manufacturer) user has the highest level of permissions. This user is allowed to configure the product's hardware (e.g. connection of encoders and sensors). He can create **Setup** and **Operator**-type users, and configure the **Setup** and **Operator** users. The **OEM** user cannot be duplicated or deleted. This user cannot be logged in automatically.

Parameters	Explanation	Edit permission
<b>Name</b>	Name of the user ■ Default value: <b>OEM</b>	–
<b>First name</b>	First name of the user ■ Default value: –	–
<b>Department</b>	Department of the user ■ Default value: –	–
<b>Group</b>	Group of the user ■ Default value: <b>oem</b>	–
<b>Password</b>	Password of the user ■ Default value: <b>oem</b>	<b>OEM</b>
<b>Language</b>	Language of the user	<b>OEM</b>
<b>Auto login</b>	On restart of the product: Automatic login of the last logged-in user ■ Default value: <b>OFF</b>	–
<b>Remove user account</b>	Removal of the user account	–

### 15.4.2 Setup

Path: **Settings ► User ► Setup**

The **Setup** user configures the product for use at the place of operation. This user can create **Operator**-type users. The **Setup** user cannot be duplicated or deleted. This user cannot be logged in automatically.

Parameters	Explanation	Edit permission
<b>Name</b>	Name of the user ■ Default value: <b>Setup</b>	–
<b>First name</b>	First name of the user ■ Default value: –	–
<b>Department</b>	Department of the user ■ Default value: –	–
<b>Group</b>	Group of the user ■ Default value: <b>setup</b>	–

Parameters	Explanation	Edit permission
<b>Password</b>	Password of the user <ul style="list-style-type: none"> <li>Default value: <b>setup</b></li> </ul>	<b>Setup, OEM</b>
<b>Language</b>	Language of the user	<b>Setup, OEM</b>
<b>Auto login</b>	On restart of the product: Automatic login of the last logged-in user <ul style="list-style-type: none"> <li>Default value: <b>OFF</b></li> </ul>	–
<b>Remove user account</b>	Removal of the user account	–

### 15.4.3 Operator

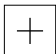
Path: **Settings ► User ► Operator**

The **Operator** user is permitted to use the basic functions of the product. An **Operator**-type user cannot create additional users, but is allowed to edit various operator-specific settings, such as his name or the language. A user of the **Operator** group can be logged in automatically as soon as the product is switched on.

Parameters	Explanation	Edit permission
<b>Name</b>	Name of the user <ul style="list-style-type: none"> <li>Default value: <b>Operator</b></li> </ul>	<b>Operator, Setup, OEM</b>
<b>First name</b>	First name of the user	<b>Operator, Setup, OEM</b>
<b>Department</b>	Department of the user <ul style="list-style-type: none"> <li>Default value: –</li> </ul>	<b>Operator, Setup, OEM</b>
<b>Group</b>	Group of the user <ul style="list-style-type: none"> <li>Default value: <b>operator</b></li> </ul>	–
<b>Password</b>	Password of the user <ul style="list-style-type: none"> <li>Default value: <b>operator</b></li> </ul>	<b>Operator, Setup, OEM</b>
<b>Language</b>	Language of the user	<b>Operator, Setup, OEM</b>
<b>Auto login</b>	On restart of the product: Automatic login of the last logged-in user <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul>	<b>Operator, Setup, OEM</b>
<b>Remove user account</b>	Removal of the user account	<b>Setup, OEM</b>

### 15.4.4 Adding User

Path: **Settings ► User ► +**

Parameter	Explanation
	Adds a new user of the type <b>Operator</b> <b>Further information:</b> "Entering and configuring users", Page 140 It is not possible to add further <b>OEM</b> and <b>Setup</b> -type users.

## 15.5 Axes

This chapter describes settings for configuring the axes and assigned devices.



Not all of the described parameters and options may be available, depending on the product version, configuration and the connected encoders.

### 15.5.1 Fundamentals of axis configuration



In order to use functions such as the execution of blocks, the configuration of the axes must comply with the requirements of the respective application.

#### Reference system on lathes

When machining a workpiece on a lathe, the coordinates entered for the principal axes X, Y and Z are referenced to the workpiece zero point. During turning the reference axis is the rotational axis of the spindle. This axis is the Z axis. The X axis moves in the direction of the radius or diameter. The Y axis is perpendicular to the X axis and Z axis and is used for machining operations outside the center of the workpiece. The position of the tool tip is clearly defined by its X and Z coordinates. The angles entered for the rotary axis (C axis) are referenced to the zero point of the C axis.

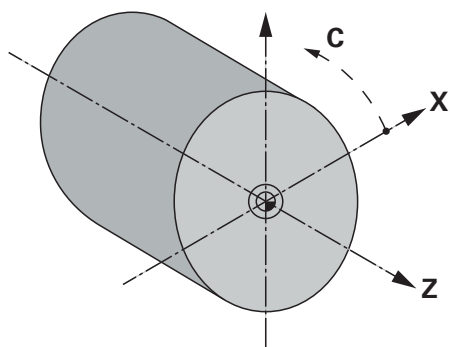


Figure 51: Assignment of the rectangular coordinate system to the workpiece

## 15.5.2 Reference marks

Path: **Settings ► Axes ► General settings ► Reference marks**

Parameters	Explanation
<b>Reference mark search after unit start</b>	Setting for the reference mark search after unit start Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The reference mark search must be performed after startup</li> <li>■ <b>OFF</b>: No prompt for a mandatory reference mark search is displayed after startup of the product</li> <li>■ Default value: <b>ON</b></li> </ul>
<b>All users can cancel reference mark search</b>	Specifies whether the reference mark search can be canceled by all user types Settings <ul style="list-style-type: none"> <li>■ <b>ON</b>: The reference mark search can be canceled by users of any type</li> <li>■ <b>OFF</b>: The reference mark search can only be canceled by users of the <b>OEM</b> or <b>Setup</b> type</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Reference mark search</b>	<b>Start</b> starts the reference mark search and opens the workspace
<b>Reference mark search status</b>	Indicates whether the reference mark search was successful Display: <ul style="list-style-type: none"> <li>■ <b>Successful</b></li> <li>■ <b>Unsuccessful</b></li> </ul>
<b>Stop of reference mark search</b>	Indicates whether the reference mark search was canceled Display: <ul style="list-style-type: none"> <li>■ <b>Yes</b></li> <li>■ <b>No</b></li> </ul>

### 15.5.3 Information

Path: **Settings ► Axes ► General settings ► Information**

Parameters	Explanation
Assignment of the encoder inputs to the axes	Shows the assignment of the encoder inputs to the axes
Assignment of the analog outputs to the axes	Shows the assignment of the analog outputs to the axes
Assignment of the analog inputs to the axes	Shows the assignment of the analog inputs to the axes
Assignment of the digital outputs to the axes	Shows the assignment of the digital outputs to the axes
Assignment of the digital inputs to the axes	Shows the assignment of the digital inputs to the axes



With the **Reset** buttons, the assignments for the inputs and outputs can be reset.

### 15.5.4 Switching functions

Path: **Settings ► Axes ► General settings ► Switching functions**



The switching functions must not be used as a part of a safety function.

Parameters	Explanation
Inputs	Assignment of the digital input for the respective switching function according to the pin layout <b>Further information:</b> "Inputs (Switching functions)", Page 238
Outputs	Assignment of the digital output for the respective switching function according to the pin layout <b>Further information:</b> "Outputs (Switching functions)", Page 240



### 15.5.5 Inputs (Switching functions)



The switching functions must not be used as a part of a safety function.

Path: **Settings ► Axes ► General settings ► Switching functions ► Inputs**

Parameter	Explanation
Control voltage on	Assignment of the digital input for querying the external control voltage (e.g. for the machine to be controlled) <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>

Parameter	Explanation
<b>Emergency stop active</b>	<p>Assignment of the digital input for querying whether an externally connected emergency stop switch was activated</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Rapid traverse</b>	<p>Assignment of the digital input for a push button that activates rapid traverse. The rapid traverse is active as long as the push button is pressed and held.</p> <p>If rapid traverse is activated, feed rate limitation is ignored by the feed rate override and the axes traverse at maximum feed rate.</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Automatic feed</b>	<p>Assignment of the digital input for a push button with the following effect:</p> <ul style="list-style-type: none"> <li>■ Manual operation: Pressing the button activates the automatic feed rate during axis movements that are controlled via the jog buttons. The axis continues to move until it reaches its next limit switch or until the push button is pressed again. The automatic feed rate only functions for axes for which limit switches have been configured</li> <li>■ MDI mode and Program Run: the push button functions as an NC-START key. Pressing the push button starts and interrupts the cycles of a program block</li> <li>■ Default value: <b>Not connected</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> If no digital input is assigned to the <b>Automatic feed</b> parameter, the <b>NC-START</b> key will be displayed during the execution of an MDI block or a program.</p> </div>
<b>Stop of the automatic feed</b>	<p>Assignment of the digital input for a push button with the following effect:</p> <ul style="list-style-type: none"> <li>■ Manual operation: Pressing the button stops the automatic feed rate during axis movements that are controlled via the jog buttons</li> <li>■ MDI mode and Program Run: The push button functions as an NC STOP key. Pressing the push button stops and interrupts the cycles of a program block</li> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Smooth feed selection for analog movement commands</b>	<p>Assignment of the digital input to select a smoother feed if the entire input voltage range is used</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Enable spindle-independent manual movement commands</b>	<p>Assignment of the digital input to execute manual NC movements that are independent of the spindle. The spindle is standing still and the axes are moved in feed mode mm/min</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> Spindle-independent manual movements are only possible if there is a high level at the input.</p> </div>

## 15.5.6 Outputs (Switching functions)



The switching functions must not be used as a part of a safety function.

Path: **Settings ▶ Axes ▶ General settings ▶ Switching functions ▶ Outputs**

Parameter	Explanation
<b>Coolant</b>	Assignment of the digital output for activating or deactivating the coolant supply of the machine tool <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Operational readiness</b>	Assignment of the relay output set if an error (e.g. positioning error or standstill error) occurs on an axis. The error results in interruption of the axis control and power disconnection of the configured analog outputs of the axis. <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>User-defined switching function</b>	Assignment of the relay output that activates for some seconds after shutdown of the product. The relay is connected to a circuit with self-retaining function that disconnects the product and machine tool from power if this signal is applied. Example: The circuit can couple the switch-on/off of the product to the switch-on/off of the machine tool to be controlled. <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Autostart light</b>	Assignment of the digital output for visual status display of the NC START key. The lighting is active if a cycle is executed in MDI mode or Program Run or if automatic feed rate is activated in Manual mode. The lighting flashes if an active cycle is interrupted and can be continued by pressing the NC START key. <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>



### 15.5.7 Overrides

Path: **Settings ► Axes ► General settings ► Overrides**

Parameters	Explanation
<b>Input for feed override</b>	Assignment of the analog input (e.g. of the feed-rate potentiometer) for the feed rate override according to pin layout Default value: <b>Not connected</b>
<b>Umax</b>	Definition of the maximum output voltage. The maximum voltage corresponds to 100 % of the feed-rate potentiometer <ul style="list-style-type: none"> <li>Setting range: <b>0 mV ... 5000 mV</b></li> <li>Default value: <b>5000</b></li> </ul>
<b>Lower dead band</b>	Definition of the lower dead band. The lower dead band starts at 0 % and defines the area within which no movement takes places yet. <ul style="list-style-type: none"> <li>Setting range: <b>0 % ... 100 %</b></li> <li>Default value: <b>0.000</b></li> </ul>

### 15.5.8 Adding M functions

Path: **Settings ► Axes ► General settings ► M functions ► +**

Parameters	Explanation
<b>Name</b>	Entry of the name for the new M function <ul style="list-style-type: none"> <li>Setting range: <b>M100 ... M120</b></li> </ul> For the configuration, see "Configuring M functions", Page 241

### 15.5.9 Configuring M functions

Path: **Settings ► Axes ► General settings ► M functions ► M100 ... M120**

Parameters	Explanation
<b>Name</b>	Entry of the name for the M function <ul style="list-style-type: none"> <li>Setting range: <b>M100 ... M120</b></li> </ul>
<b>Digital output</b>	Assignment of the digital output for the M function according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Restore switching state after device restart</b>	Identification of M function as nonvolatile Settings: <ul style="list-style-type: none"> <li><b>ON</b>: M function is saved in nonvolatile memory</li> <li><b>OFF</b>: M function is not saved in nonvolatile memory</li> <li>Default value: <b>ON</b></li> </ul>
<b>Digital input for switching enable</b>	Assignment of the input for enabling the M function <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Remove</b>	Removal of the selected M function


### 15.5.10 Diameter axis

Path: Settings ► Axes ► General settings ► Diameter axis

Parameter	Explanation
<b>Preset setting via axis label</b>	<p>Defines whether the direct setting of a preset via the axis label is activated</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p><b>i</b> Preset setting via the axis label can lead to unintentional shifting of the preset away from the center of the workpiece.</p> </div> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: Preset setting via axis label is active</li> <li>■ <b>OFF</b>: Preset setting via axis label is inactive</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Consider presets with CSS</b>	<p>Defines whether the presets are considered in CSS mode</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p><b>i</b> A consideration of the presets in CSS mode can lead to CSS no longer acting on the physical center of the workpiece.</p> </div> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: Consideration of the presets in CSS mode is active</li> <li>■ <b>OFF</b>: Consideration of the presets in CSS mode is inactive</li> <li>■ Default value: <b>OFF</b></li> </ul>

## 15.5.11 Special settings

Path: Settings ► Axes ► General settings ► Special settings

Parameters	Explanation
<b>Electronic axis clamping on axis halt</b>	<p>Setting for electronic axis clamping when the axis is at a standstill</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: The axis is clamped on standstill of the axis</li> <li>■ <b>OFF</b>: The axis is not clamped on standstill of the axis</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Only single axis movement via jog buttons</b>	<p>Definition of the axis movements that are possible with the traverse keys</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: Only a single axis can be moved</li> <li>■ <b>OFF</b>: Several axes can be moved simultaneously</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Maximum machine speed for linear movements</b>	<p>Definition of the maximum speed at which NC-controlled linear axes can be moved</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 mm/min ... 10000 mm/min</b></li> <li>■ Default value: <b>2000</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> The <b>Maximum machine speed</b> cannot be exceeded, even if you have defined a higher feed rate for individual axes.</p> </div>
<b>Maximum machine speed for radial movements</b>	<p>Definition of the maximum speed at which NC-controlled rotational axes can be moved.</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>72000 °/min ... 3600000 °/min</b></li> <li>■ Default value: <b>720000</b></li> </ul>
<b>Rapid traverse speed for linear movements</b>	<p>Definition of the speed at which NC-controlled linear axes can be moved at rapid traverse</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 mm/min ... 10000 mm/min</b></li> <li>■ Default value: <b>2000</b></li> </ul>
<b>Rapid traverse speed for radial movements</b>	<p>Definition of the speed at which NC-controlled rotary axes can be moved at rapid traverse.</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>72000 °/min ... 3600000 °/min</b></li> <li>■ Default value: <b>720000</b></li> </ul>
<b>Velocity feedforward control for position feedback control</b>	<p>Setting the <b>Velocity feedforward control</b> for position feedback control of interpolated NC movements. Reducing the following error directly affects the speed control loop</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>None</b></li> <li>■ <b>t - 2 ms</b></li> <li>■ <b>t - 4 ms</b></li> <li>■ <b>t - 6 ms</b></li> <li>■ Default value: <b>None</b></li> </ul>

### Function of the velocity feedforward control

The velocity feedforward control influences the command action of the position-controlled drive. It directly affects the speed control loop as a control factor and can reduce the following error without compromising the stability of the control loop.

If you configure the **Velocity feedforward control for position feedback control** parameter, the feedforward control calculates the following error that, based on the current velocity, would result in the position controller and uses the calculated value to determine the nominal velocity value to be added to the position controller output.

## 15.5.12 Thread cutting

Path: **Settings ► Axes ► General settings ► Thread cutting**

Parameter	Explanation
<b>Rotation axis</b>	Selecting the rotational axis for thread cutting Depending on the machine setup and the axis configuration, the following rotational axes are available: <ul style="list-style-type: none"> <li>■ <b>None</b></li> <li>■ <b>S</b> axis (spindle)</li> <li>■ <b>C</b> axis</li> </ul>
<b>Speed for pre-positioning the rotational axis</b>	Setting the speed for pre-positioning the rotational axis <b>S</b> : <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 2000 rpm</b></li> <li>■ Default value: <b>0</b></li> </ul>
<b>Feed rate for pre-positioning the rotational axis</b>	Setting the feed rate for pre-positioning the rotational axis <b>C</b> : <ul style="list-style-type: none"> <li>■ Setting range: <b>0 °/min ... 2000 °/min</b></li> <li>■ Default value: <b>0</b></li> </ul>





## 15.5.13 <Axis name> (settings of the axis)

Path: **Settings ► Axes ► <Axis name>**



In order to use functions such as the execution of blocks, the configuration of the axes must comply with the requirements of the respective application.

**Further information:** "Fundamentals of axis configuration", Page 236

Parameters	Explanation
<b>Axis name</b>	<p>Selection of the axis name displayed in the position preview Default setting: <b>Not defined</b></p> <div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> <p> You can configure the following axes: <b>X, Z, Zo, C, S</b>.</p> </div> <div style="border: 1px solid black; padding: 5px;"> <p> The axis name <b>S</b> is displayed in the selection list once you have selected <b>Spindle</b>, <b>Gear spindle</b> or <b>Spindle with orientation</b> under Axis type.</p> </div>
<b>Axis type</b>	<p>Definition of the axis type Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Not defined</b></li> <li>■ <b>Axis</b></li> <li>■ <b>Axis + NC</b> (possible for up to three axes): NC-controlled linear axis or rotary axis</li> <li>■ <b>Coupled axis</b>: Axis whose position value is offset against a principal axis</li> </ul> <div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> <p> Coupled axes do not appear in the position display. The position axis shows only the principal axis with the calculated position value of both axes.</p> </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> <p> For coupled axes, the product adapts the axis name automatically. The axis name consists of the name of the principal axis and the selected calculation type, e.g. <b>+X</b>.</p> </div> <ul style="list-style-type: none"> <li>■ <b>Spindle</b></li> <li>■ <b>Spindle with orientation</b></li> <li>■ <b>Gear spindle</b></li> <li>■ <b>Electronic handwheel</b></li> <li>■ Default value: <b>Axis</b></li> </ul>
<b>Encoder</b>	<p>Configuration of the connected encoder <b>Further information:</b> "Encoder", Page 247</p>
<b>Error compensation</b>	<p>Configuration of the linear error compensation <b>LEC</b> or segmented linear error compensation <b>SLEC</b> <b>Further information:</b> "Linear error compensation (LEC)", Page 254 <b>Further information:</b> "Segmented linear error compensation (SLEC)", Page 254</p>
<b>Outputs</b>	<p>Configuration of the <b>Outputs</b> for the NC function <b>Further information:</b> "Outputs", Page 255</p>
<b>Inputs</b>	<p>Configuration of the <b>Inputs</b> for the NC function <b>Further information:</b> "Inputs", Page 257</p>
<b>Software limit switches</b>	<p>Configuration of the <b>Software limit switches</b> <b>Further information:</b> "Software limit switches", Page 260</p>

Parameters	Explanation
<b>Start-up time</b>	<p>Configuration of the acceleration behavior and the braking behavior of the axis; time during which the drive accelerates from standstill to maximum feed rate <b>Fmax</b> or decelerates from maximum feed rate to standstill.</p> <ul style="list-style-type: none"> <li>Setting range: <b>50 ms ... 10000 ms</b></li> <li>Default value: <b>500</b></li> </ul>
<b>Kv factor P</b>	<p>Proportional component of the position controller during positioning</p> <ul style="list-style-type: none"> <li>Setting range: <b>0.3 m/(min x mm) ... 6 m/(min x mm)</b></li> <li>Default value: <b>2.5</b></li> </ul>
<b>Kv factor L</b>	<p>Proportional component of the position controller at a standstill</p> <ul style="list-style-type: none"> <li>Setting range: <b>0.3 m/(min x mm) ... 6 m/(min x mm)</b></li> <li>Default value: <b>2.5</b></li> </ul>
<b>Maximum positioning error</b>	<p>Definition of the maximum following error during positioning</p> <ul style="list-style-type: none"> <li>Setting range: <b>5 µm ... 1000 µm</b></li> <li>Default value: <b>500</b></li> </ul>
<b>Maximum standstill error</b>	<p>Definition of the maximum position deviation at a standstill</p> <ul style="list-style-type: none"> <li>Setting range: <b>5 µm ... 1000 µm</b></li> <li>Default value: <b>100</b></li> </ul>
<b>Positioning window</b>	<p>Input of the scaling factor for the positioning aid in MDI mode (only for manually operated linear axes)</p> <ul style="list-style-type: none"> <li>Setting range: <b>0.020 mm ... 2.000 mm</b></li> <li>Default value: <b>0.100</b></li> </ul>
<b>Minimum dwell time in manual positioning window</b>	<p>The entered required amount of time for the axes to be in the positioning window until the block is completed (only for manually operated linear axes)</p> <ul style="list-style-type: none"> <li>Setting range: <b>0 ms to 10000 ms</b></li> <li>Default value: <b>0 ms</b></li> </ul>
<b>Minimum dwell time in positioning window</b>	<p>The entered required amount of time for the axes to be in the positioning window until the block is completed</p> <ul style="list-style-type: none"> <li>Setting range: <b>0 ms to 10000 ms</b></li> <li>Default value: <b>0 ms</b></li> </ul>
<b>Coupled main axis</b>	<p>For axes of the <b>Coupled axis</b> type: Selecting the principal axis to be coupled with the axis Default value: None</p>
<b>Calculation with main axis</b>	<p>For axes of the <b>Coupled axis</b> type: Calculation type for the position values of the principal (main) axis and coupled axis Settings:</p> <ul style="list-style-type: none"> <li><b>+</b>: The position values are added (principal axis + coupled axis)</li> <li><b>-</b>: The position values are subtracted (principal axis – coupled axis)</li> <li>Default value: <b>+</b></li> </ul>

## 15.5.14 Encoder

Path: **Settings ► Axes ► <Axis name> ► Encoder**

### Settings for encoders with interfaces of the EnDat 2.2 type

Parameter	Explanation
<b>Encoder input</b>	Assignment of the encoder input to the axis of the product Settings: <ul style="list-style-type: none"> <li>■ <b>Not connected</b></li> <li>■ <b>X1</b></li> <li>■ <b>X2</b></li> <li>■ <b>X3</b></li> <li>■ <b>X4</b></li> <li>■ <b>X5</b></li> <li>■ <b>X6</b></li> </ul> <b>Further information:</b> "Device overview", Page 47
<b>Interface</b>	Automatically detected <b>EnDat</b> interface type
<b>ID label</b>	Information about the encoder that was read out from the electronic ID label
<b>Diagnosis</b>	Results of encoder diagnostics, evaluation of encoder function (e.g., based on functional reserves)
<b>Encoder model</b>	Connected encoder model Settings: <ul style="list-style-type: none"> <li>■ <b>Linear encoder:</b> Linear axis</li> <li>■ <b>Angle encoder:</b> Rotary axis</li> <li>■ <b>Angle encoder as linear encoder:</b> Rotary axis is displayed as linear axis</li> <li>■ Default value: Depending on the connected encoder</li> </ul>
<b>Mechanical ratio</b>	For display of a rotary axis as a linear axis: traverse path in mm per revolution <ul style="list-style-type: none"> <li>■ Setting range: <b>0.1 mm ... 1000 mm</b></li> <li>■ Default value: <b>1.0</b></li> </ul>
<b>Reference point displacement</b>	Configuration of the offset between the reference mark and the zero point <b>Further information:</b> "Reference point displacement", Page 251

#### Using an Angle encoder as linear encoder


Certain parameters must be taken into account when configuring angle encoder or rotary encoder as a linear encoder, in order to prevent an overrun of the system.

- The mechanical ratio must be chosen such that the maximum traverse range of 21474.483 mm is not exceeded
- The reference mark shift should only be used when considering the maximum traverse range of  $\pm 21474.483$  mm, since this limit applies both with and without a reference mark shift
- **Only for multiturn rotary encoders with EnDat 2.2:** the rotary encoder must be mounted such that an overrun of the rotary encoder does not affect the machine coordinates negatively

### Settings for encoders with interfaces of the type 1 V<sub>PP</sub> or 11 μA<sub>PP</sub>

Parameter	Explanation
Encoder input	<p>Assignment of the encoder input to the axis of the product</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Not connected</b></li> <li>■ <b>X1</b></li> <li>■ <b>X2</b></li> <li>■ <b>X3</b></li> <li>■ <b>X4</b></li> <li>■ <b>X5</b></li> <li>■ <b>X6</b></li> </ul> <p><b>Further information:</b> "Device overview", Page 47</p>
Incremental signal	<p>Signal of the connected encoder</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>1 V<sub>pp</sub></b>: Sinusoidal voltage signal</li> <li>■ <b>11 μA<sub>pp</sub></b>: Sinusoidal current signal</li> <li>■ Default value: <b>1 V<sub>pp</sub></b></li> </ul>
Encoder model	<p>Connected encoder model</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>Linear encoder</b>: Linear axis</li> <li>■ <b>Angle encoder</b>: Rotary axis</li> <li>■ <b>Angle encoder as linear encoder</b>: Rotary axis is displayed as linear axis</li> <li>■ Default value: Depending on the connected encoder</li> </ul>
Signal period	<p>For linear encoders</p> <p>Length of a signal period</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0.001 μm ... 1000000.000 μm</b></li> <li>■ Default value: <b>20.000</b></li> </ul>
Line count	<p>For angle encoders and for display of a rotary axis as a linear axis.</p> <p>Number of lines</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>1 ... 1000000</b></li> <li>■ Default value: <b>1000</b></li> </ul>
Teach sequence	<p>Starts the teach sequence for determining the <b>Line count</b> for an angle encoder based on a specified angle of rotation.</p>
Display mode	<p>For angle encoders and for the display of a rotary axis as a linear axis.</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>- ∞ ... ∞</b></li> <li>■ <b>0° ... 360°</b></li> <li>■ <b>-180° ... 180°</b></li> <li>■ Default value: <b>- ∞ ... ∞</b></li> </ul>
Mechanical ratio	<p>For display of a rotary axis as a linear axis:</p> <p>traverse path in mm per revolution</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0.1 mm ... 1000 mm</b></li> <li>■ Default value: <b>1.0</b></li> </ul>



Parameter	Explanation
Reference marks	Configuration of the <b>Reference marks</b> <b>Further information:</b> "Reference marks (Encoder)", Page 250
Analog filter frequency	Frequency value of the analog low-pass filter Settings: <ul style="list-style-type: none"> <li>■ <b>33 kHz:</b> Suppression of interference frequencies above 33 kHz</li> <li>■ <b>400 kHz:</b> Suppression of interference frequencies above 400 kHz</li> <li>■ Default value: <b>400 kHz</b></li> </ul>
Terminating resistor	Dummy load to avoid reflections <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>ON</b></li> </ul>
Error monitor	Monitoring of signal errors Settings: <ul style="list-style-type: none"> <li>■ <b>Off:</b> Error monitoring not active</li> <li>■ <b>Amplitude:</b> Error monitoring of the signal amplitude</li> <li>■ <b>Frequency:</b> Error monitoring of the signal frequency</li> <li>■ <b>Frequency &amp; amplitude:</b> Error monitoring of the signal amplitude and signal frequency</li> <li>■ Default value: <b>Frequency &amp; amplitude</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> A warning or error message is displayed if one of the limit values for error monitoring is exceeded.</p> </div> <p>The limit values depend on the signal of the connected encoder:</p> <ul style="list-style-type: none"> <li>■ Signal <b>1 Vpp</b>, setting <b>Amplitude</b> <ul style="list-style-type: none"> <li>■ Warning with voltage <math>\leq 0.45</math> V</li> <li>■ Error message with voltage <math>\leq 0.18</math> V or <math>\geq 1.34</math> V</li> </ul> </li> <li>■ Signal <b>1 Vpp</b>, setting <b>Frequency</b> <ul style="list-style-type: none"> <li>■ Error message with frequency <math>\geq 400</math> kHz</li> </ul> </li> <li>■ Signal <b>11 <math>\mu</math>App</b>, setting <b>Amplitude</b> <ul style="list-style-type: none"> <li>■ Warning with current <math>\leq 5.76</math> <math>\mu</math>A</li> <li>■ Error message with current <math>\leq 2.32</math> <math>\mu</math>A or <math>\geq 17.27</math> <math>\mu</math>A</li> </ul> </li> <li>■ Signal <b>11 <math>\mu</math>App</b>, setting <b>Frequency</b> <ul style="list-style-type: none"> <li>■ Error message with frequency <math>\geq 150</math> kHz</li> </ul> </li> </ul>
Counting direction	Signal detection during axis movement Settings: <ul style="list-style-type: none"> <li>■ <b>Positive:</b> The direction of traverse corresponds to the counting direction of the encoder</li> <li>■ <b>Negative:</b> The direction of traverse does not correspond to the counting direction of the encoder</li> <li>■ Default value: <b>Positive</b></li> </ul>
Diagnosis	Results of encoder diagnostics, evaluation of encoder function (e.g., based on Lissajous figure)

### 15.5.15 Reference marks (Encoder)

Path: **Settings ▶ Axes ▶ <Axis name> ▶ Encoder ▶ Reference marks**



The reference mark search does not need to be performed for serial encoders with EnDat interface, because the axes are automatically homed.

Parameters	Explanation
<b>Reference mark</b>	<p>Definition of the type of reference mark</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>None</b>: There is no reference mark</li> <li>■ <b>One</b>: The encoder has one reference mark</li> <li>■ <b>Coded</b>: The encoder has distance-coded reference marks</li> <li>■ Default value: <b>One</b></li> </ul>
<b>Maximum traverse path</b>	<p>For linear encoders with coded reference marks: maximum traverse path for determining the absolute position</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0.1 mm ... 10000.0 mm</b></li> <li>■ Default value: <b>20.0</b></li> </ul>
<b>Nominal increment</b>	<p>For angle encoders with coded reference marks: maximum nominal increment for determining the absolute position</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>&gt; 0° ... 360°</b></li> <li>■ Default value: <b>10.0</b></li> </ul>
<b>Interpolation</b>	<p>For encoders with TTL interface:</p> <p>Interpolation value of the encoders and integrated interpolation for the evaluation of the coded reference marks.</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>None</b></li> <li>■ <b>2-fold</b></li> <li>■ <b>5-fold</b></li> <li>■ <b>10-fold</b></li> <li>■ <b>20-fold</b></li> <li>■ <b>50-fold</b></li> <li>■ Default value: <b>None</b></li> </ul>
<b>Inversion of reference mark pulses</b>	<p>Specifies whether the reference mark pulses are evaluated in inverted form</p> <p>Settings</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: Reference pulses are evaluated in inverted form</li> <li>■ <b>OFF</b>: Reference pulses are not evaluated in inverted form</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Reference point displacement</b>	<p>Configuration of the offset between the reference mark and the zero point</p> <p><b>Further information:</b> "Reference point displacement", Page 251</p>

### 15.5.16 Reference point displacement

Path: **Settings ▶ Axes ▶ <Axis name> ▶ Encoder ▶ Reference marks ▶ Reference point displacement**

Parameters	Explanation
<b>Reference point displacement</b>	Activation of offset calculation between reference mark and datum of the machine <ul style="list-style-type: none"> <li>■ Setting range: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Reference point displacement</b>	Manual input of the offset (in mm or degrees according to the selected encoder type) between reference mark and datum Default value: <b>0.00000</b>
<b>Current position for reference point shift</b>	<b>Apply</b> applies the current position as an offset (in mm or degrees, depending on the selected encoder model) between the reference mark and the zero point

### 15.5.17 Diagnostics for encoders with EnDat interface

Path: **Settings ▶ Axes ▶ <Axis name> ▶ Encoder ▶ Diagnosis**

Message	Description
Encoder error	Encoder errors indicate a malfunction of the encoder Examples of encoder errors that may be displayed: <ul style="list-style-type: none"> <li>■ Failure of the light unit</li> <li>■ Incorrect signal amplitude</li> <li>■ Incorrect position</li> <li>■ Overvoltage</li> <li>■ Undervoltage supply</li> <li>■ Overcurrent</li> <li>■ Battery failure</li> </ul>
Encoder warning	Encoder warnings indicate that certain tolerance limits of the encoder have been reached or exceeded Examples of encoder warnings that may be displayed: <ul style="list-style-type: none"> <li>■ Frequency collision</li> <li>■ Temperature exceedance</li> <li>■ Light-source control reserve</li> <li>■ Battery charge</li> <li>■ Reference point</li> </ul>

The messages can have the following status:

Status	Evaluation
<b>OK!</b>	The encoder is within the specification
<b>Not supported</b>	Message not supported by the encoder
<b>Error!</b>	Servicing/maintenance recommended; detailed analyses recommended (e.g., with PWT 101)

Path: **Settings ► Axes ► <Axis name> ► Encoder ► Diagnosis ► Functional reserves**



Parameter	Explanation
<b>Absolute track</b>	Displays the functional reserves of the absolute track
<b>Incremental track</b>	Displays the functional reserves of the incremental track
<b>Position value calculation</b>	Displays the functional reserves of position value calculation
<b>Position</b>	Displays the actual current position of the encoder

The product displays the functional reserves in a bar graph:

Color	Range	Evaluation
Yellow	0 % to 25 %	Servicing/maintenance recommended; testing recommended (e.g., with PWT 101)
Green	25 % to 100 %	The encoder is within the specification

### 15.5.18 Diagnostics for encoders with 1 V<sub>PP</sub>/11 μA<sub>PP</sub>

Path: Settings ► Axes ► <Axis name> ► Encoder ► Diagnosis

Parameter	Explanation
<b>Amplitude A</b>	Display of amplitude A in volts (V)
<b>Amplitude B</b>	Display of amplitude B in volts (V)
<b>Asymmetry</b>	Asymmetry value
<b>Rapid traverse speed for radial movements</b>	Phase deviation from 90°
<b>Freeze graph</b>	Freezing of Lissajous figure Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The graph is frozen and is not updated when the encoder is moved</li> <li>■ <b>OFF</b>: The graph is not frozen and is updated when the encoder is moved</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Show tolerance range</b>	Display of tolerance circles in a range from 0.6 V to 1.2 V Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: Two red circles are shown</li> <li>■ <b>OFF</b>: Tolerance circles are hidden</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Encoder input for comparative measurement</b>	Display of another encoder at another encoder input for comparative measurement; the Freeze graph parameter allows you to superimpose the circles Settings: <ul style="list-style-type: none"> <li>■ Selection of desired encoder input</li> <li>■ Default value: Not connected</li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> The parameter is available only if another encoder with 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface is connected.</p> </div>
<b>Freeze comparative graph</b>	The Lissajous figure of the encoder at the encoder input is frozen for comparative measurement Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The graph is frozen and is not updated when the encoder is moved</li> <li>■ <b>OFF</b>: The graph is not frozen and is updated when the encoder is moved</li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> The parameter is available only if another encoder with 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface is connected.</p> </div>

### 15.5.19 Linear error compensation (LEC)

Path: **Settings ► Axes ► <Axis name> ► Error compensation ► Linear error compensation (LEC)**

Parameter	Explanation
<b>Compensation</b>	<p>Mechanical influences on the axes of the machine are compensated</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON: Compensation</b> is active</li> <li>■ <b>OFF: Compensation</b> is not active</li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> If <b>Compensation</b> is active, the <b>Nominal length</b> and <b>Actual length</b> cannot be edited or generated.</p> </div>
<b>Nominal length</b>	<p>Input field for the length of the calibration standard according to the manufacturer's specifications</p> <p>Input: Millimeters or degrees (depending on the encoder)</p>
<b>Actual length</b>	<p>Input field for entering the measured length (actual distance traversed)</p> <p>Input: millimeters or degrees (depending on the encoder)</p>

### 15.5.20 Segmented linear error compensation (SLEC)

Path: **Settings ► Axes ► <Axis name> ► Error compensation ► Segmented linear error compensation (SLEC)**

Parameters	Explanation
<b>Compensation</b>	<p>Mechanical influences on the axes of the machine are compensated</p> <p>Settings:</p> <ul style="list-style-type: none"> <li>■ <b>ON: Compensation</b> is active</li> <li>■ <b>OFF: Compensation</b> is not active</li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> When <b>Compensation</b> is active, then the <b>Table of supporting points</b> cannot be edited or created.</p> </div>
<b>Table of supporting points</b>	<p>Opens the table of supporting points for manual editing</p>
<b>Create table of supporting points</b>	<p>Opens the menu for creating a new <b>Table of supporting points</b></p> <p><b>Further information:</b> "Create table of supporting points", Page 255</p>

### 15.5.21 Create table of supporting points

Path: **Settings ► Axes ► <Axis name> ► Error compensation ► Segmented linear error compensation (SLEC) ► Create table of supporting points**

Parameters	Explanation
<b>Number of supporting points</b>	Number of supporting points on the mechanical axis of the machine <ul style="list-style-type: none"> <li>■ Setting range: <b>2 ... 200</b></li> <li>■ Default value: <b>2</b></li> </ul>
<b>Spacing of the supporting points</b>	Spacing of the supporting points on the mechanical axis of the machine <ul style="list-style-type: none"> <li>■ Default value: <b>100.00000</b></li> </ul>
<b>Start point</b>	The start point defines the position starting from which the compensation is applied to the axis <ul style="list-style-type: none"> <li>■ Default value: <b>0.00000</b></li> </ul>
<b>Create</b>	Creates a new table of supporting points based on the entries

### 15.5.22 Outputs

Path: **Settings ► Axes ► X, Y ... ► Outputs**

Parameters	Explanation
<b>Type of motor</b>	For axes that are operated with a servo motor: Selection of the motor type Settings: <ul style="list-style-type: none"> <li>■ <b>Bipolar servo motor: -10 V ... 10 V</b></li> <li>■ <b>Unipolar servo motor: 0 V ... 10 V</b></li> <li>■ <b>Stepper motor</b></li> </ul>
<b>Analog output</b>	Assignment of the analog output of the servo motor according to pin layout <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Output for stepper motor</b>	Assignment of the stepper motor output according to the pin layout <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Minimum step frequency</b>	Definition of the minimum step frequency of the connected stepper motor <ul style="list-style-type: none"> <li>■ Setting range: <b>0 kHz ... 1000 kHz</b></li> <li>■ Default value: <b>0.000</b></li> </ul>
<b>Maximum step frequency</b>	Definition of the maximum step frequency of the connected stepper motor <ul style="list-style-type: none"> <li>■ Setting range: <b>0 kHz ... 1000 kHz</b></li> <li>■ Default value: <b>20.000</b></li> </ul>
<b>Direction signal is inverted</b>	Activate this function if you want to change the direction of rotation of the connected stepper motor <ul style="list-style-type: none"> <li>■ Default value: <b>Not active</b></li> </ul>

Parameters	Explanation
<b>Analog output is inverted</b>	<p>If this function is active, the analog signal is inverted at the output</p> <ul style="list-style-type: none"> <li>■ Default value: Not active</li> </ul>
<b>Open position control loop</b>	<p>If this function is active, the axis is operated with an open position control loop</p> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p><b>i</b> When you are setting up the product, you can move the axes in an open position control loop. This way you determine appropriate parameters for <b>Fmax</b> and <b>Umax</b>.</p> </div> <ul style="list-style-type: none"> <li>■ Default value: Not active</li> </ul>
<b>Fmax</b>	<p>Definition of the feed rate achieved at <b>Umax</b></p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 mm/min ... 10000 mm/min</b></li> <li>■ Default value: <b>2000</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p><b>i</b> The <b>Maximum machine speed</b> cannot be exceeded, even if you have defined a higher feed rate for individual axes.</p> </div> <p><b>Further information:</b> "Special settings", Page 243</p>
<b>Umax</b>	<p>Maximum voltage that is output at the analog output in order to achieve <b>Fmax</b></p> <ul style="list-style-type: none"> <li>■ Setting range: <b>1000 mV ... 10000 mV</b></li> <li>■ Default value: <b>9000</b></li> </ul>
<b>Enable clockwise rotation</b>	<p>Assignment of the digital output for the clockwise spindle enable The input must be configured if the <b>Unipolar servo motor</b> motor type is selected</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Enable counterclockwise rotation</b>	<p>Assignment of the digital output for the counterclockwise spindle enable The input must be configured if the <b>Unipolar servo motor</b> motor type is selected</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Drive enable</b>	<p>Assignment of the digital output for the drive enable according to pin layout</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Target position reached</b>	<p>Assignment of the digital output when the axis is on the <b>Target position</b> in MDI mode of operation or in program run</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>



### 15.5.23 Inputs

Path: Settings ► Axes ► X, Y ... ► Inputs

Parameters	Explanation
<b>Movement commands from digital input</b>	Configuration of movement commands from external input devices via the digital input
<b>Movement commands from analog input</b>	Configuration of movement commands from external input devices via the analog input
<b>Movement commands from electronic handwheel</b>	Configuration of the movement commands from an electronic handwheel
<b>Digital enable inputs</b>	Configuration of the digital inputs for the enable

### 15.5.24 Movement commands from digital input

Path: Settings ► Axes ► X, Y ... ► Inputs ► Movement commands from digital input

Parameter	Explanation
<b>Enable digital movement commands</b>	<p>Enabling external movement commands (such as jog buttons on the operating panel of the machine) via the digital input</p> <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> Digital movement commands are only available if the analog movement commands are deactivated. <b>Further information:</b> "Movement commands from analog input", Page 258</p> </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> To be able to work with external movement commands you have to configure the following inputs:</p> <ul style="list-style-type: none"> <li>■ <b>Input for digital movement command in positive direction</b></li> <li>■ <b>Input for digital movement command in negative direction</b></li> </ul> </div>
<b>Input for digital movement command in positive direction</b>	<p>Assignment of the digital input for the movement command in the positive direction according to pin layout</p> <p>Default value: <b>Not connected</b></p>
<b>Input for digital movement command in negative direction</b>	<p>Assignment of the digital input for the movement command in the negative direction according to pin layout</p> <p>Default value: <b>Not connected</b></p>

## 15.5.25 Movement commands from analog input

Path: Settings ► Axes ► X, Y ... ► Inputs ► Movement commands from analog input

Parameter	Explanation
<b>Enable analog movement commands</b>	<p>Enabling movement commands from external input devices (such as a joystick) via the analog input</p> <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> Analog movement commands are only available if the digital movement commands are deactivated. <b>Further information:</b> "Movement commands from digital input", Page 257</p> </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> To be able to work with external movement commands you have to configure the <b>Input for analog movement commands</b>.</p> </div>
<b>Input for analog movement commands</b>	<p>Assignment of the analog input for the movement commands according to pin layout. The analog voltage at these inputs must be within a range of 0 V...5 V</p> <p>Default value: <b>Not connected</b></p>
<b>Dead band</b>	<p>Enter the dead band value in percent. The <b>Dead band</b> defines the input voltage range around the zero position (at approx. 2.5 V), at which the supplied voltage is not yet interpreted as movement command. The value refers to the entire voltage range.</p> <ul style="list-style-type: none"> <li>Setting range: <b>0 % ... 100 %</b></li> <li>Default value: <b>10 %</b></li> </ul>
<b>Invert the analog input</b>	<p>If this function is active, the analog input is inverted. With an inverted input, a higher input voltage leads to a feed rate in negative direction. A lower input voltage results in a feed rate in positive direction</p> <p>Default value: Not active</p>
<b>Fmax</b>	<p><b>Fmax</b> defines the maximum feed rate of the axis that can be reached via movement commands from the analog input</p> <ul style="list-style-type: none"> <li>Setting range: <b>100 mm/min ... 2000 mm/min</b></li> <li>Default value: <b>2000</b></li> </ul>
<b>Fmax for smooth feed</b>	<p>Definition of the feed rate for a slower feed rate with a fully deflected joystick</p> <ul style="list-style-type: none"> <li>Setting range: <b>100 mm/min ... 2000 mm/min</b></li> <li>Default value: <b>200</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> To be able to use the function, an input must be assigned in <b>Smooth feed selection for analog movement commands</b> <b>Further information:</b> "Inputs (Switching functions)", Page 238</p> </div>

Parameter	Explanation
Set input voltage	Starts a teach sequence to determine the input voltage

### 15.5.26 Movement commands from electronic handwheel

Path: **Settings ▶ Axes ▶ X, Y ... ▶ Inputs ▶ Movement commands from electronic handwheel**

Parameter	Explanation
Enable movement commands from electronic handwheel	Enabling of movement commands from an electronic handwheel <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul>
Selection of the electronic handwheel	In the drop-down list, select the electronic handwheel you want to use
Invert the counting direction	Activate this function if you want to invert the counting direction
Calculation of the feed override in handwheel mode	When the function is active, the current feed-rate override is taken into account in a handwheel movement
Position difference per revolution	Entry of the position difference per revolution. This parameter defines the linear movement per handwheel revolution <ul style="list-style-type: none"> <li>Setting range: <b>0.001 mm ... 8000 mm</b></li> <li>Default value: <b>2.5</b></li> </ul>
Maximum position difference	Entry of maximum position difference. This parameter allows you to limit the buffer that the handwheel has built up for traversing the linear axis <ul style="list-style-type: none"> <li>Setting range: <b>0.005 mm ... 20000 mm</b></li> <li>Default value: <b>20</b></li> </ul>
Resolution	Entry of the electronic handwheel resolution for defining how the electronic handwheel should move the axis. This parameter defines how fine or coarse the axis movement will be <ul style="list-style-type: none"> <li>Setting range: <b>1 μm ... 65000 μm</b></li> <li>Default value: <b>1</b></li> </ul>
Permissive button for movement commands from electronic handwheel	Assignment of the digital input for activating the electronic handwheel

### 15.5.27 Digital enable inputs

Path: Settings ► Axes ► X, Y ... ► Inputs ► Digital enable inputs

Parameter	Explanation
Input for error signal	<p>Assignment of the digital input according to pin layout</p> <p>The connected servo amplifier outputs the signal. The product interprets the signal as an error signal. If an error is present at the input, the axis is disconnected from power and abruptly brought to a standstill without a ramp. An error message is displayed on the product</p> <p>Default value: <b>Not connected</b></p> <p><b>Signal is low-active</b></p> <ul style="list-style-type: none"> <li>■ If the function is active, a "low" signal at the input is interpreted as an error. Release is given with a "high" signal</li> </ul>
Input for activated mechanical handwheel	<p>Assignment of the digital input for activation of the mechanical handwheel</p> <p>If the input is present, no NC movements can be executed with the axis. If the axis is in closed-loop control and the <b>Input for activated mechanical handwheel</b> switches, the axis is slowed down in a controlled manner and taken out of closed-loop control. When the input is no longer present, the axis can be moved in closed-loop control again</p> <p>Default value: <b>Not connected</b></p> <p><b>Signal is low-active</b></p> <ul style="list-style-type: none"> <li>■ If the function is active, a "low" signal at the input is interpreted as a mechanical handwheel</li> </ul>

### 15.5.28 Software limit switches

Path: Settings ► Axes ► X, Y ... ► Software limit switches

Parameters	Explanation
Software limit switches	<p>Use of the software limit switch</p> <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>
Limit switch in positive direction	<p>Distance in the positive direction from the machine datum to the software limit switch (including <b>Reference point displacement</b>, if activated)</p> <p>Unit: millimeters</p> <ul style="list-style-type: none"> <li>■ Default value: <b>0</b></li> </ul>
Limit switch in negative direction	<p>Distance in the negative direction from the machine datum to the software limit switch (including <b>Reference point displacement</b>, if activated)</p> <p>Unit: millimeters</p> <ul style="list-style-type: none"> <li>■ Default value: <b>0</b></li> </ul>

### Function of the software limit switches

Software limit switches limit the permissible range of traverse of an NC-controlled axis in the positive or negative direction. If the software limit switches are active, the axis is slowed down early enough to come to a standstill at the latest when reaching the software limit switch.

If a program step contains a nominal position that is outside the permissible range of traverse, the program step is acknowledged with an error message and the axis is not traversed. If the actual position of the axis is outside the permissible range of traverse, the axis can only be moved in the direction of the machine datum. A corresponding message is displayed on the product.

## 15.5.29 Spindle axis S

Path: **Settings ► Axes ► Spindle axis S**

Parameters	Explanation
<b>Axis name</b>	Definition of the axis name displayed in the position preview Settings: <ul style="list-style-type: none"> <li>■ <b>Not defined</b></li> <li>■ <b>S</b></li> <li>■ Default setting: <b>S</b></li> </ul>
<b>Axis type</b>	Definition of the axis type Settings: <ul style="list-style-type: none"> <li>■ <b>Not defined</b></li> <li>■ <b>Axis</b></li> <li>■ <b>Spindle</b></li> <li>■ <b>Gear spindle</b></li> <li>■ <b>Spindle with orientation</b></li> <li>■ Default setting: <b>Spindle</b></li> </ul>
<b>Encoder</b>	Configuration of the connected encoder <b>Further information:</b> "Encoder", Page 247
<b>Error compensation</b>	Configuration of the linear error compensation <b>LEC</b> or segmented linear error compensation <b>SLEC</b> <b>Further information:</b> "Linear error compensation (LEC)", Page 254 <b>Further information:</b> "Segmented linear error compensation (SLEC)", Page 254
<b>Outputs</b>	Configuration of the <b>Outputs</b> for the spindle <b>Further information:</b> "Outputs (S)", Page 263
<b>Inputs</b>	Configuration of the <b>Inputs</b> for the spindle <b>Further information:</b> "Inputs (S)", Page 264
<b>Gear stages</b>	Configuration of the <b>Gear stages</b> for the <b>Gear spindle</b> <b>Further information:</b> "Gear stages", Page 267

Parameters	Explanation
<b>Gear stage selection through an external signal</b>	<p>Selection of the <b>Gear stages</b> of the <b>Gear spindle</b> via external signals</p> <p>Settings</p> <ul style="list-style-type: none"> <li>■ <b>ON</b>: The <b>Gear stages</b> are selected via external signals</li> <li>■ <b>OFF</b>: The <b>Gear stages</b> are selected manually in the operating modes</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Start-up time for upper spindle speed range</b>	<p>Setting the <b>Start-up time</b> from standstill to the maximum spindle speed <b>Smax</b> for the upper spindle speed range</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>50 ms ... 10000 ms</b></li> <li>■ Default value: <b>500</b></li> </ul>
<b>Start-up time for lower spindle speed range</b>	<p>Setting the <b>Start-up time</b> from standstill to the maximum spindle speed <b>Smax</b> for the lower spindle speed range</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>50 ms ... 10000 ms</b></li> <li>■ Default value: <b>500</b></li> </ul>
<b>Break point of characteristic curve for start-up times</b>	<p>Definition of the limit between the upper and the lower spindle speed range</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 2000 rpm</b></li> <li>■ Default value: <b>1500</b></li> </ul>
<b>Minimum spindle speed</b>	<p>Definition of the minimum spindle speed</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 500 rpm</b></li> <li>■ Default value: <b>50</b></li> </ul>
<b>Maximum spindle speed for oriented spindle stop</b>	<p>Definition of the maximum spindle speed for oriented spindle stop</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 500 rpm</b></li> <li>■ Default value: <b>30</b></li> </ul>
<div style="border: 1px solid black; padding: 5px; display: inline-block;"> <p><b>i</b> To use the function, you have to assign an input to the <b>Spindle position</b> parameter.  <b>Further information:</b> "Inputs (S)", Page 264</p> </div>	
<b>Maximum spindle speed for thread cutting</b>	<p>Setting the maximum spindle speed for thread cutting during tapping in the Milling application</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 rpm ... 2000 rpm</b></li> <li>■ Default value: <b>1000</b></li> </ul>
<b>Maximum spindle speed in positioning mode</b>	<p>Setting the maximum spindle speed in controlled operation for the Thread Cutting machining cycles in the Turning application</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 rpm ... 200 rpm</b></li> <li>■ Default value: <b>1500</b></li> </ul>
<b>Kv factor P</b>	<p>Proportional component of the position controller during positioning</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0.3°/(min x m°) ... 6°/(min x m°)</b></li> <li>■ Default value: <b>2.5</b></li> </ul>
<b>Kv factor L</b>	<p>Proportional component of the position controller at a standstill</p> <ul style="list-style-type: none"> <li>■ Setting range: <b>0.3°/(min x m°) ... 6°/(min x m°)</b></li> <li>■ Default value: <b>2.5</b></li> </ul>

Parameters	Explanation
<b>Maximum positioning error</b>	Definition of the maximum following error during positioning <ul style="list-style-type: none"> <li>Setting range: <b>0.005° ... 10.000°</b></li> <li>Default value: <b>0.500</b></li> </ul>
<b>Maximum standstill error</b>	Definition of the maximum position deviation at a standstill <ul style="list-style-type: none"> <li>Setting range: <b>0.005° ... 10.000°</b></li> <li>Default value: <b>0.100</b></li> </ul>
<b>Positioning window in NC mode</b>	Setting the positioning window in NC mode <ul style="list-style-type: none"> <li>Setting range: <b>0.005° ... 2.000°</b></li> <li>Default value: <b>0.020</b></li> </ul>

#### Start-up times of a spindle

The **Break point of characteristic curve for start-up times** value divides the spindle speeds into two ranges. For each range you can define an individual start-up time:

- **Start-up time for upper spindle speed range:** Time within which the motor accelerates from standstill to the maximum speed **S<sub>max</sub>**
- **Start-up time for lower spindle speed range:** Time within which the motor accelerates from standstill to the maximum speed **S<sub>max</sub>**

### 15.5.30 Outputs (S)

Path: **Settings ► Axes ► S ► Outputs**

Parameters	Explanation
<b>Type of motor</b>	For axes that are operated with a servo motor: <ul style="list-style-type: none"> <li><b>Bipolar servo motor: -10 V ... 10 V</b></li> <li><b>Unipolar servo motor: 0 V ... 10 V</b></li> <li><b>Stepper motor</b></li> </ul>
<b>Analog output</b>	Assignment of the analog output according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Output for stepper motor</b>	Assignment of the stepper motor output according to the pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Minimum step frequency</b>	Definition of the minimum step frequency of the connected stepper motor <ul style="list-style-type: none"> <li>Setting range: <b>0 kHz ... 1000 kHz</b></li> <li>Default value: <b>0.000</b></li> </ul>
<b>Maximum step frequency</b>	Definition of the maximum step frequency of the connected stepper motor <ul style="list-style-type: none"> <li>Setting range: <b>0 kHz ... 1000 kHz</b></li> <li>Default value: <b>20.000</b></li> </ul>
<b>Analog output is inverted</b>	If this function is active, the analog signal is inverted at the output <ul style="list-style-type: none"> <li>Default value: <b>Not active</b></li> </ul>

Parameters	Explanation
<b>Direction signal is inverted</b>	<p>Activate this function if you want to change the direction of rotation of the connected stepper motor</p> <ul style="list-style-type: none"> <li>■ Default value: Not active</li> </ul>
<b>Open position control loop</b>	<p>If this function is active, the axis is operated with an open position control loop</p> <ul style="list-style-type: none"> <li>■ Default value: Not active</li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> When you are setting up the product, you can move the axes in an open position control loop. This way you determine appropriate parameters for <b>Smax</b> and <b>Umax</b>.</p> </div>
<b>Smax</b>	<p>Definition of the <b>Spindle speed</b> attained with <b>Umax</b></p> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 rpm ... 10000 rpm</b></li> <li>■ Default value: <b>2000</b></li> </ul> <p><b>Further information:</b> "Special settings", Page 243</p>
<b>Umax</b>	<p>Maximum voltage that is output at the analog output in order to attain <b>Smax</b></p> <ul style="list-style-type: none"> <li>■ Setting range: <b>1000 mV ... 10000 mV</b></li> <li>■ Default value: <b>9000</b></li> </ul>
<b>Enable clockwise rotation</b>	<p>Assignment of the digital output for the clockwise spindle enable The input must be configured if the <b>Unipolar servo motor</b> motor type is selected</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Enable counterclockwise rotation</b>	<p>Assignment of the digital output for the counterclockwise spindle enable The input must be configured if the <b>Unipolar servo motor</b> motor type is selected</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Drive enable</b>	<p>Assignment of the digital output for the drive enable according to pin layout</p> <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>

### 15.5.31 Inputs (S)

Path: **Settings ► Axes ► S ► Inputs**

Parameters	Explanation
<b>Movement commands from digital input</b>	Configuration of the movement commands for the the digital input of the spindle
<b>Digital enable inputs</b>	Configuration of the digital inputs for the spindle enable
<b>Spindle speed display via analog input</b>	Configuration of the display of the actual spindle speed





### 15.5.32 Movement commands from digital input (S)

Path: Settings ► Axes ► S ► Inputs ► Movement commands from digital input

Parameter	Explanation
<b>Enable digital movement commands</b>	Use of the digital movement commands <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul>
<b>Spindle start</b>	Assignment of the digital input for the spindle start according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle stop</b>	Assignment of the digital input for the spindle stop according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>

### 15.5.33 Digital enable inputs (S)

Path: Settings ► Axes ► S ► Inputs ► Digital enable inputs

Parameter	Explanation
<b>Spindle ready</b>	Assignment of a digital input; indicates that the spindle is in reliable condition <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle interrupt</b>	Assignment of a digital input; in active state it immediately disconnects from power the configured analog output of the spindle. A spindle movement is stopped without a ramp, axes with automatic traverse are stopped if applicable and spindle activation is prevented. <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> The machine tool builder is responsible for the immediate stopping of the spindles.</p> </div> <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle protection device</b>	Assignment of a digital input; indicates whether an existing spindle protection device is open or closed. This signal influences error messages and program run. <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p> The machine tool builder is responsible for the immediate shutdown of the spindles with opened spindle protection.</p> </div> <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle sleeve final position +</b>	Assignment of a digital input for the upper limit switch of the sleeves. The input is used for reversing the spindle with thread cutting <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>

Parameter	Explanation
<b>Spindle sleeve final position -</b>	Assignment of a digital input for the lower limit switch of the sleeves. The input is used for reversing the spindle with thread cutting <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle position</b>	Assignment of a digital input; the signal positions the spindle at the speed set in <b>Maximum spindle speed for oriented spindle stop</b> during stopping to a desired position <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Enable spindle CCW</b>	Assignment of a digital input for counterclockwise direction of spindle rotation according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> The external input signal takes precedence over the direction of rotation set in the <b>OEM bar</b> or in the <b>Programming</b> menu.</p> </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> The external signal is only evaluated if a high level is constantly present at the digital input for <b>Spindle start</b>.</p> </div>

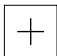
### 15.5.34 Spindle speed display via analog input (S)

Path: **Settings ▶ Axes ▶ S ▶ Inputs ▶ Spindle speed display via analog input**

Parameter	Explanation
<b>Spindle speed display via analog input</b>	Activation of spindle-speed display in the position display <ul style="list-style-type: none"> <li>Settings: <b>ON</b> or <b>OFF</b></li> <li>Default value: <b>OFF</b></li> </ul>
<b>Input for spindle speed display</b>	Assignment of the analog input according to pin layout <ul style="list-style-type: none"> <li>Default value: <b>Not connected</b></li> </ul>
<b>Spindle speed at input voltage 5 V</b>	Entering the spindle speed at an input voltage of 5 V <ul style="list-style-type: none"> <li>Default value: <b>2000</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> The measured input voltage is offset against the factor <b>Spindle speed at input voltage 5 V</b>. The result is shown as actual speed in the position display.</p> </div>

### 15.5.35 Adding Gear stages

Path: **Settings ▶ Axes ▶ S ▶ Gear stages ▶ +**

Parameter	Explanation
	Adding a new gear stage with default name <b>Further information:</b> "Gear stages", Page 267

### 15.5.36 Gear stages

Path: Settings ► Axes ► S ► Gear stages

Parameter	Explanation
<b>Name</b>	Entry of the name for the gear stage <ul style="list-style-type: none"> <li>■ Default value: <b>Stage [n]</b></li> </ul>
<b>Smax</b>	Definition of the <b>Spindle speed</b> attained with <b>Umax</b> <ul style="list-style-type: none"> <li>■ Setting range: <b>100 rpm ... 10000 rpm</b></li> <li>■ Default value: <b>2000</b></li> </ul>
<b>Start-up time for upper spindle speed range</b>	Definition of the required <b>Start-up time</b> until <b>Smax</b> is reached <ul style="list-style-type: none"> <li>■ Setting range: <b>50 ms ... 10000 ms</b></li> <li>■ Default value: <b>500</b></li> </ul>
<b>Start-up time for lower spindle speed range</b>	Definition of the required <b>Start-up time</b> until <b>Smax</b> is reached <ul style="list-style-type: none"> <li>■ Setting range: <b>50 ms ... 10000 ms</b></li> <li>■ Default value: <b>500</b></li> </ul>
<b>Break point of characteristic curve for start-up times</b>	Setting of the spindle speed that marks the transition from the upper to the lower spindle speed range <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 2000 rpm</b></li> <li>■ Default value: <b>1500</b></li> </ul>
<b>Minimum spindle speed</b>	Definition of the minimum spindle speed <ul style="list-style-type: none"> <li>■ Setting range: <b>0 rpm ... 10000 rpm</b></li> <li>■ Default value: <b>50</b></li> </ul>
<b>Remove</b>	Removal of the selected gear stage

## 15.6 Service

This chapter describes settings for product configuration, for maintaining the firmware and for enabling software options.

This chapter describes the settings for the product configuration and for the maintenance of the firmware.

### 15.6.1 Firmware information

Path: **Settings ► Service ► Firmware information**

The following information on the individual software modules is displayed for service and maintenance.

Parameter	Explanation
<b>Core version</b>	Version number of the microkernel
<b>Microblaze bootloader version</b>	Version number of the Microblaze bootloader
<b>Microblaze firmware version</b>	Version number of the Microblaze firmware
<b>Extension PCB bootloader version</b>	Version number of the bootloader (expansion board)
<b>Extension PCB firmware version</b>	Version number of the firmware (expansion board)
<b>Boot ID</b>	ID number of the boot process
<b>HW Revision</b>	Revision number of the hardware
<b>C Library Version</b>	Version number of the C library
<b>Compiler Version</b>	Version number of the compiler
<b>Touchscreen Controller version</b>	Version number of the touchscreen controller
<b>Number of unit starts</b>	Number of times the product was switched on
<b>Qt build system</b>	Version number of the Qt compilation software
<b>Qt runtime libraries</b>	Version number of the Qt runtime libraries
<b>Kernel</b>	Version number of the Linux kernel
<b>Login status</b>	Information on the logged-in user
<b>SystemInterface</b>	Version number of the system interface module
<b>BackendInterface</b>	Version number of the backend interface module
<b>GuiInterface</b>	Version number of the user interface module
<b>TextDataBank</b>	Version number of the text database module
<b>Optical edge detection</b>	Version number of the optical edge detection module
<b>NetworkInterface</b>	Version number of the network interface module
<b>OSInterface</b>	Version number of the operating system interface module
<b>PrinterInterface</b>	Version number of the printer interface module
<b>system.xml</b>	Version number of the system parameters
<b>axes.xml</b>	Version number of the axis parameters
<b>encoders.xml</b>	Version number of the encoder parameters
<b>ncParam.xml</b>	Version number of the NC parameters
<b>spindle.xml</b>	Version number of the spindle axis parameters

Parameter	Explanation
<b>io.xml</b>	Version number of the parameters for inputs and outputs
<b>mFunctions.xml</b>	Version number of the M function parameters
<b>peripherals.xml</b>	Version number of the parameters for peripherals
<b>slec.xml</b>	Version number of the parameters for segmented linear error compensation (SLEC)
<b>lec.xml</b>	Version number of the parameters for linear error compensation (LEC)
<b>microBlazePVRegister.xml</b>	Version number of the "Processor Version Register" of MicroBlaze
<b>info.xml</b>	Version number of the information parameters
<b>audio.xml</b>	Version number of the audio parameters
<b>network.xml</b>	Version number of the network parameters
<b>os.xml</b>	Version number of the operating system parameters
<b>runtime.xml</b>	Version number of the runtime parameters
<b>users.xml</b>	Version number of the user parameters
<b>GI Patch Level</b>	Patch level of the golden image (GI)

## 15.6.2 Back up and restore

Path: **Settings ► Service ► Back up and restore**

The unit's settings or user files can be backed up as a file so that they are available after a reset to the factory default settings has been performed or for installation on multiple units.

Parameters	Explanation
<b>Restore settings</b>	Restoring of the backed up settings <b>Further information:</b> "Restore settings", Page 292
<b>Back up settings</b>	Backing up of settings of the product <b>Further information:</b> "Back up settings", Page 132
<b>Restore user files</b>	Restoring of user files of the product <b>Further information:</b> "Restore user files", Page 291
<b>Back up user files</b>	Backing up of user files of the product <b>Further information:</b> "Back up user files", Page 133

### 15.6.3 Firmware update

Path: **Settings ► Service ► Firmware update**

The firmware is the operating system of the product. You can import new versions of the firmware via the product's USB port or the network connection.



Prior to the firmware update, you must comply with the release notes for the respective software version and the information they contain regarding reverse compatibility.



In order to be on the safe side, the current settings must be backed up if the unit's firmware is going to be updated.

**Further information:** "Updating the firmware", Page 284

### 15.6.4 Reset


Path: **Settings ► Service ► Reset**

If necessary, you can reset the unit's settings to the factory default settings or to the condition at delivery. Software options are deactivated and subsequently need to be reactivated with the available license key.

Parameter	Explanation
<b>Reset all settings</b>	The settings are reset to factory default settings <b>Further information:</b> "Reset all settings", Page 293
<b>Reset to shipping conditions</b>	Resetting of the settings to the factory default setting and deletion of the user files from the unit's memory area <b>Further information:</b> "Reset to shipping conditions", Page 293

## 15.6.5 OEM area

Path: **Settings ► Service ► OEM area**

Parameters	Explanation
<b>Documentation</b>	Addition of OEM documentation, e.g. service information <b>Further information:</b> "Adding documentation", Page 119
<b>Startup screen</b>	Changing the startup screen (e.g., with one's own company logo) <b>Further information:</b> "Startup screen", Page 271
<b>OEM bar</b>	Customization of the OEM bar with specific functions <b>Further information:</b> "OEM bar", Page 272
<b>Settings</b>	Adaptation of the application mode, override display, keyboard design, and program execution. Management of texts and messages. <b>Further information:</b> "Settings (OEM area)", Page 276
<b>Back up and restore</b>	Backing up and restoring the settings of the OEM area
<b>Remote access for screenshots</b>	Permitting a network connection with the ScreenshotClient program so that ScreenshotClient can take screenshots of the unit from a computer Settings: <ul style="list-style-type: none"> <li>■ <b>ON:</b> Remote access is possible</li> <li>■ <b>OFF:</b> Remote access is not possible</li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;">  When the unit is shut down, <b>Remote access for screenshots</b> is automatically deactivated. </div>

## 15.6.6 Startup screen

Path: **Settings ► Service ► OEM area ► Startup screen**

Parameter	Explanation
<b>Add startup screen</b>	Selecting the image file that is to be displayed as opening screen (file type: PNG or JPG) <b>Further information:</b> "Adding a startup screen", Page 119
<b>Delete startup screen</b>	<b>Delete</b> clears the user-defined opening screen and restores the default view

### 15.6.7 OEM bar

Path: **Settings ► Service ► OEM area ► OEM bar**

Parameters	Explanation
<b>Show bar</b>	Display of the <b>OEM bar</b> Settings: <ul style="list-style-type: none"> <li>■ <b>ON: OEM bar</b> is displayed on the user interface of the respective operating modes</li> <li>■ <b>OFF: OEM bar</b> is not displayed</li> </ul> Default value: <b>OFF</b>
<b>Bar items</b>	Configuration of the <b>Bar items</b> in the <b>OEM bar</b> <b>Further information:</b> "Adding OEM-Bar items", Page 272

### 15.6.8 Adding OEM-Bar items

Path: **Settings ► Service ► OEM area ► OEM bar ► Bar items ► +**

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	Selection of the new bar item on the <b>OEM bar</b> Settings: <ul style="list-style-type: none"> <li>■ <b>Empty</b></li> <li>■ <b>Logo</b></li> <li>■ <b>Spindle speed</b></li> <li>■ <b>M function</b></li> <li>■ <b>Special functions</b></li> <li>■ <b>Document</b></li> </ul> Default value: <b>Empty</b>
Parameters	The available parameters depend on the type of bar item selected: <ul style="list-style-type: none"> <li>■ <b>Logo:</b> <b>Further information:</b> "OEM bar item: Logo", Page 273</li> <li>■ <b>Spindle speed:</b> <b>Further information:</b> "Spindle speed OEM bar item", Page 273</li> <li>■ <b>M functions:</b> <b>Further information:</b> "M function OEM bar item", Page 274</li> <li>■ <b>Special functions:</b> <b>Further information:</b> "Special functions OEM bar item", Page 275</li> <li>■ <b>Document:</b> <b>Further information:</b> "Document OEM bar item", Page 275</li> </ul>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>



### 15.6.9 OEM bar item: Logo

Path: **Settings ► Service ► OEM area ► OEM bar ► Bar items ► Logo**

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	<b>Logo</b>
<b>Select logo</b>	Selecting the desired image for the depiction
<b>Link to documentation</b>	Using a logo for calling linked documentation Settings: <ul style="list-style-type: none"> <li>■ <b>None</b></li> <li>■ <b>Operating Instructions</b></li> <li>■ <b>OEM service info</b></li> </ul> Default value: <b>None</b>
<b>Upload image file</b>	Copies a selected image file to the storage location <b>/Oem/Images</b> <ul style="list-style-type: none"> <li>■ File format: PNG, JPG, PPM, BMP, or SVG</li> <li>■ Image size: max. 140 x 70 px</li> </ul>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>

### 15.6.10 Spindle speed OEM bar item

Path: **Settings ► Service ► OEM area ► OEM bar ► Bar items ► Spindle speed**

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	<b>Spindle speed</b>
<b>Spindle</b>	<b>S</b>
<b>Spindle speed</b>	Setting the spindle speed <ul style="list-style-type: none"> <li>■ Setting range: depends on the configuration of the spindle axis S</li> <li>■ Default value: <b>0</b></li> </ul>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>

### 15.6.11 M function OEM bar item

Path: Settings ► Service ► OEM area ► OEM bar ► Bar items ► M function

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	<b>M function</b>
<b>Number of the M function</b>	<p>Selection of the desired M function</p> <p>Setting ranges</p> <ul style="list-style-type: none"> <li>■ <b>100.T ... 120.T (TOGGLE:</b> switches between the states when tapped)</li> <li>■ <b>100.P ... 120.P (PULSE:</b> The length can be set in <b>Pulse time</b>)</li> <li>■ Default value: Empty</li> </ul>
<b>Pulse time</b>	<p>Selecting the length of the high-active pulse</p> <p>Setting range</p> <ul style="list-style-type: none"> <li>■ 8 ms ... 1500 ms</li> <li>■ Default value: 500 ms</li> </ul>
<b>Restart</b>	<p>Restarting the pulse duration</p> <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Select image for active function</b>	Selecting the desired image for depicting the active function
<b>Select image for inactive function</b>	Selecting the desired image for depicting the inactive function
<b>Upload image file</b>	<p>Copies a selected image file to the storage location <b>/Oem/Images</b></p> <ul style="list-style-type: none"> <li>■ File format: PNG, JPG, PPM, BMP, or SVG</li> <li>■ Image size: Max. 100 x 70 px</li> </ul>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>

### 15.6.12 Special functions OEM bar item

Path: Settings ► Service ► OEM area ► OEM bar ► Bar items ► Special functions

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	<b>Special functions</b>
<b>Function</b>	Selection of the desired special function Settings: <ul style="list-style-type: none"> <li>■ <b>Thread cutting</b></li> <li>■ <b>Spindle direction</b></li> <li>■ <b>Coolant</b></li> <li>■ <b>Coolant during spindle operation</b></li> <li>■ <b>Clamp axes</b></li> <li>■ <b>Zero the tool axis</b></li> </ul> Default value: <b>Thread cutting</b>
<b>Spindle</b>	Only with <b>Spindle direction</b> function: <b>S</b>
<b>Select image for clockwise spindle direction</b>	Only with <b>Spindle direction</b> function: Selecting the desired image for clockwise spindle rotation
<b>Select image for counterclockwise spindle direction</b>	Only with <b>Spindle direction</b> function: Selecting the desired image for counterclockwise spindle rotation
<b>Select image for active function</b>	Selecting the desired image for depicting the active function
<b>Select image for inactive function</b>	Selecting the desired image for depicting the inactive function
<b>Upload image file</b>	Copies a selected image file to the storage location <b>/Oem/Images</b> <ul style="list-style-type: none"> <li>■ File format: PNG, JPG, PPM, BMP, or SVG</li> <li>■ Image size: Max. 100 x 70 px</li> </ul>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>

### 15.6.13 Document OEM bar item

Path: Settings ► Service ► OEM area ► OEM bar ► Bar items ► Document

Parameters	Explanation
<b>Description</b>	Description of the bar item on the <b>OEM bar</b>
<b>Type</b>	<b>Document</b>
<b>Select a document</b>	Selecting the desired document
<b>Select image for display</b>	Selecting the desired image for depicting the function
<b>Upload image file</b>	Copies a selected image file to the storage location <b>/Oem/Images</b>
<b>Remove bar entry</b>	Removing the bar item from the <b>OEM bar</b>

### 15.6.14 Settings (OEM area)

Path: Settings ► Service ► OEM area ► Settings

Parameters	Explanation
<b>Application</b>	The type of application mode; a change becomes active after a restart Settings: <ul style="list-style-type: none"> <li>■ <b>Milling</b></li> <li>■ <b>Turning</b></li> </ul> Default value: <b>Milling</b>
<b>Override display</b>	Type of override display in <b>Manual mode</b> and <b>MDI</b> Settings: <ul style="list-style-type: none"> <li>■ <b>Percent</b>: The override is displayed as a percentage of the set maximum feed rate</li> <li>■ <b>Value</b>: Override is displayed in mm/min</li> </ul> Default value: <b>Percent</b>
<b>Keyboard theme</b>	Selection of the keyboard layout Settings: <ul style="list-style-type: none"> <li>■ <b>Standard</b>: Confirm the input with (Return)</li> <li>■ <b>TNC</b>: entry confirmed with (Enter)</li> </ul> Default value: <b>Standard</b>
<b>Program run</b>	Modifying of the program execution <b>Further information</b> : "Program execution", Page 276
<b>Text database</b>	Text database with message texts that are used for OEM-specific messages <b>Further information</b> : "Text database", Page 277
<b>Messages</b>	Definition of OEM-specific messages <b>Further information</b> : "Messages", Page 278

### 15.6.15 Program execution

Path: Settings ► Service ► OEM area ► Settings ► Program run

Parameter	Explanation
<b>Automatic advance on reaching upper spindle sleeve final position</b>	Automatic advance when executing hole patterns always occurs when the upper spindle sleeve limit switch is reached <ul style="list-style-type: none"> <li>■ Settings: <b>ON</b> or <b>OFF</b></li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>M functions</b>	For the configuration, see "Configuring M functions", Page 277

### 15.6.16 Configuring M functions

Path: **Settings ► Service ► OEM area ► Settings ► Program run ► M functions**

Parameter	Explanation
<b>Number of the M function</b>	Enter the number of the new M function <ul style="list-style-type: none"> <li>■ Setting range: <b>M2.0 ... M120.0 (0)</b>: The output assigned to the M function is switched to inactive)</li> <li>■ Setting range: <b>M2.1 ... M120.1 (1)</b>: The output assigned to the M function is switched to active)</li> <li>■ Setting range: <b>M2.2 ... M120.2 (2)</b>: The output assigned to the M function generates a high active pulse of 8 ms)</li> </ul>
<b>Select image for dialog during program run</b>	Select the desired image for display during program run
<b>Upload image file</b>	Copies a selected image file to the storage location <b>/Oem/Images</b> <ul style="list-style-type: none"> <li>■ File format: PNG, JPG, PPM, BMP, or SVG</li> <li>■ Image size: Max. 100 x 70 px</li> </ul>
<b>Remove the entry</b>	Remove the entry

### 15.6.17 Text database


Path: **Settings ► Service ► OEM area ► Settings ► Text database**

The device features the option of importing your own text database. The **Messages** parameter allows you to show various messages.

Parameter	Explanation
<b>Select text database</b>	Selecting an XML type text database stored in the device <b>Further information:</b> "Creating a Text database", Page 127
<b>Deselect text database</b>	Deselecting the currently selected text database

### 15.6.18 Messages

Path: Settings ► Service ► OEM area ► Settings ► Messages

Parameter	Explanation
<b>Name</b>	Description of the message
<b>Text ID or text</b>	Selecting the message to be displayed. You can enter a text ID and use it to select an existing message text from your text database. As an alternative, you can directly enter a new message text
	<div style="border: 1px solid black; padding: 5px;"> <p> If you change the language of your product's user interface, the translated message texts from the text database are used. Message texts you have directly entered are shown untranslated.</p> </div>
	<b>Further information:</b> "Text database", Page 277
<b>Message type</b>	Selecting the desired type of message Settings: <ul style="list-style-type: none"> <li>■ <b>Standard:</b> The message is displayed as long as the input is active</li> <li>■ <b>Acknowledgment by user:</b> The message is displayed until the user acknowledges it</li> <li>■ Default value: <b>Standard</b></li> </ul>
<b>Input</b>	Assignment of the digital input in accordance with pin layout in order to show the message <ul style="list-style-type: none"> <li>■ Default value: <b>Not connected</b></li> </ul>
<b>Remove the entry</b>	Removing the message entry

### 15.6.19 Back up and restore (OEM area)

Path: Settings ► Service ► OEM area ► Back up and restore

Parameter	Explanation
<b>Back-up OEM-specific folders and files</b>	Backing up the settings of the OEM area as a ZIP file <b>Further information:</b> "Back-up OEM-specific folders and files", Page 130
<b>Restore OEM specific folders and files</b>	Restoring the settings of the OEM area as a ZIP file <b>Further information:</b> "Restore OEM specific folders and files", Page 130

### 15.6.20 Documentation

Path: **Settings ► Service ► Documentation**

The product provides the possibility to upload the corresponding Operating Instructions in the desired language. The Operating Instructions can be copied from the supplied USB mass storage device to the product.

The latest version can be downloaded from the download area at **www.heidenhain.com**.

Parameters	Explanation
<b>Add Operating Instructions</b>	Adding the Operating Instructions in the desired language

### 15.6.21 Software options

Path: **Settings ► Service ► Software options**



Software options need to be enabled on the product via a license key. Before you can use the associated hardware components, you need to enable the respective software option.

**Further information:** "Activating the Software options", Page 96

Parameter	Explanation
<b>Overview</b>	Overview of all software options that are active on the product
<b>Request options</b>	Creation of a license key request that can be submitted to a HEIDENHAIN service agency <b>Further information:</b> "Requesting license key", Page 96
<b>Request trial options</b>	Creation of a license key request that can be submitted to a HEIDENHAIN service agency <b>Further information:</b> "Requesting license key", Page 96
<b>Activate options</b>	Activation of the software options via license key or license file <b>Further information:</b> "Activating a license key", Page 97
<b>Reset trial options</b>	Reset of the trial options by entering a license key





# 16

**Servicing and  
maintenance**

## 16.1 Overview

This chapter describes the general maintenance work on the product.



The following steps must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29



This chapter contains a description of maintenance work for the product only. Any maintenance work on peripheral devices is not described in this chapter.

**Further information:** Manufacturer's documentation for the respective peripheral devices

## 16.2 Cleaning

### NOTICE

#### Cleaning with sharp-edged objects or aggressive cleaning agents

Improper cleaning will cause damage to the product.

- ▶ Never use abrasive or aggressive cleaners, and never use strong detergents or solvents
- ▶ Do not use sharp-edged objects to remove persistent contamination

#### Cleaning the housing

- ▶ Use only a cloth dampened with water and a mild detergent for cleaning the exterior surfaces

#### Cleaning the screen

Activate cleaning mode to clean the display. This switches the unit to an inactive state without interrupting the power supply. The screen is switched off in this state.



- ▶ Tap **Switch-off** in the main menu to activate the cleaning mode



- ▶ Tap **Cleaning mode**
- > The screen switches off
- ▶ Use a lint-free cloth and a commercially available glass cleaner to clean the screen




- ▶ To deactivate the cleaning mode, tap anywhere on the touchscreen
- > An arrow appears at the bottom of the screen
- ▶ Drag the arrow up
- > The screen is switched on and shows the user interface last displayed

### 16.3 Maintenance plan

The product is largely maintenance-free.

<b>NOTICE</b>	
<b>Operating defective devices</b>	
Operating defective devices may result in serious consequential damage.	
<ul style="list-style-type: none"> <li>▶ Do not repair or operate the device if it is damaged</li> <li>▶ Replace defective devices immediately or contact a HEIDENHAIN service agency</li> </ul>	

	The following steps are only to be performed by electrical specialists. <b>Further information:</b> "Personnel qualification", Page 29
---	---

Maintenance step	Interval	Corrective action
▶ All labels and symbols provided on the product must be checked for readability	Annually	▶ Contact HEIDENHAIN service agency
▶ Inspect electrical connections for damage and check their function	Annually	▶ Replace defective cables. Contact HEIDENHAIN service agency if required
▶ Check power cables for faulty insulation and weak points	Annually	▶ Replace power cables according to the specification

### 16.4 Resuming operation

When operation is resumed, e.g. when the product is reinstalled after repair or when it is remounted, the same measures and personnel requirements apply as for mounting and installing the product.

**Further information:** "Mounting", Page 39

**Further information:** "Installation", Page 45

When connecting the peripheral devices (e.g. encoders), the operating company must ensure safe resumption of operation and assign authorized and appropriately qualified personnel to the task.

**Further information:** "Obligations of the operating company", Page 29

## 16.5 Updating the firmware

The firmware is the operating system of the product. You can import new versions of the firmware via the product's USB port or the network connection.



Prior to the firmware update, you must comply with the release notes for the respective software version and the information they contain regarding reverse compatibility.



In order to be on the safe side, the current settings must be backed up if the unit's firmware is going to be updated.

### Prerequisite

- The new firmware is available as a \*.dro file
- To update the firmware over the USB port, the current firmware must be stored on a USB mass storage device (FAT32 format)
- To update the firmware via the network interface, the current firmware must be available in a folder on the network drive

### Starting a firmware update



- ▶ Tap **Settings** in the main menu
- ▶ Tap **Service**
- ▶ Open in succession:
  - **Firmware update**
  - **Continue**
- > The service application is launched

### Updating the firmware

The firmware can be updated from a USB mass storage device (FAT32 format) or via a network drive.



- ▶ Tap **Firmware update**
- ▶ Tap **Select**
- ▶ If required, connect a USB mass storage device to a USB port of the product
- ▶ Navigate to the folder containing the new firmware

**i** If you have accidentally tapped the wrong folder, you can return to the previous folder.

- ▶ Tap the file name that is displayed above the list

- ▶ Select the firmware
- ▶ Tap **Select** to confirm the selection
- ▶ The firmware version information is displayed
- ▶ Tap **OK** to close the dialog

**i** The firmware update cannot be canceled once the data transfer has started.

- ▶ Tap **Start** to start the update
- ▶ The screen shows the progress of the update
- ▶ Tap **OK** to confirm successful update
- ▶ Tap **Finish** to terminate the service application
- ▶ The service application is terminated
- ▶ The main application is launched
- ▶ If automatic user login is active, the user interface is displayed in the **Manual operation** menu
- ▶ If automatic user login is not active, the **User login** menu is displayed

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations
- ▶ Tap **Safely remove**
- ▶ The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



## 16.6 Encoder diagnostics

The diagnostic function allows you to perform a basic functional check of the encoders. For absolute encoders with EnDat interface, the messages from the encoder and its functional reserves are displayed. For incremental encoders with 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface, the displayed values allow you to evaluate the fundamental functioning of the encoders. Based on this initial diagnostic option for encoders, you can initiate further actions for more detailed testing or repair.

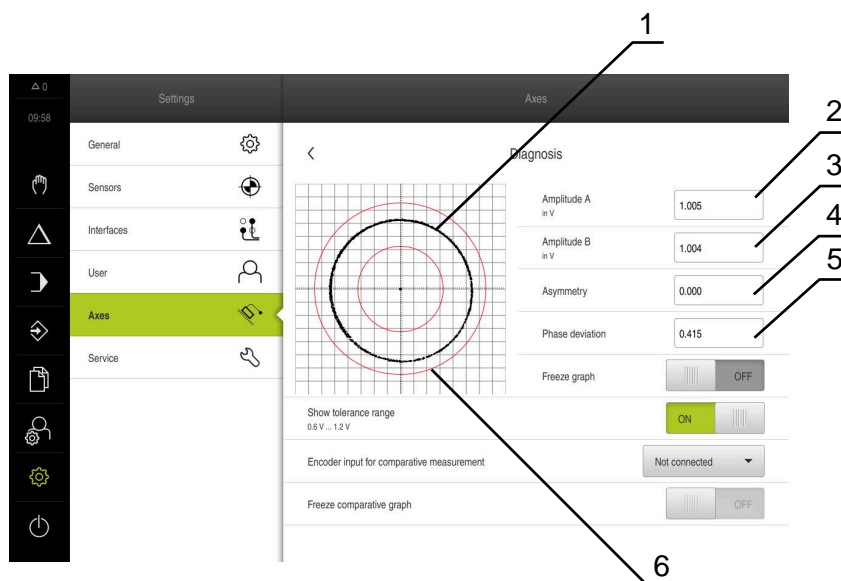


The PWT 101 or PWM 21 from HEIDENHAIN provides further inspection and testing capabilities.

For more information, please refer to [www.heidenhain.com](http://www.heidenhain.com).

### 16.6.1 Diagnostics for encoders with 1 V<sub>PP</sub>/11 μA<sub>PP</sub> interface

For encoders with 1 V<sub>PP</sub>/11 μA<sub>PP</sub> interface, you can evaluate the functioning of the encoder based on the signal amplitudes, asymmetry, and phase deviation. These values are also displayed graphically as a Lissajous figure.



- 1 Lissajous figure
- 2 Amplitude A
- 3 Amplitude B
- 4 Asymmetry
- 5 Phase error
- 6 Amplitude tolerances

For encoders with 1 V<sub>PP</sub>/11 μA<sub>PP</sub> interface, the following values are displayed:

- **Amplitude A**
- **Amplitude B**
- **Asymmetry**
- **Rapid traverse speed for radial movements**

The following parameters are available for evaluation:

Parameter	Explanation
<b>Freeze graph</b>	Freezing of Lissajous figure Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The graph is frozen and is not updated when the encoder is moved</li> <li>■ <b>OFF</b>: The graph is not frozen and is updated when the encoder is moved</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Show tolerance range</b>	Display of tolerance range for the amplitudes <ul style="list-style-type: none"> <li>■ 1 V<sub>PP</sub>: 0.6 V ... 1.2 V</li> <li>■ 11 μA<sub>PP</sub>: 7 μA<sub>PP</sub> ... 16 μA<sub>PP</sub></li> </ul> Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The tolerance range is displayed</li> <li>■ <b>OFF</b>: The tolerance range is hidden</li> <li>■ Default value: <b>OFF</b></li> </ul>
<b>Encoder input for comparative measurement</b>	Display the encoder of another encoder input for comparison; the signals can be superimposed for comparison Settings: <ul style="list-style-type: none"> <li>■ Selection of desired encoder input</li> <li>■ Default value: Not connected</li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> The parameter is available only if another encoder with 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface is connected.</p> </div>
<b>Freeze comparative graph</b>	The Lissajous figure of the encoder at the encoder input is frozen for comparative measurement Settings: <ul style="list-style-type: none"> <li>■ <b>ON</b>: The graph is frozen and is not updated when the encoder is moved</li> <li>■ <b>OFF</b>: The graph is not frozen and is updated when the encoder is moved</li> <li>■ Default value: <b>OFF</b></li> </ul> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p><b>i</b> The parameter is available only if another encoder with 1 V<sub>PP</sub> or 11 μA<sub>PP</sub> interface is connected.</p> </div>



▶ Tap **Settings** in the main menu



▶ Tap **Axes**

▶ Open in succession:

■ <Axis name>

■ **Encoder**

■ **Diagnosis**

▶ To display the signals and values, move the encoder

### 16.6.2 Diagnostics for encoders with EnDat interface

You can check the encoders with EnDat interface for proper functioning by reading out the errors or warnings and by evaluating their functional reserves.

Depending on the encoder, not all of the functional reserves and messages are supported.

#### Functional reserves

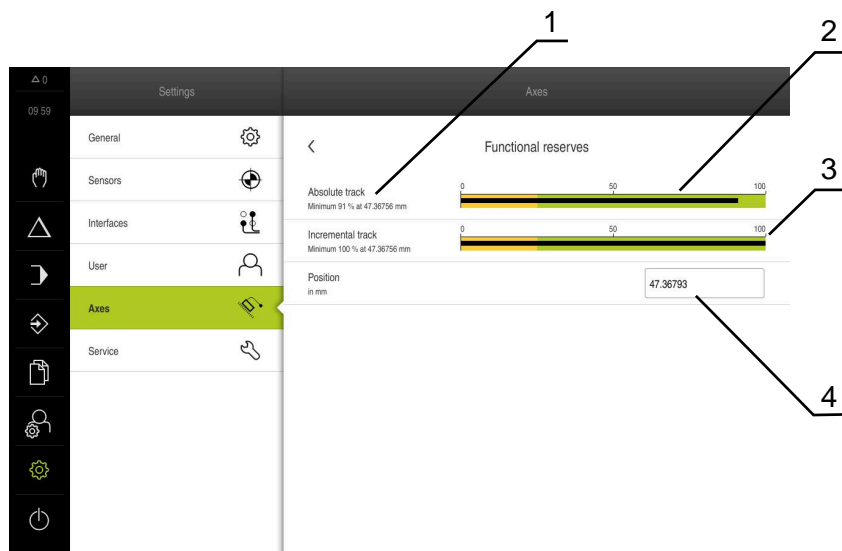


Figure 52: Example of functional reserves of a length gauge

- 1 Minimum percentage value of functional reserves at this specific position
- 2 Absolute track
- 3 Incremental track
- 4 Current position of encoder

The following functional reserves are displayed for absolute encoders with EnDat interface:

- **Absolute track**
- **Incremental track**
- **Position value calculation**

The product displays the functional reserves in a bar graph:

Color	Range	Evaluation
Yellow	0 % ... 25 %	Servicing/maintenance recommended
Green	25 % ... 100 %	The encoder is within the specification



► Tap **Settings** in the main menu





- ▶ Tap **Axes**
- ▶ Open in succession:
  - <Axis name>
  - **Encoder**
  - **Diagnosis**
  - **Functional reserves**
- ▶ To display the **Functional reserves**, move the encoder

### Errors and warnings

The messages displayed by the product for the serial interface are classified as follows:

Message	Description
Encoder error	Encoder errors indicate a malfunction of the encoder Examples of encoder errors that may be displayed: <ul style="list-style-type: none"> <li>■ Failure of the light unit</li> <li>■ Incorrect signal amplitude</li> <li>■ Incorrect position</li> <li>■ Overvoltage</li> <li>■ Undervoltage supply</li> <li>■ Overcurrent</li> <li>■ Battery failure</li> </ul>
Encoder warning	Encoder warnings indicate that certain tolerance limits of the encoder have been reached or exceeded Examples of encoder warnings that may be displayed: <ul style="list-style-type: none"> <li>■ Frequency collision</li> <li>■ Temperature exceedance</li> <li>■ Light-source control reserve</li> <li>■ Battery charge</li> <li>■ Reference point</li> </ul>

The messages can have the following status:

Status	Evaluation
<b>OK!</b>	The encoder is within the specification
<b>Not supported</b>	Message not supported by the encoder
<b>Error!</b>	Servicing/maintenance recommended; detailed analyses recommended (e.g., with PWT 101)



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Axes**
- ▶ Open in succession:
  - <Axis name>
  - **Encoder**
  - **Diagnosis**
- > Errors and warnings are displayed

## 16.7 Restoring files and settings

You can restore saved files and settings to a device. The following sequence should be followed when restoring files and settings:

- Restore OEM-specific folders and files
- Restore user files
- Restore settings

An automatic restart of the product is performed only after the settings have been restored.

### 16.7.1 Restore OEM-specific folders and files

Backed-up OEM-specific folders and files of the product can be loaded onto a device. This allows you to restore the configuration of a device while restoring the settings.

**Further information:** "Restore settings", Page 292

If servicing becomes necessary, an exchange unit can thus be operated with the configuration of the failed unit once the settings have been restored, provided that both units use the same or compatible firmware versions.



- ▶ Tap **Settings** in the main menu



- ▶ Tap **Service**
- ▶ Tap **OEM area**
- ▶ Open in succession:
  - **Back up and restore**
  - **Restore OEM specific folders and files**
- ▶ Tap **Load as ZIP**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Navigate to the folder containing the backup file
- ▶ Select the backup file
- ▶ Tap **Select**
- ▶ Confirm the successful transfer with **OK**



There is no automatic restart when the OEM-specific folders and files are restored. A restart is performed when the settings are restored.

**Further information:** "Restore settings", Page 292

- ▶ To restart the product with the transferred OEM-specific folders and files, switch the product off and then back on

### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations
- ▶ Tap **Safely remove**
- ▶ The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device




### 16.7.2 Restore user files

Backed-up user files of the product can be loaded into the product again. Existing user files will be overwritten. This, together with the restoring of the settings, enables you to restore the complete configuration of a unit.

**Further information:** "Restore settings", Page 292

If servicing becomes necessary, a replacement unit can be operated with the configuration of the failed unit after restoring. This requires that the version of the old firmware matches that of the new firmware or that the versions are compatible.

 All files from all user groups that are stored in the respective folders are backed up and can be restored as user files.  
The files in the **System** folder are not restored.



- ▶ Tap **Settings** in the main menu

- ▶ Open in succession:



- ▶ Tap **Service**

- ▶ Open in succession:

- **Back up and restore**

- **Restore user files**

- ▶ Tap **Load as ZIP**


- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product

- ▶ Navigate to the folder containing the backup file

- ▶ Select the backup file

- ▶ Tap **Select**

- ▶ Confirm the successful transfer with **OK**

 There is no automatic restart when the user files are restored. A restart is performed when the settings are restored.  
"Restore settings"

- ▶ To restart the product with the transferred user files, switch the product off and then back on

#### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu

- ▶ Navigate to the list of storage locations



- ▶ Tap **Safely remove**

- ▶ The message "**The storage medium can be removed now.**" appears

- ▶ Disconnect the USB mass storage device

### 16.7.3 Restore settings

Backed-up settings can be restored to the product. The current configuration of the product is replaced in the process.



Software options that were active when the settings were backed up must be activated before restoring the settings.

A restore can be necessary in the following cases:

- During commissioning, the settings are set on a product and transferred to all identical products

**Further information:** "Steps for commissioning", Page 94

- After a reset, the settings are copied back to the product

**Further information:** "Reset all settings", Page 293



- ▶ Tap **Settings** in the main menu
- ▶ Open in succession:
  - **Service**
  - **Back up and restore**
  - **Restore settings**
- ▶ Tap **Complete restoration**
- ▶ If required, connect a USB mass storage device (FAT32 format) to a USB port of the product
- ▶ Navigate to the folder containing the backup file
- ▶ Select the backup file
- ▶ Tap **Select**
- ▶ Confirm the successful transfer with **OK**
- > The system is shut down
- ▶ To restart the product with the transferred configuration data, switch the product off and then back on

#### Safely removing a USB mass storage device



- ▶ Tap **File management** in the main menu
- ▶ Navigate to the list of storage locations
- ▶ Tap **Safely remove**
- > The message "**The storage medium can be removed now.**" appears
- ▶ Disconnect the USB mass storage device



## 16.8 Reset all settings

You can reset the settings of the product to the factory defaults if required. The software options are deactivated and must be subsequently reactivated with the available license key.



- ▶ Tap **Settings** in the main menu
- ▶ Tap **Service**
- ▶ Open in succession:
  - **Reset**
  - **Reset all settings**
- ▶ Enter password
- ▶ Confirm the entry with **RET**
- ▶ To show the password in plain text, activate **Show password**
- ▶ Tap **OK** to confirm the action
- ▶ Tap **OK** to confirm the reset
- ▶ Tap **OK** to confirm shutdown of the device
- > The product is shut down
- > All settings are reset
- > To restart the product, switch it off and then back on

## 16.9 Reset to shipping conditions

You can reset the settings of the product to the factory defaults and delete the user files from product's memory area. The software options are deactivated and must be subsequently reactivated with the available license key.



- ▶ Tap **Settings** in the main menu
- ▶ Tap **Service**
- ▶ Open in succession:
  - **Reset**
  - **Reset to shipping conditions**
- ▶ Enter password
- ▶ Confirm the entry with **RET**
- ▶ To show the password in plain text, activate **Show password**
- ▶ Tap **OK** to confirm the action
- ▶ Tap **OK** to confirm the reset
- ▶ Tap **OK** to confirm shutdown of the device
- > The product is shut down
- > All settings are reset and the user files are deleted
- > To restart the product, switch it off and then back on



# 17

**What to do if ...**

## 17.1 Overview

This chapter describes the causes of faults or malfunctions of the product and the appropriate corrective actions.



Make sure that you have read and understood the "Basic operation" chapter before carrying out the actions described below.

**Further information:** "Basic operation", Page 57

## 17.2 System or power failure

Operating system data can be corrupted in the following cases:

- System or power failure
- Switching off the product without shutting down the operating system

If the firmware is damaged, the product starts a Recovery System that displays short instructions on the screen.

With restoration, the Recovery System overwrites the damaged firmware with a new firmware previously saved to a USB mass storage device. During this procedure the settings of the product are deleted.

### 17.2.1 Restoring the firmware

- ▶ On a computer, create the folder "heidenhain" on a USB mass storage device (FAT32 format).
- ▶ In the "heidenhain" folder, create the folder "update"
- ▶ Copy the new firmware to the "update" folder
- ▶ Rename the firmware "recovery.dro"
- ▶ Switch off the product
- ▶ Connect a USB mass storage device to a USB port of the product
- ▶ Switch on the product
- > The product starts the Recovery System
- > The USB mass storage device is detected automatically
- > The firmware is installed automatically
- > After a successful update, the firmware is automatically renamed "recovery.dro.[yyyy.mm.dd.hh.mm]"
- ▶ Restart the product on completion of the installation
- > The product starts up with the factory defaults



### 17.2.2 Restore settings

Reinstalling the firmware resets the product to the factory defaults. This deletes the setting, including the error compensation values and the activated software options.

To restore settings, you must either reconfigure them on the unit yourself or restore previously backed up settings on the unit.

**i** Software options that were active when the settings were backed up must be activated before restoring the settings on the product.

- ▶ Activating software options

**Further information:** "Activating the Software options", Page 96

- ▶ Restoring settings

**Further information:** "Restore settings", Page 292

## 17.3 Malfunctions

If faults or malfunctions that are not listed in the "Troubleshooting" table below occur during operation, refer to the machine tool builder's documentation or contact a HEIDENHAIN service agency.

### 17.3.1 Troubleshooting

**i** The following troubleshooting steps must be performed only by the personnel indicated in the table.  
**Further information:** "Personnel qualification", Page 29

Fault	Cause of fault	Correction of fault	Personnel
The status LED remains dark after switch-on	There is no supply voltage	▶ Check the power cable	Electrical specialist
	The product does not function properly	▶ Contact a HEIDENHAIN service agency	Qualified personnel
A blue screen appears when the unit starts up	Firmware error during startup	▶ If this fault occurs for the first time, switch the product off and then on again ▶ If the fault recurs, contact a HEIDENHAIN service agency	Qualified personnel
After startup, the product does not recognize any entries made on the touchscreen	Incorrect hardware initialization	▶ Switch the product off and then on again	Qualified personnel
Axes do not count despite movement of the encoder	Incorrect connection of the encoder	▶ Correct the connection ▶ Contact the encoder manufacturer's service agency	Qualified personnel
Axes are miscounting	Incorrect settings of the encoder	▶ Check the encoder settings Page 104	Qualified personnel

<b>Fault</b>	<b>Cause of fault</b>	<b>Correction of fault</b>	<b>Personnel</b>
Axes cannot be moved	Incorrect axis settings	▶ Check the axis settings	Qualified personnel
	Feed-rate override is at zero	▶ Check position of the feed rate override potentiometer	Qualified personnel
Positioning error	Incorrect axis settings	▶ Check the axis settings	Qualified personnel
Standstill error	Incorrect axis settings	▶ Check the axis settings	Qualified personnel
Axis cannot be move with the jog buttons	Incorrect axis settings	▶ Check the axis settings	Qualified personnel
	Incorrect operating mode (MDI mode, programming)	▶ Check the operating mode	Qualified personnel
	Feed rate override is at zero	▶ Check position of the feed rate override potentiometer	Qualified personnel
Feed rate override does not limit the axis speed	Incorrect feed rate override settings	▶ Check the axis settings	Qualified personnel
Rapid traverse key does not work	Incorrect rapid traverse settings	▶ Check settings Page 238	Qualified personnel
External axis error	External peripherals	▶ Conduct a systematic error search	Qualified personnel, possibly OEM
Spindle error	Incorrect settings of the spindle axis	▶ Check the settings of the spindle axes Page 261	Qualified personnel, possibly OEM
	External peripherals	▶ Perform systematic error search	Qualified personnel, possibly OEM
Spindle stop	External peripherals	▶ Conduct a systematic error search	Qualified personnel, possibly OEM
Cycles cannot be started with Cycle Start	Incorrect setting of <b>Automatic feed</b>	▶ Check settings Page 238	Qualified personnel
Cycle start key lighting does not work	Incorrect setting of <b>Autostart light</b>	▶ Check settings Page 240	Qualified personnel
Reversal during thread cutting does not work	Incorrect setting of <b>Spindle sleeve final position +/-</b>	▶ Check settings	Qualified personnel
Automatic traversing to the limit switch does not work	Incorrect setting of <b>Software limit switches</b> or <b>Automatic feed</b>	▶ Check settings Page 260 Page 238	Qualified personnel
Outside of software limit switches	Incorrect setting of <b>Software limit switches</b>	▶ Check settings Page 260	Qualified personnel
Emergency stop	External peripherals	▶ Conduct a systematic error search	Qualified personnel, possibly OEM

<b>Fault</b>	<b>Cause of fault</b>	<b>Correction of fault</b>	<b>Personnel</b>
Control voltage is missing	External peripherals	<ul style="list-style-type: none"> <li>▶ Conduct a systematic error search</li> </ul>	Qualified personnel, possibly OEM
Connection to the network is not possible	Defective connection	<ul style="list-style-type: none"> <li>▶ Check the cable and the correct connection to X116</li> </ul>	Qualified personnel
	Incorrect settings of the network	<ul style="list-style-type: none"> <li>▶ Check the network settings Page 144</li> </ul>	Qualified personnel
The connected USB mass storage device is not detected	Defective USB connection	<ul style="list-style-type: none"> <li>▶ Check the correct position of the USB mass storage device in the port</li> <li>▶ Use another USB port</li> </ul>	Qualified personnel
	The type or formatting of the USB mass storage device is not supported	<ul style="list-style-type: none"> <li>▶ Use another USB mass storage device</li> <li>▶ Format USB mass storage device with FAT32</li> </ul>	Qualified personnel
The unit starts in recovery mode (text only mode)	Firmware error during startup	<ul style="list-style-type: none"> <li>▶ If this fault occurs for the first time, switch the product off and then on again</li> <li>▶ If the fault recurs, contact a HEIDENHAIN service agency</li> </ul>	Qualified personnel
User login is not possible	Password does not exist	<ul style="list-style-type: none"> <li>▶ As user with higher permission level, reset the password Page 140</li> <li>▶ To reset the OEM password, contact the HEIDENHAIN service agency</li> </ul>	Qualified personnel



# 18

**Removal and  
disposal**

## 18.1 Overview

This chapter contains information and environmental protection specifications that must be observed for correct disassembly and disposal of the device.

## 18.2 Removal



Removal of the product must be performed only by qualified personnel.

**Further information:** "Personnel qualification", Page 29

Depending on the connected peripherals, the removal may need to be performed by an electrical specialist.

In addition, the same safety precautions that apply to the mounting and installation of the respective components must be taken.

### Removing the product

To remove the product, follow the installation and mounting steps in the reverse order.

**Further information:** "Installation", Page 45

**Further information:** "Mounting", Page 39

## 18.3 Disposal



### NOTICE

#### Incorrect disposal of the product!

Incorrect disposal of the product can cause environmental damage.

- ▶ Do not dispose of electrical waste and electronic components in domestic waste
- ▶ The integrated backup battery must be disposed of separately from the product
- ▶ Forward the product and the backup battery to recycling in accordance with the applicable local disposal regulations

- ▶ If you have any questions about the disposal of the product, please contact a HEIDENHAIN service agency

# 19

**Specifications**

## 19.1 Overview

This chapter contains an overview of the product data and drawings with the product dimensions and mating dimensions.

## 19.2 Product data

---

### Device

---

Housing	Aluminum milled housing
Housing dimensions	314 mm x 265 mm x 36 mm
Fastener system, mating dimensions	VESA MIS-D, 100 100 mm x 100 mm

---

### Display

---

Visual display unit	<ul style="list-style-type: none"> <li>■ LCD widescreen (16:10) color screen 30.7 cm (12.1")</li> <li>■ 1280 x 800 pixels</li> </ul>
Display step	Selectable, min. 0.00001 mm
User interface	User interface (GUI) with touchscreen

---

### Electrical data

---

Supply voltage	<ul style="list-style-type: none"> <li>■ AC 100 V ... 240 V (<math>\pm 10</math> %)</li> <li>■ 50 Hz ... 60 Hz (<math>\pm 5</math> %)</li> <li>■ For devices with ID 1089176-xx: Max. input power 38 W</li> <li>■ For devices with ID 1089177-xx: Max. input power 79 W</li> </ul>
Buffer battery	Lithium battery type CR2032; 3.0 V
Overvoltage category	II
Number of encoder inputs	Milling application mode: 4 (2 additional inputs can be enabled via software option) Turning application mode: 4
Encoder interfaces	<ul style="list-style-type: none"> <li>■ 1 V<sub>PP</sub>: maximum current 300 mA, max. input frequency 400 kHz</li> <li>■ 11 <math>\mu</math>A<sub>PP</sub>: maximum current 300 mA, max. input frequency 150 kHz</li> <li>■ EnDat 2.2: maximum current 300 mA</li> </ul>
Interpolation at 1 V <sub>PP</sub>	4096-fold
Touch probe connection	<ul style="list-style-type: none"> <li>■ Voltage supply DC 5 V or DC 12 V</li> <li>■ 5 V or floating switching output</li> <li>■ Max. cable length with HEIDENHAIN cable 30 m</li> </ul>

---



---

**Electrical data**


---

Digital inputs	TTL DC 0 V ... +5 V									
	<table> <thead> <tr> <th>Level</th> <th>Voltage range</th> <th>Current range</th> </tr> </thead> <tbody> <tr> <td>High</td> <td>DC 11 V ... 30 V</td> <td>2.1 mA ... 6.0 mA</td> </tr> <tr> <td>Low</td> <td>DC 3 V ... 2.2 V</td> <td>0.43 mA</td> </tr> </tbody> </table>	Level	Voltage range	Current range	High	DC 11 V ... 30 V	2.1 mA ... 6.0 mA	Low	DC 3 V ... 2.2 V	0.43 mA
Level	Voltage range	Current range								
High	DC 11 V ... 30 V	2.1 mA ... 6.0 mA								
Low	DC 3 V ... 2.2 V	0.43 mA								
Digital outputs	TTL DC 0 V ... +5 V Maximum load 1 k $\Omega$ Voltage range DC 24 V (20.4 V ... 28.8 V) Output current max. 150 mA per channel									
Relay outputs	For devices with ID 1089177-xx: <ul style="list-style-type: none"> <li>■ Max. switching voltage AC 30 V / DC 30 V</li> <li>■ Max. switching current 0.5 A</li> <li>■ Max. switching capacity 15 W</li> <li>■ Max. continuous current 0.5 A</li> </ul>									
Analog inputs	For devices with ID 1089177-xx: Voltage range DC 0 V ... +5 V Resistance 100 $\Omega$ $\leq$ R $\leq$ 50 k $\Omega$									
Analog outputs	For devices with ID 1089177-xx: Voltage range DC -10 V ... +10 V Maximum load 1 k $\Omega$									
5 V voltage outputs	Voltage tolerance $\pm$ 5 %, maximum current 100 mA									
Data interface	<ul style="list-style-type: none"> <li>■ 4 USB 2.0 Hi-Speed (Type A), maximum current 500 mA per USB connection</li> <li>■ 1 Ethernet 10/100 Mbit/1 Gbit (RJ45)</li> </ul>									

---

**Environment**


---

Operating temperature	0 °C to +45 °C
Storage temperature	-20 °C to +70 °C
Relative air humidity	10 % to 80 % RH, non-condensing
Altitude	$\leq$ 2000 m

---

**General information**


---

Directives	<ul style="list-style-type: none"> <li>■ EMC Directive 2014/30/EU</li> <li>■ Low Voltage Directive 2014/35/EU</li> <li>■ RoHS Directive 2011/65/EU</li> </ul>
Pollution degree	2
Protection EN 60529	<ul style="list-style-type: none"> <li>■ Front panel and side panels: IP 65</li> <li>■ Rear panel: IP 40</li> </ul>
Mass	<ul style="list-style-type: none"> <li>■ 3.5 kg</li> <li>■ With Single-Pos stand: 3.6 kg</li> <li>■ With Duo-Pos stand: 3.8 kg</li> <li>■ With Multi-Pos stand: 4.5 kg</li> <li>■ With Multi-Pos holder: 4.1 kg</li> </ul>

### 19.3 Product dimensions and mating dimensions

All dimensions in the drawings are in millimeters.

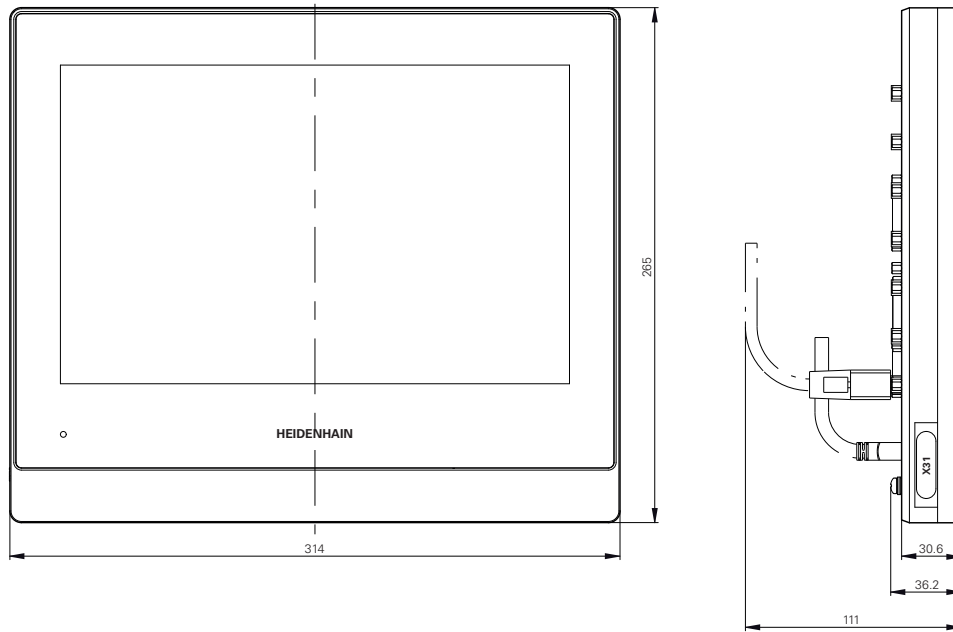


Figure 53: Dimensions of housing

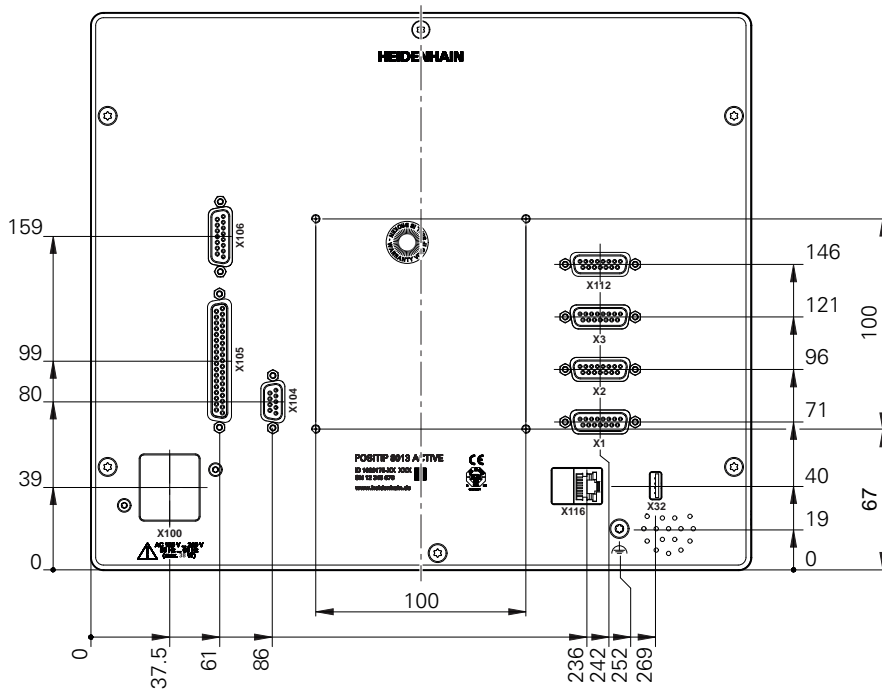


Figure 54: Dimensions of rear panel of the product

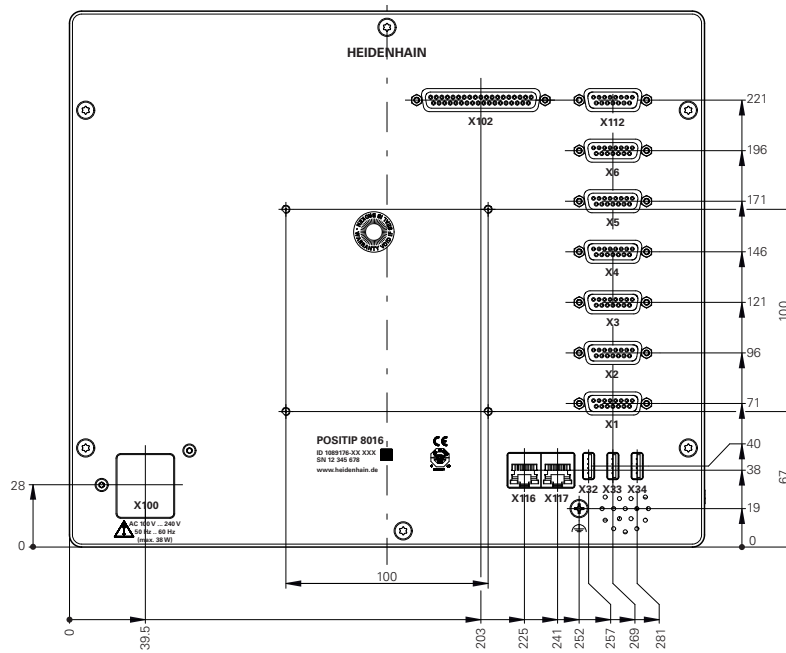


Figure 55: Dimensions of the rear panel for devices with ID 1089176-xx

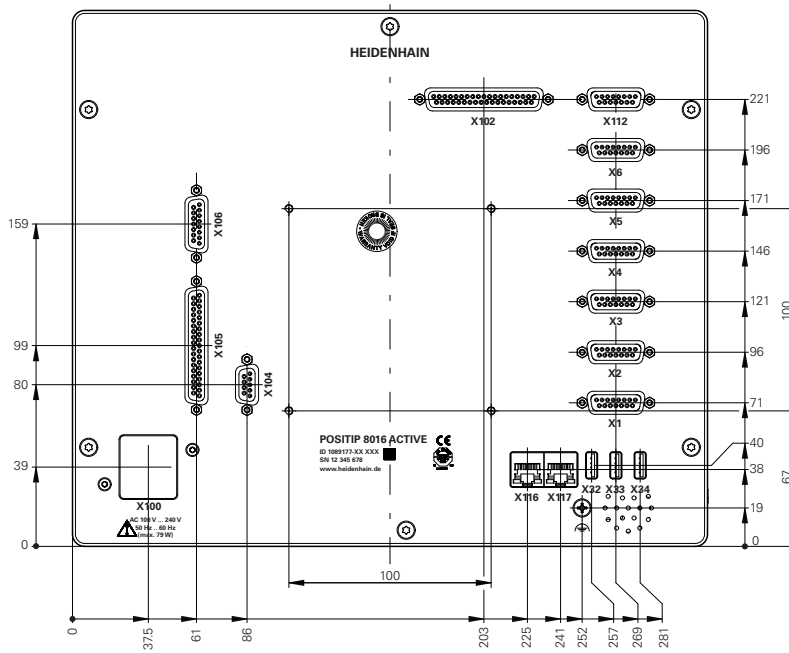


Figure 56: Dimensions of the rear panel for devices with ID 1089177-xx

### 19.3.1 Product dimensions with Single-Pos stand

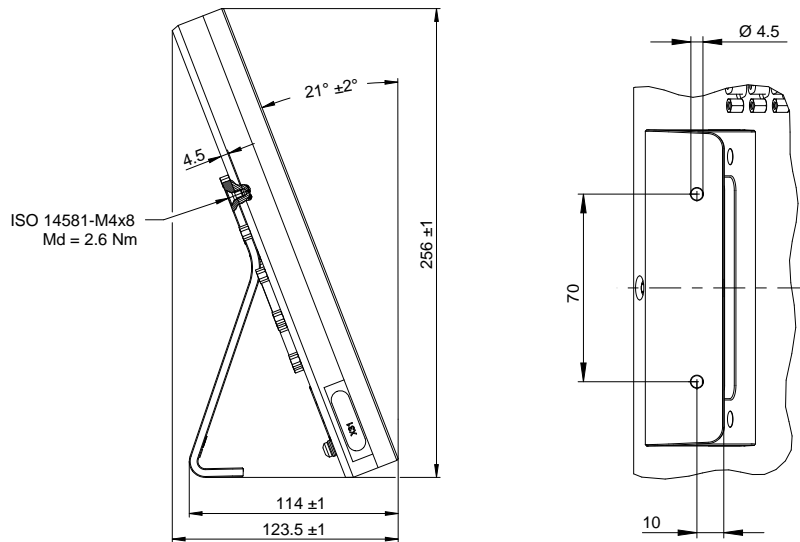


Figure 57: Product dimensions with Single-Pos stand

### 19.3.2 Product dimensions with Duo-Pos stand

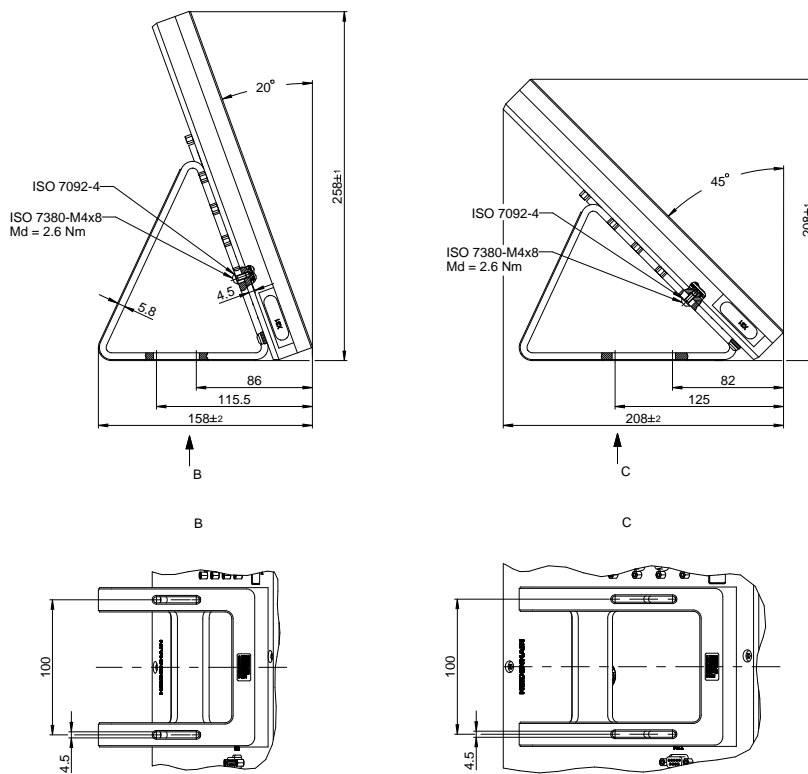


Figure 58: Product dimensions with Duo-Pos stand

### 19.3.3 Product dimensions with Multi-Pos stand

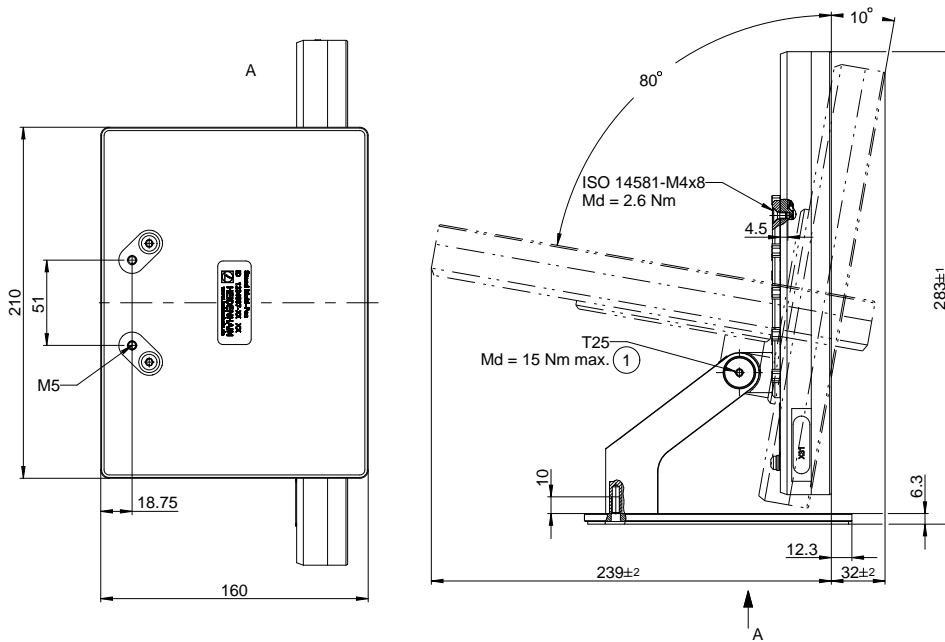


Figure 59: Product dimensions with Multi-Pos stand

### 19.3.4 Product dimensions with Multi-Pos holder

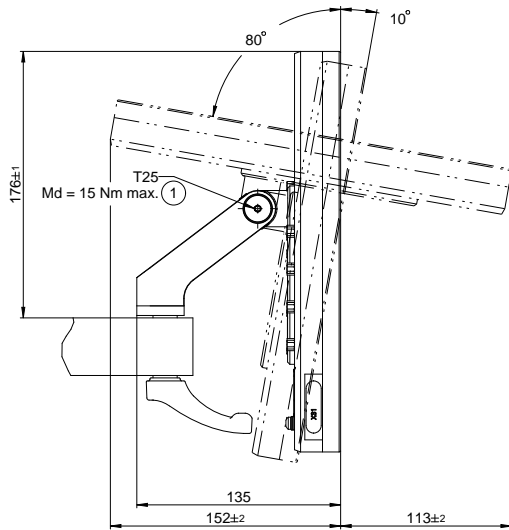


Figure 60: Product dimensions with Multi-Pos holder

## 20 Index

- A**
- Accessories..... 35
  - Adding a startup screen..... 119
  - Ambient conditions..... 305
  - Application, selecting..... 96
  - Assembly..... 40
  - Audio feedback..... 90
  - axes..... 104
    - Settings..... 244
- B**
- Backing up user files..... 133, 152
  - Basic configuration
    - Axis + NC..... 113
    - electronic handwheel..... 114
    - Spindle axis..... 111
  - Block types..... 203
- C**
- Cleaning the screen..... 282
  - Code number..... 64
  - commissioning..... 94
  - Computer..... 54
  - Configuring
    - network drive..... 145
    - Presets..... 149
    - touchscreen..... 146
    - USB keyboard..... 146
  - Configuring network settings... 144
  - Configuring the OEM logo..... 121
  - Connecting encoders..... 50
  - Connection
    - Computer..... 54
  - Connection overview..... 47
  - Contour view..... 188, 197, 210
    - detail view..... 198
    - overview..... 198
  - Coordinate system
    - Defining presets..... 175
    - In program..... 203
  - Coupled axis..... 115
- D**
- Damage in transit..... 36
  - date and time..... 99, 140, 227
  - decimal places..... 99, 140, 228
  - Decimal separators..... 228
  - Device
    - installing..... 46
  - Diagnostics
    - Errors and warnings..... 289
    - Functional reserves..... 288
  - Diagnostics for encoders with.. 253
  - Diagnostics for encoders with EnDat interface..... 251
  - Diameter axis..... 242
  - Documentation
    - Addendum..... 20
    - download..... 19
    - OEM..... 119
  - Dragging..... 59
  - Duo-Pos..... 42
- E**
- Electrical specialist..... 29
  - Electronic handwheel..... 259
  - Encoders
    - Axis parameter configuration (1 Vpp, 11  $\mu$ App)..... 104
    - Configuring axis parameters (EnDat)..... 102
    - energy saving mode..... 62
  - Error compensation
    - linear error compensation... 108, 254
    - Methods..... 107
    - performing..... 107
    - segmented linear error compensation..... 109, 254
    - Table of supporting points... 255
  - Error messages..... 88, 126
    - configuring..... 129
    - deleting..... 129
  - Errors and warnings..... 289
  - Example
    - Finishing the outside
      - contour..... 165
      - preset..... 161
    - Roughing the outside
      - contour..... 161
      - Setting up the lathe..... 158
      - Stud bolt drawing..... 155
      - Thread..... 168
      - Turning the chamfer..... 165
      - Turning the recess..... 164
      - Workpiece..... 154
- F**
- Feed-rate value
    - Setting..... 86
  - File
    - copying..... 217
    - deleting..... 217
    - exporting..... 218
    - importing..... 219
    - moving..... 216
    - Opening..... 218
    - renaming..... 217
  - File management
    - file types..... 215
    - Menu..... 75
    - Short description..... 214
  - Firmware update..... 284
  - Folder
    - copying..... 216
    - creating..... 215
    - deleting..... 217
    - moving..... 216
    - renaming..... 216
  - Folders
    - managing..... 215
  - Folder structure..... 215
  - Functional reserves..... 288
- G**
- Geared spindles..... 110
  - Gear stages
    - configuring..... 267
  - Gestures
    - Dragging..... 59
    - Holding..... 59
    - Operation..... 58
    - Tapping..... 58
  - Ground connection, 3-wire cable 55
- H**
- Handwheel..... 259
  - HEIDENHAIN encoders..... 101
  - Holding..... 59
- I**
- Informational notes..... 24
  - Input devices
    - connect..... 54
    - Operation..... 58
  - Installation..... 46
  - Installation Instructions..... 20
  - Items supplied..... 34
- L**
- Language
    - setting..... 65, 93, 137
  - Lathe
    - Tool measurement..... 159
  - License key
    - Activating..... 97
    - Entering..... 98
    - requesting..... 96
  - linear error compensation (LEC)..... 108
  - Lissajous figure..... 286
- M**
- Machining block
    - Mirroring..... 84
    - Scaling..... 84
  - Main menu..... 67
  - Maintenance plan..... 283
  - Malfunctions..... 297
  - Managing programs..... 211
  - Manual operation..... 69

menu.....	69	close.....	61	creating.....	207
MDI		confirm.....	61	creating program header.....	208
menu.....	70	drop-down list.....	61	deleting.....	212
MDI mode		Main menu.....	67	deleting blocks.....	208
Applying the scaling factor....		OEM bar.....	87	opening.....	199, 211
189,	198	plus/minus button.....	60	running (manual).....	195
Example.....	168	Screen keyboard.....	60	running (NC-controlled).....	195
Menu		slide switch.....	61	running (single block).....	195
File management.....	75	status bar.....	82	running blocks.....	212
manual operation.....	69, 172	toggle switch.....	61	saving.....	208, 211
MDI.....	70	undo.....	61	Using.....	193
MDI mode.....	180	Operating Instructions.....	20	Programming	
Programming.....	73, 202	updating.....	143	Menu.....	73
Program run.....	192	Operation		Short description.....	202
Settings.....	77	Audio feedback.....	90	Programming support.....	207
Switch-off.....	78	Energy saving mode.....	62	Program run.....	192
User login.....	76	General operation.....	58	Menu.....	72
Messages		Gestures and mouse actions.	58	Short description.....	192
closing.....	89	Messages.....	88		
viewing.....	88	Operating elements.....	60	<b>Q</b>	
M functions		Touchscreen and input		Qualified personnel.....	29
configuring.....	123, 241, 274	devices.....	58	Quick start.....	154
configuring.....	277	Wizard.....	89		
manufacturer-specific.....	118	Operator.....	29	<b>R</b>	
Overview.....	117	Override display.....	126	Reference mark search	
standard.....	118	Overview of new and modified		activating.....	116
mounting.....	40	functions.....	18	Conducting.....	174
Duo-Pos stand.....	42	<b>P</b>		performing after startup....	65, 93, 137, 174
Multi-Pos holder.....	44	Password.....	64	Repackaging.....	37
Multi-Pos stand.....	43	changing.....	94, 138, 142	rounding methods.....	99, 140, 228
Single-Pos stand.....	41	creating.....	141		
Mouse actions		default password....	64, 92, 136, 155	<b>S</b>	
configuring.....	146	Personnel qualification.....	29	Safety precautions.....	24, 28
Dragging.....	59	Pin layout		general.....	30
Holding.....	59	encoders.....	50	Peripheral devices.....	30
Operation.....	58	line voltage.....	55	ScreenshotClient	
Tapping.....	58	network.....	55	Information.....	131
Multi-Pos.....	43, 44	switching inputs.....	51	Segmented linear error	
<b>O</b>		Power connector.....	55	compensation (SLEC).....	109
Obligations of the operating		Preset		Settings	
company.....	29	Probing.....	86	Backing up.....	132, 151
OEM		Preset table		Menu.....	77
adding documentation.....	119	Creating.....	149	quick access menu.....	84
Adding messages.....	278	Product		Restore.....	292
adjusting display.....	126	commissioning.....	94	Setup.....	139
defining keyboard design....	126	Setting up.....	139	Simulation window.....	196
Deleting the startup screen	271	Switch-off.....	63	activating.....	198
modifying startup screen....	119	Switch-on.....	62	Single-Pos.....	41
OEM bar.....	87	Product data.....	304	Spindle	
Configuring.....	120	Program		Configuring inputs and	
configuring M functions.....	123	aborting program run.....	196	outputs.....	110
displaying OEM logo.....	121	adding blocks.....	208	spindle axis.....	110
Functions.....	87	Applying the scaling factor....	189,	Spindle speed	
Operating elements.....	87	189,	198	programming.....	88
Operating elements		closing.....	199, 211	setting.....	87
add.....	61	control blocks.....	196	Status bar.....	82
back.....	62			adjusting the quick access	

menu.....	84
Calculator.....	85
Feed rate.....	86
operating elements.....	82
Stop watch.....	85
Storage.....	37
Switch-off	
Menu.....	78
Symbols and fonts used for marking text.....	25
Symbols on the product.....	30

**T**

Table of supporting points	
adjusting.....	110
creating.....	108, 109
Tapping.....	58
Text database	
Creating.....	127
Thread cutting.....	117
Tool table	
Creating.....	157
Touchscreen	
configuring.....	146
Operation.....	58

**U**

Units	
Setting.....	84
units of measure.....	99, 140, 228
Uploading license file.....	98
USB keyboard.....	146
User	
configuring.....	142
creating.....	141
Default password.....	64
Login.....	64
Logout.....	64
User login.....	63
user types.....	140
User files	
Restoring.....	291
User ID.....	141
User interface	
After start-up.....	66
Factory default setting.....	66
File management menu.....	75
Main menu.....	67
manual operation menu.....	69
MDI menu.....	70
Programming menu.....	73
Program run menu.....	72
Settings menu.....	77
Switch-off menu.....	78
User login menu.....	76
User login.....	63, 76
Users	
deleting.....	143

**W**

Wiring switching inputs and outputs.....	51
Wizard.....	89



## 21 List of figures

Figure 1:	Dimensions of the rear panel.....	40
Figure 2:	Product mounted on Single-Pos stand.....	41
Figure 3:	Cable routing on Single-Pos stand.....	41
Figure 4:	Product mounted on Duo-Pos stand.....	42
Figure 5:	Cable routing on Duo-Pos stand.....	42
Figure 6:	Product mounted on Multi-Pos stand.....	43
Figure 7:	Cable routing on Multi-Pos stand.....	43
Figure 8:	Product mounted on Multi-Pos holder.....	44
Figure 9:	Cable routing on Multi-Pos holder.....	44
Figure 10:	Rear panel of devices with ID 1089176-xx .....	48
Figure 11:	Rear panel of devices with ID 1089177-xx .....	49
Figure 12:	Screen keyboard.....	60
Figure 13:	The user interface in the product's factory default setting.....	66
Figure 14:	<b>Manual operation</b> menu.....	69
Figure 15:	<b>MDI</b> menu.....	70
Figure 16:	<b>Program run</b> menu.....	72
Figure 17:	<b>Programming</b> menu.....	73
Figure 18:	<b>Programming</b> menu with opened simulation window.....	74
Figure 19:	<b>File management</b> menu.....	75
Figure 20:	<b>User login</b> menu.....	76
Figure 21:	<b>Settings</b> menu.....	77
Figure 22:	Support from the wizard for action steps.....	89
Figure 23:	Example – XML file for text database.....	127
Figure 24:	The ScreenshotClient user interface.....	131
Figure 25:	Example workpiece.....	154
Figure 26:	Example workpiece – technical drawing.....	155
Figure 27:	Finishing tool parameters.....	158
Figure 28:	Preset.....	158
Figure 29:	Example workpiece – finding the preset.....	161
Figure 30:	Example workpiece – machining the thread.....	168
Figure 31:	<b>Manual operation</b> menu.....	172
Figure 32:	<b>Upper limit for spindle speed</b> dialog box.....	173
Figure 33:	<b>MDI</b> menu.....	181
Figure 34:	<b>Upper limit for spindle speed</b> dialog box.....	182
Figure 35:	Schematic depiction of the <b>Thread cutting (basic)</b> block .....	184
Figure 36:	Schematic depiction of the <b>Thread cutting (extended)</b> block.....	185
Figure 37:	Example of a block in <b>MDI</b> mode.....	187
Figure 38:	Simulation window with contour view.....	188
Figure 39:	<b>Distance to go with position</b> view with graphical positioning aid.....	189
Figure 40:	Example – MDI block.....	190
Figure 41:	Example – Execution of an MDI block with scaling factor.....	190
Figure 42:	Example of a program in the <b>Program run</b> operating mode.....	194
Figure 43:	Simulation window with contour view.....	197
Figure 44:	<b>Programming</b> menu.....	202

Figure 45:	Schematic depiction of the <b>Thread cutting (basic)</b> block .....	205
Figure 46:	Schematic depiction of the <b>Thread cutting (extended)</b> block.....	206
Figure 47:	Example of a program in the <b>Programming</b> operating mode.....	207
Figure 48:	Simulation window with contour view.....	210
Figure 49:	<b>File management</b> menu.....	214
Figure 50:	<b>File management</b> menu with preview image and file information.....	218
Figure 51:	Assignment of the rectangular coordinate system to the workpiece.....	236
Figure 52:	Example of functional reserves of a length gauge.....	288
Figure 53:	Dimensions of housing.....	306
Figure 54:	Dimensions of rear panel of the product.....	306
Figure 55:	Dimensions of the rear panel for devices with ID 1089176-xx.....	307
Figure 56:	Dimensions of the rear panel for devices with ID 1089177-xx.....	307
Figure 57:	Product dimensions with Single-Pos stand.....	308
Figure 58:	Product dimensions with Duo-Pos stand.....	308
Figure 59:	Product dimensions with Multi-Pos stand.....	309
Figure 60:	Product dimensions with Multi-Pos holder.....	309

# HEIDENHAIN

---

## DR. JOHANNES HEIDENHAIN GmbH

Dr.-Johannes-Heidenhain-Straße 5

**83301 Traunreut, Germany**

☎ +49 8669 31-0

FAX +49 8669 32-5061

E-mail: [info@heidenhain.de](mailto:info@heidenhain.de)

---

**Technical support** FAX +49 8669 32-1000

**Measuring systems** ☎ +49 8669 31-3104

E-mail: [service.ms-support@heidenhain.de](mailto:service.ms-support@heidenhain.de)

**NC support** ☎ +49 8669 31-3101

E-mail: [service.nc-support@heidenhain.de](mailto:service.nc-support@heidenhain.de)

**NC programming** ☎ +49 8669 31-3103

E-mail: [service.nc-pgm@heidenhain.de](mailto:service.nc-pgm@heidenhain.de)

**PLC programming** ☎ +49 8669 31-3102

E-mail: [service.plc@heidenhain.de](mailto:service.plc@heidenhain.de)

**APP programming** ☎ +49 8669 31-3106

E-mail: [service.app@heidenhain.de](mailto:service.app@heidenhain.de)

---

[www.heidenhain.de](http://www.heidenhain.de)

